
Barcelona Gardens Condominium

Typical elevations by building · Concrete and stucco repair locations

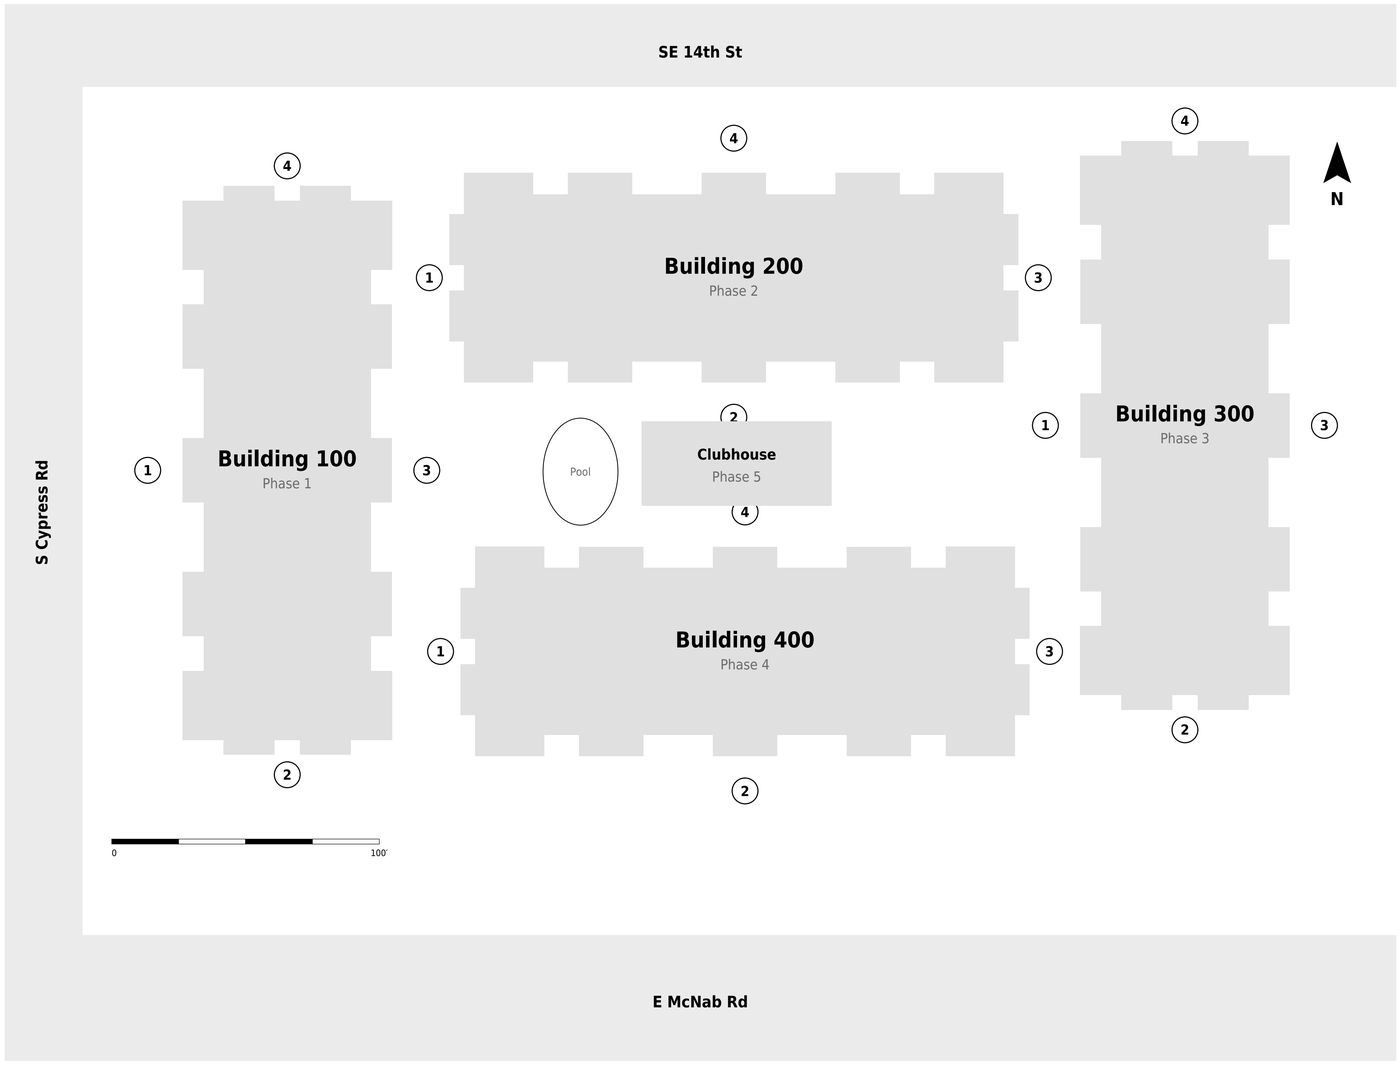

Site plan. Circled numbers show the elevation number of each face per the MTD phasing plan: 1 West, 2 South, 3 East, 4 North.

How to read these sheets

Each sheet shows two orthographic elevations of one building. Each repair has a circled number with a leader line pointing to its location on the face. The table on the same sheet gives the code, description, floor and plan distance to the nearest corridor door.

- ◯ Repair
- ● 15′-0″ or less from an exit
- ◌ Between 15′-0″ and 20′-0″ from an exit

NV5 drawing codes

B	Beam crack	**OH**	Overhead
B/E	Beam edge	**RS**	Rust spot
BL	Block crack	**FL**	Balcony floor (waterproofing)
BR	Cracked brick	**C**	Code not in NV5 legend
ST	Stucco	**CC**	Corner cracked
W	Wall	**Hatch**	Unlabeled spalling hatch
E	Edge		

To verify

- Building 400: NV5 sheet 2/4 labels the west-end units as 301 and 317.
- Buildings 300 and 400: sheets 4/4 have identical marks; Building 200 repeats the same ST.
- Building 400: waterproofing note at ground-floor balcony 409.
- Stairs: no drawing shows them.

Sheet index

E-000	Cover and index
E-101	Building 100 · elevations 1 West and 3 East
E-102	Building 100 · elevations 2 South and 4 North
E-201	Building 200 · elevations 2 South and 4 North
E-202	Building 200 · elevations 1 West and 3 East
E-301	Building 300 · elevations 1 West and 3 East
E-302	Building 300 · elevations 2 South and 4 North
E-401	Building 400 · elevations 2 South and 4 North
E-402	Building 400 · elevations 1 West and 3 East
E-501	Clubhouse · elevations 2 South and 4 North

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Cover and index
Typical elevations by building
Concrete and stucco repairs per NV5

Legend
- ◯ Repair
- ● 15′-0″ or less from an exit
- ◌ Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
As noted

Basis
NV5 drawings

Sheet
E-000

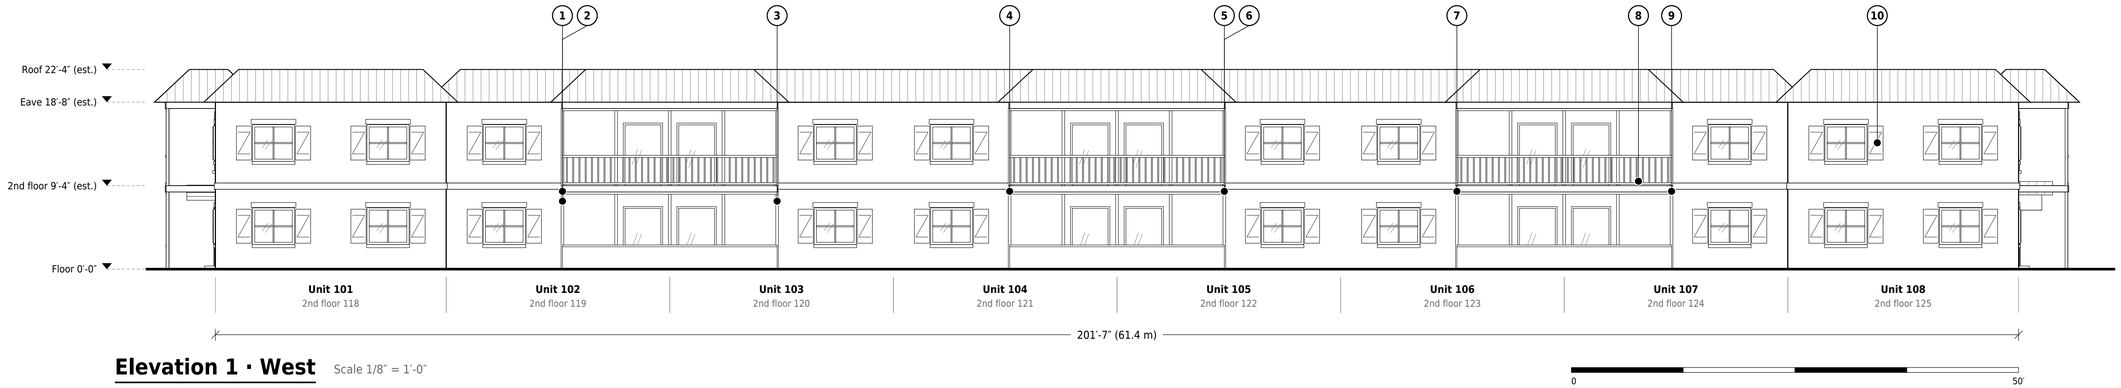

Elevation 1 · West

Scale 1/8″ = 1′-0″



Elevation 3 · East

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	**B**	Beam crack. Right column, balconies 103/102	Ground	54′-10″
2	**RS**	Rust, balcony 102	Ground	51′-0″
3	**RS**	Rust, balcony 103	Ground	71′-11″
4	**B**	Beam crack. Right column, balconies 105/104	Ground	96′-10″
5	**B**	Beam crack. Left column, balconies 105/104	Ground	96′-10″
6	**E**	Edge. Side edge, balcony 105	Ground	95′-5″
7	**B**	Beam crack. Right column, balconies 107/106	Ground	73′-9″
8	**FL**	Balcony 124 floor, waterproofing required	2nd	55′-2″
9	**B**	Beam crack. Left column, balconies 107/106	Ground	54′-10″
10	**ST**	Stucco, corner of unit 125	2nd	41′-10″
11	**B**	Beam crack. Left column, balconies 110/111	Ground	55′-5″
12	**BL**	Block crack between balconies 110/111	Ground	64′-5″
13	**B/E**	Beam edge, balcony 111	Ground	71′-11″
14	**B/E**	Beam edge, balcony 112	Ground	95′-5″
15	**B/E**	Beam edge, balcony 114	Ground	95′-5″
16	**B**	Beam crack. Right column, balconies 112/114	Ground	97′-3″
17	**B**	Beam crack. Left column, balconies 115/116	Ground	74′-3″
18	**B**	Beam crack. Right column, balconies 115/116	Ground	55′-5″
19	**B/E**	Beam edge, balcony 116	Ground	52′-9″
20	**BR/ST**	Cracked brick and stucco, wall of unit 116	Ground	47′-3″
21	**BR**	Cracked brick, wall of unit 117	Ground	40′-7″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 100 · Elevations 1 West and 3 East
Phase 1 · long faces

Key plan

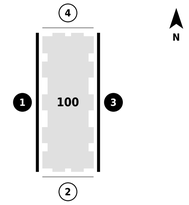

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004816.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″


Basis
NV5 BP25-00004816

Sheet
E-101



Elevation 2 · South

Scale 1/4″ = 1′-0″

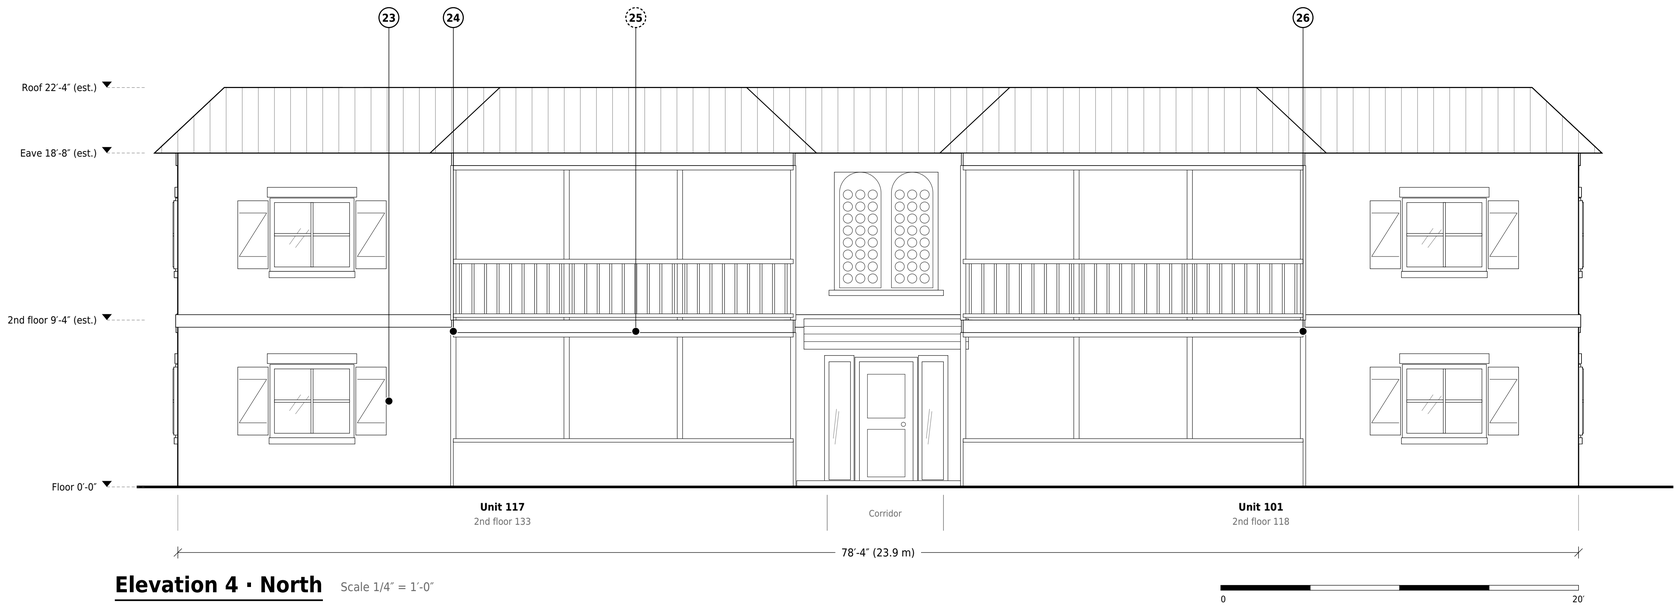

Elevation 4 · North

Scale 1/4″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
22	**B**	Beam crack. Corner of balcony 108	Ground	23′-11″
23	**ST/W**	Stucco at end wall of unit 117	Ground	27′-10″
24	**B**	Beam crack. Corner of balcony 117	Ground	24′-10″
25	**E/OH**	Overhead edge, balcony 117	Ground	15′-0″
26	**B**	Beam crack. Corner of balcony 101	Ground	23′-11″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 100 · Elevations 2 South and 4 North
Phase 1 · end faces

Key plan

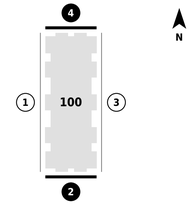

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004816.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″


Basis
NV5 BP25-00004816

Sheet
E-102

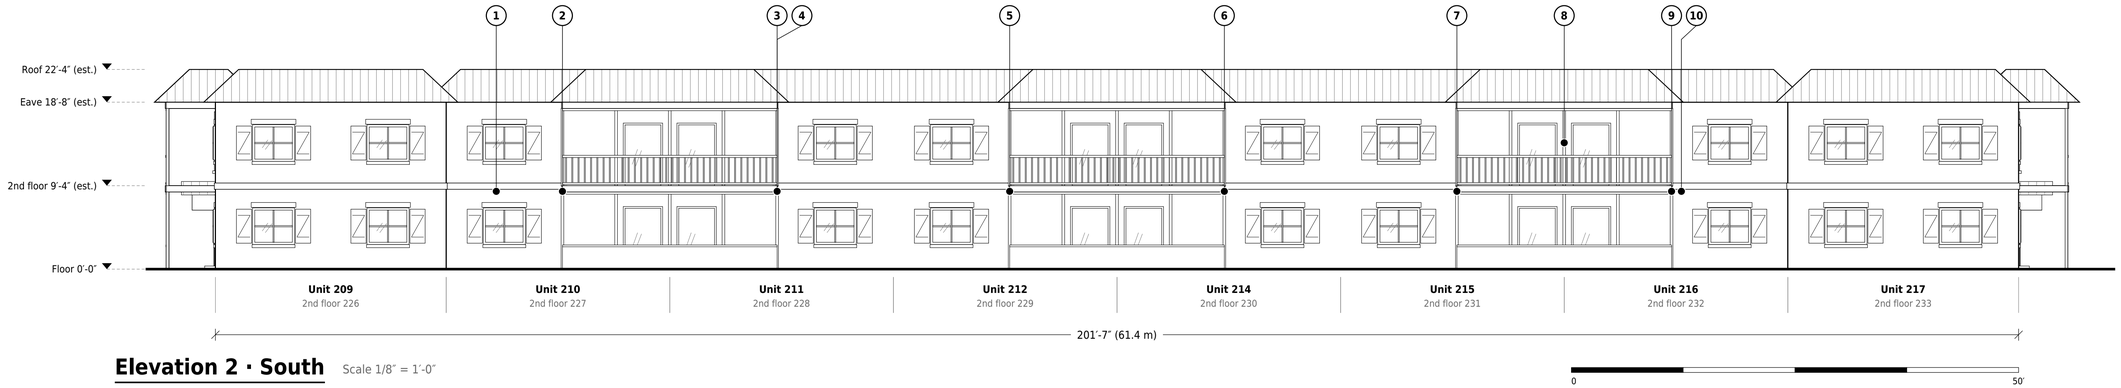

Elevation 2 · South

Scale 1/8″ = 1′-0″

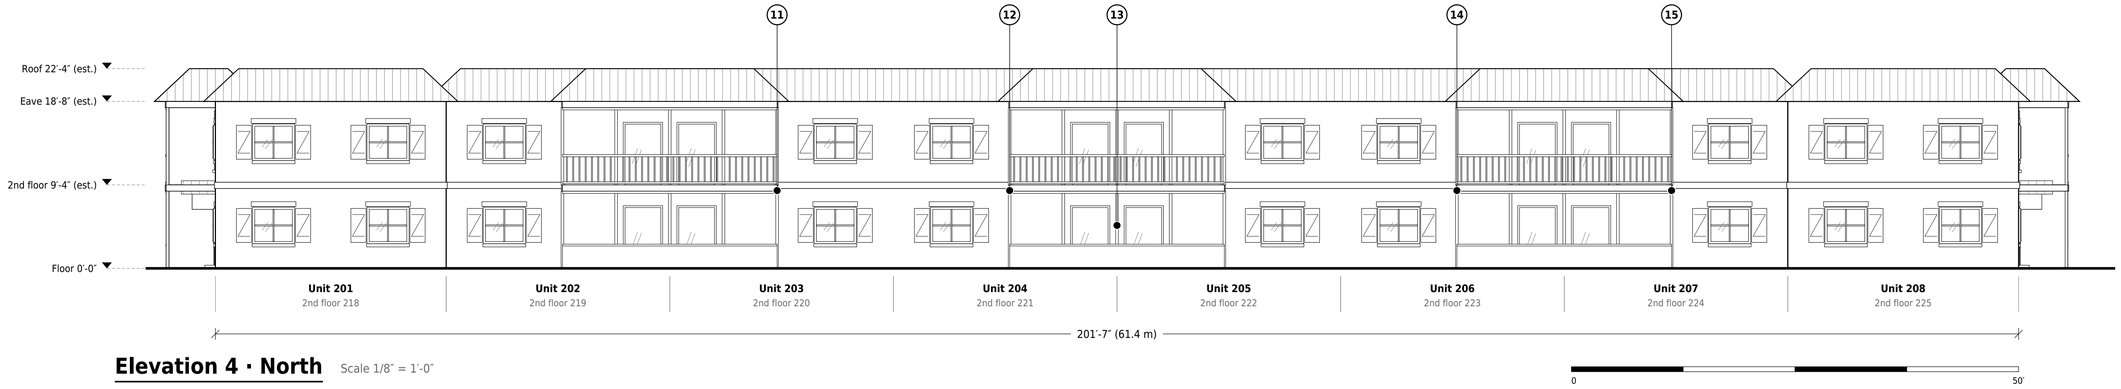

Elevation 4 · North

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B/E	Beam edge, wall of unit 210	Ground	44′-8″
2	B	Beam crack. Left column, balconies 210/211	Ground	55′-5″
3	B	Beam crack. Right column, balconies 210/211	Ground	74′-3″
4	B/E	Beam edge, balcony 211	Ground	71′-11″
5	B	Beam crack. Left column, balconies 212/214	Ground	97′-3″
6	B	Beam crack. Right column, balconies 212/214	Ground	97′-3″
7	B	Beam crack. Left column, balconies 215/216	Ground	74′-3″
8	ST	Stucco, column between balconies 231/232	2nd	64′-5″
9	B	Beam crack. Right column, balconies 215/216	Ground	55′-5″
10	B/E	Beam edge, balcony 216	Ground	50′-2″
11	B	Beam crack. Left column, balconies 203/202	Ground	73′-9″
12	B	Beam crack. Right column, balconies 205/204	Ground	96′-10″
13	ST	Stucco, center column of balconies 205/204	Ground	108′-0″
14	B	Beam crack. Right column, balconies 207/206	Ground	73′-9″
15	B	Beam crack. Left column, balconies 207/206	Ground	54′-10″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 200 · Elevations 2 South and 4 North
Phase 2 · long faces

Key plan

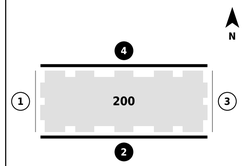

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00004987

Sheet
E-201



Elevation 1 · West

Scale 1/4″ = 1′-0″



Elevation 3 · East

Scale 1/4″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
16	B	Beam crack. Corner of balcony 208	Ground	23′-11″
17	ST	Stucco, balcony 208 next to west exit	Ground	**7′-0″**
18	B	Beam crack. Corner of balcony 209	Ground	24′-10″
19	B	Beam crack. Corner of balcony 217	Ground	24′-10″
20	B	Beam crack. Beam at wall of unit 217	Ground	23′-4″
21	RS	Rust, balcony 217	Ground	**10′-1″**
22	RS	Rust, balcony 217 next to east exit	Ground	**8′-7″**
23	B	Beam crack. Corner of balcony 201	Ground	23′-11″
24	ST	Stucco, end wall next to balcony 201	Ground	23′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 200 · Elevations 1 West and 3 East
Phase 2 · end faces

Key plan

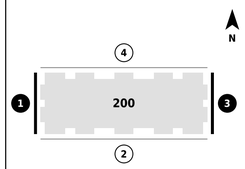

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″


Basis
NV5 BP25-00004987

Sheet
E-202

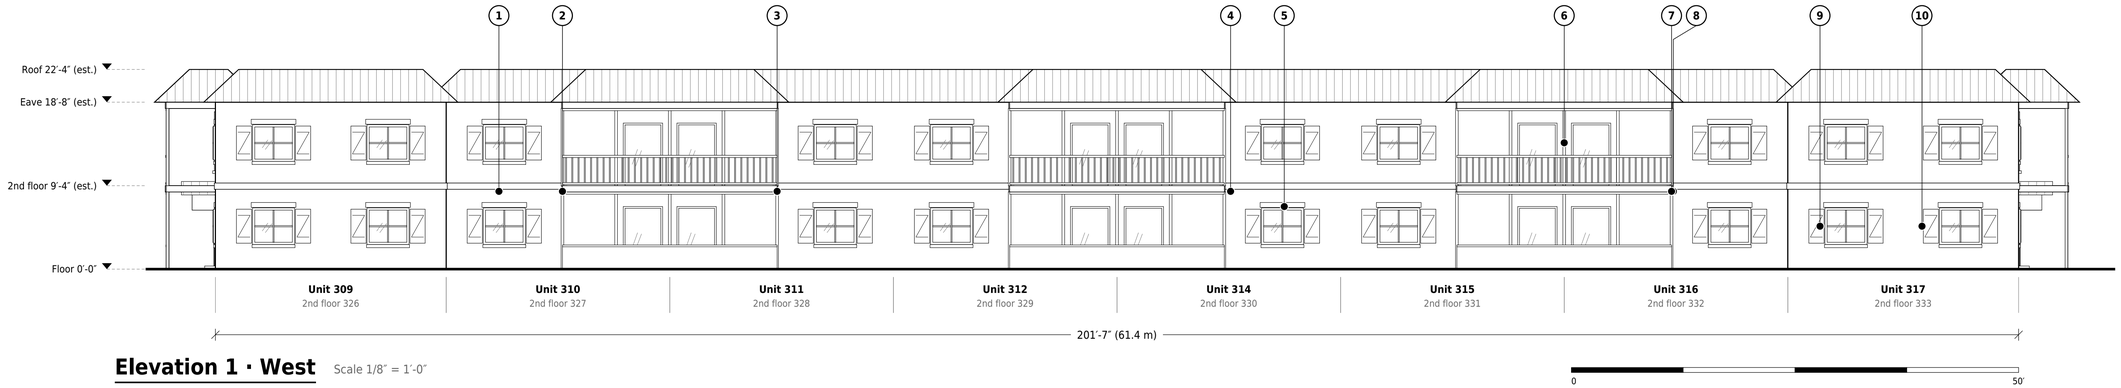

Elevation 1 · West

Scale 1/8″ = 1′-0″

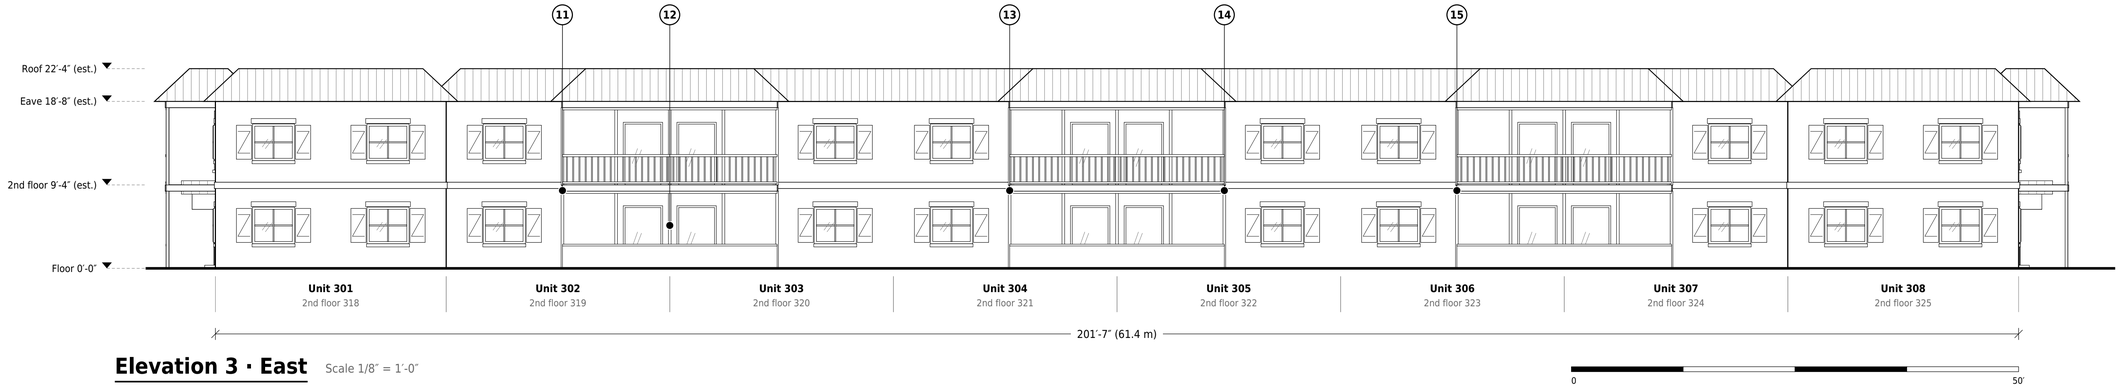

Elevation 3 · East

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B/E	Beam edge, wall of unit 310	Ground	44′-11″
2	B	Beam crack. Left column, balconies 310/311	Ground	55′-5″
3	B	Beam crack. Right column, balconies 310/311	Ground	74′-3″
4	B/E	Beam edge next to column of balconies 312/314	Ground	94′-3″
5	BR	Cracked brick veneer, wall of unit 315	Ground	88′-1″
6	ST	Stucco, column between balconies 331/332	2nd	64′-5″
7	B	Beam crack. Right column, balconies 315/316	Ground	55′-5″
8	B/E	Beam edge, balcony 316	Ground	51′-0″
9	ST	Stucco, wall of unit 317	Ground	45′-5″
10	ST	Stucco, wall of unit 317	Ground	41′-1″
11	B	Beam crack. Right column, balconies 303/302	Ground	54′-10″
12	ST	Stucco, center column of balconies 303/302	Ground	63′-10″
13	E	Edge, right column of balconies 305/304	Ground	96′-10″
14	B	Beam crack. Left column, balconies 305/304	Ground	96′-10″
15	B/E	Beam edge, balcony 306	Ground	71′-4″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 300 · Elevations 1 West and 3 East
Phase 3 · long faces

Key plan

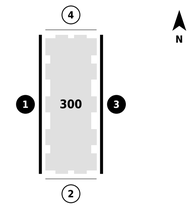

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00005001.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00005001

Sheet
E-301

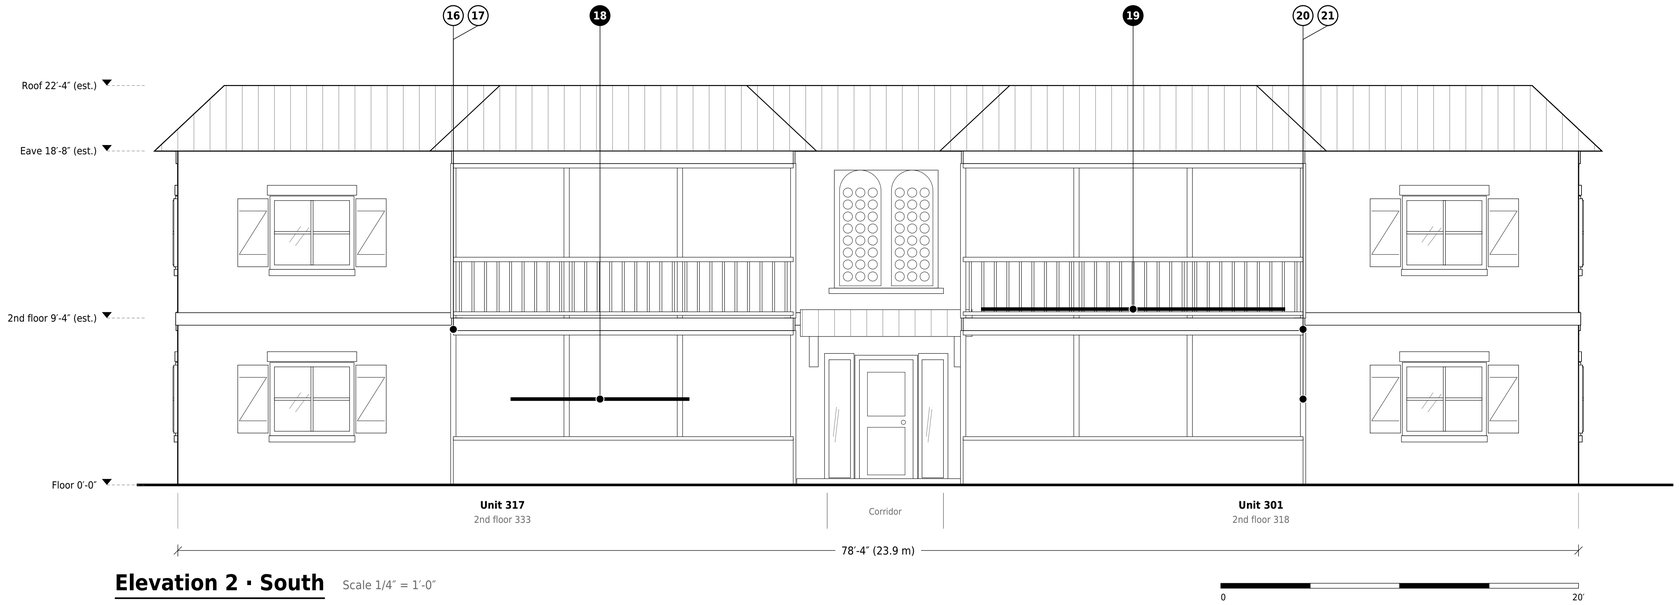

Elevation 2 · South

Scale 1/4″ = 1′-0″



Elevation 4 · North

Scale 1/4″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
16	**B**	Beam crack. Corner of balcony 317	Ground	24′-10″
17	**B/E**	Beam edge, balcony 317	Ground	24′-3″
18	**Hatch**	Unlabeled hatch at edge of balcony 317	Ground	**12′-4″**
19	**FL**	Balcony 318 floor, waterproofing required	2nd	**6′-0″**
20	**B**	Beam crack. Corner of balcony 301	Ground	23′-11″
21	**ST**	Stucco, end wall next to balcony 301	Ground	23′-4″
22	**C**	Code “C” (not in legend), balcony 308 next to north exit	Ground	**7′-0″**
23	**B/E**	Beam edge, corner of balcony 309	Ground	24′-10″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 300 · Elevations 2 South and 4 North
Phase 3 · end faces

Key plan

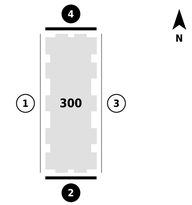

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00005001.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″


Basis
NV5 BP25-00005001

Sheet
E-302

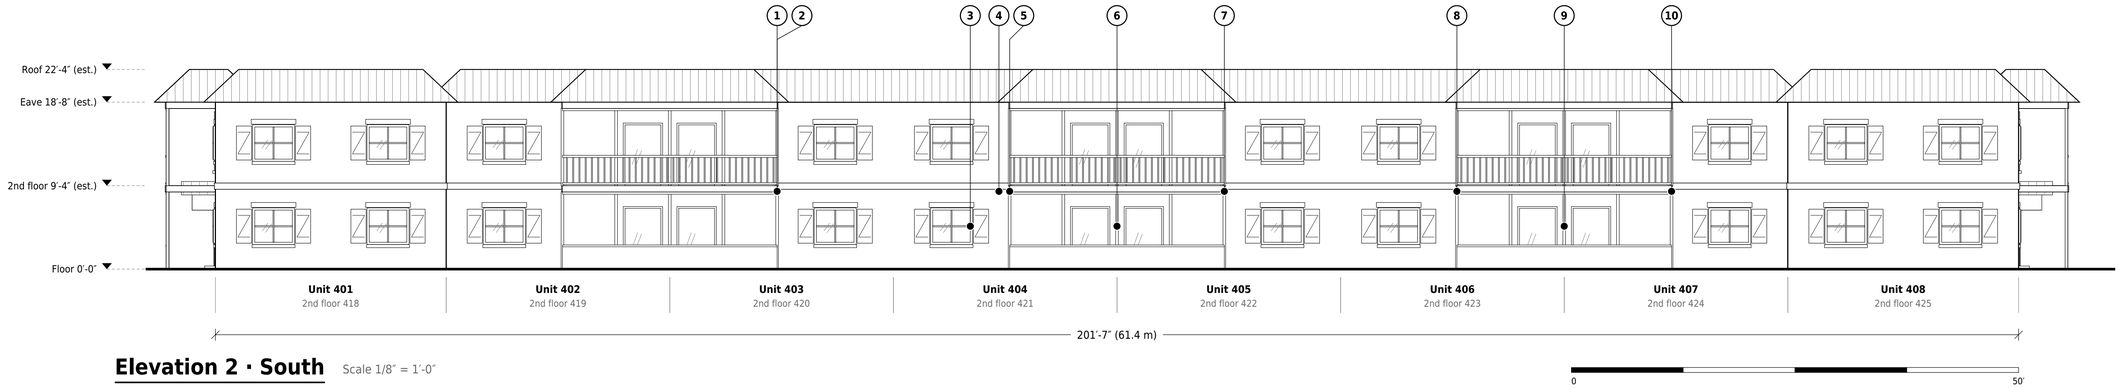

Elevation 2 · South

Scale 1/8″ = 1′-0″

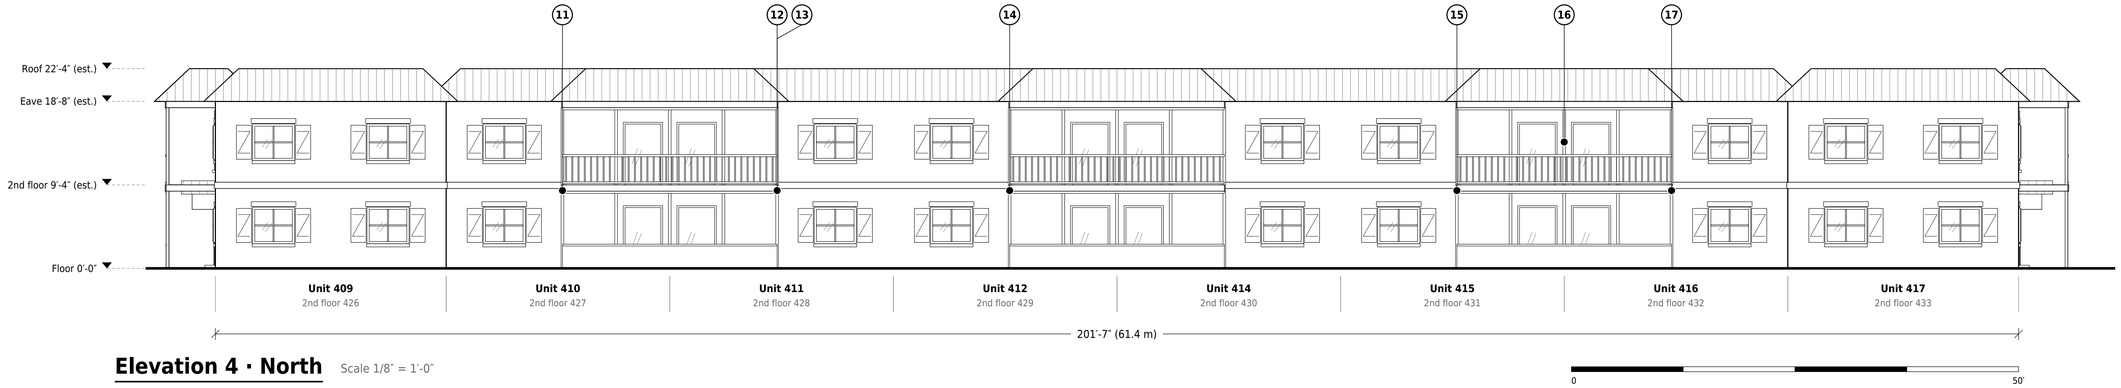

Elevation 4 · North

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B	Beam crack. Left column, balconies 403/402	Ground	73′-9″
2	B/E	Beam edge, balcony 403	Ground	70′-8″
3	ST	Stucco, wall of unit 403	Ground	89′-10″
4	B/E	Beam edge next to balcony 404	Ground	93′-6″
5	B	Beam crack. Right column, balconies 405/404	Ground	96′-10″
6	ST	Stucco, center column of balconies 405/404	Ground	108′-0″
7	B/E	Beam edge, balcony 405	Ground	94′-6″
8	B	Beam crack. Right column, balconies 407/406	Ground	73′-9″
9	ST	Stucco, center column of balconies 407/406	Ground	63′-10″
10	B	Beam crack. Left column, balconies 407/406	Ground	54′-10″
11	B	Beam crack. Left column, balconies 410/411	Ground	55′-5″
12	B	Beam crack. Right column, balconies 410/411	Ground	74′-3″
13	B/E	Beam edge, balcony 411	Ground	71′-4″
14	B	Beam crack. Left column, balconies 412/414	Ground	97′-3″
15	B/E	Beam edge, balcony 415	Ground	71′-3″
16	ST	Stucco, column between balconies 431/432	2nd	64′-5″
17	B	Beam crack. Right column, balconies 415/416	Ground	55′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 400 · Elevations 2 South and 4 North
Phase 4 · long faces

Key plan

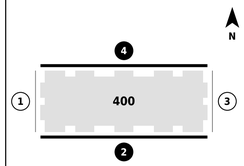

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004990.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00004990

Sheet
E-401



Elevation 1 · West

Scale 1/4″ = 1′-0″

0 20′



Elevation 3 · East

Scale 1/4″ = 1′-0″

0 20′

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
18	**B**	Beam crack. Corner of balcony 417 (labeled 317)	Ground	24′-10″
19	**Hatch**	Unlabeled hatch, wall of unit 417 (labeled 317)	Ground	17′-11″
20	**FL**	Balcony 418 floor, waterproofing required	2nd	**6′-0″**
21	**RS**	Rust, end wall of unit 401 (labeled 301 on plan)	Ground	23′-2″
22	**RS**	Rust, balcony 401 (labeled 301)	Ground	23′-5″
23	**B**	Beam crack. Corner of balcony 401 (labeled 301)	Ground	23′-11″
24	**B**	Beam crack. Corner of balcony 408	Ground	23′-11″
25	**B/E**	Beam edge, balcony 408	Ground	23′-7″
26	**FL***	Waterproofing note at ground-floor balcony 409 (no hatch)	Ground	**14′-7″**
27	**E**	Edge. Cracked edge, balcony 426	2nd	**12′-0″**
28	**E**	Edge, corner of balcony 426	2nd	24′-5″
29	**CC**	Cracked corner, balcony 409	Ground	24′-10″
30	**B/E**	Beam edge, balcony 409	Ground	24′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 400 · Elevations 1 West and 3 East
Phase 4 · end faces

Key plan

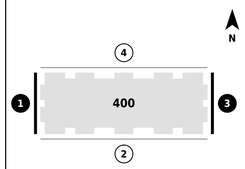

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004990.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004990


Sheet
E-402



Elevation 2 · South

Scale 1/4″ = 1′-0″

0 20′

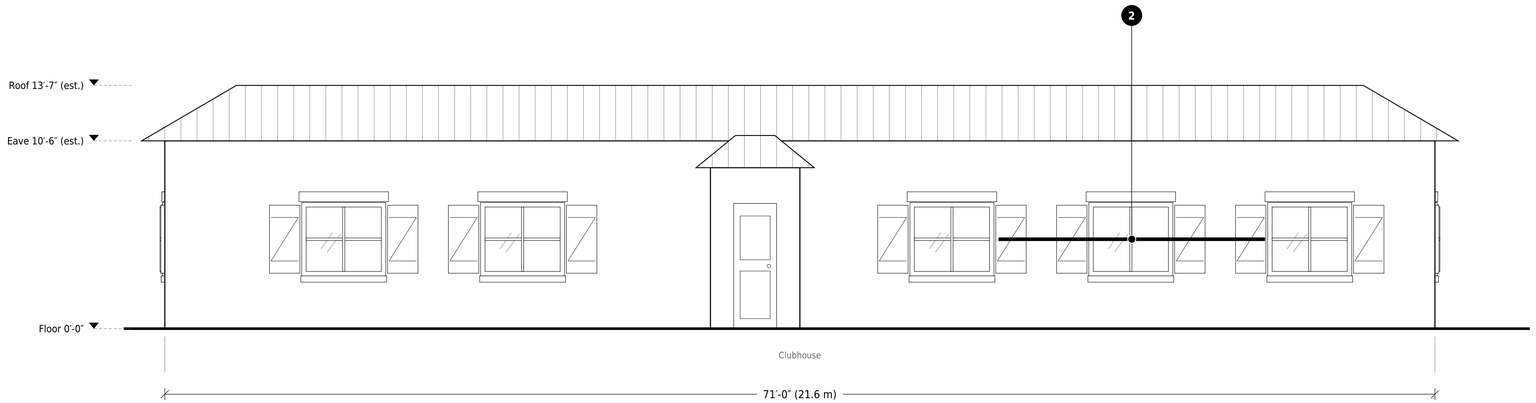

Elevation 4 · North

Scale 1/4″ = 1′-0″

0 20′

Repairs on this sheet

No.	Code	Location and description	Floor	To exit
1	ST	Stucco, clubhouse south wall	Ground	8′-4″
2	ST	Stucco, clubhouse north wall	Ground	13′-7″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project

Barcelona Gardens Condominium


101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title

Clubhouse · Elevations 2 South and 4 North

Phase 5 · faces with repairs
Dimensions from the aerial; the NV5 clubhouse drawing is not to scale. Entry location estimated.

Key plan

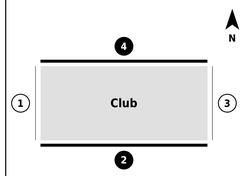

Legend

- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes

1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004987

Sheet

E-501