SOIL CONSERVATION DEPARTMENT, GOVERNMENT OF ASSAM

Soil Erosion Monitoring Report · Dibrugarh District

Report date: 09-11-2026


Satellite images compared: 12-07-2020 – 09-11-2020 and 12-07-2026 – 09-11-2026

Summary

Between the 12-07-2020 – 09-11-2020 and 12-07-2026 – 09-11-2026 windows, 851.0 ha of stable land along the river turned into water and 5,346.2 ha of chars or sandbars were lost, while 8,832.6 ha of new land formed. 15 sites need immediate bank protection, and about 22,675 people live within 500 m of them. 15 more sites should be checked in the field before the monsoon. Away from the river, 10,031 ha lost vegetation cover and 1,875 ha became bare soil.

851.0 ha Bank erosion	**5,346.2 ha** Char or sandbar lost	**15** Sites for immediate action	**22,675** People within 500 m of immediate-action sites
8,832.6 ha New land (accretion)	**15** Sites to check before the monsoon	**10,031 ha** Vegetation loss	**1,875 ha** New bare soil

Priority sites

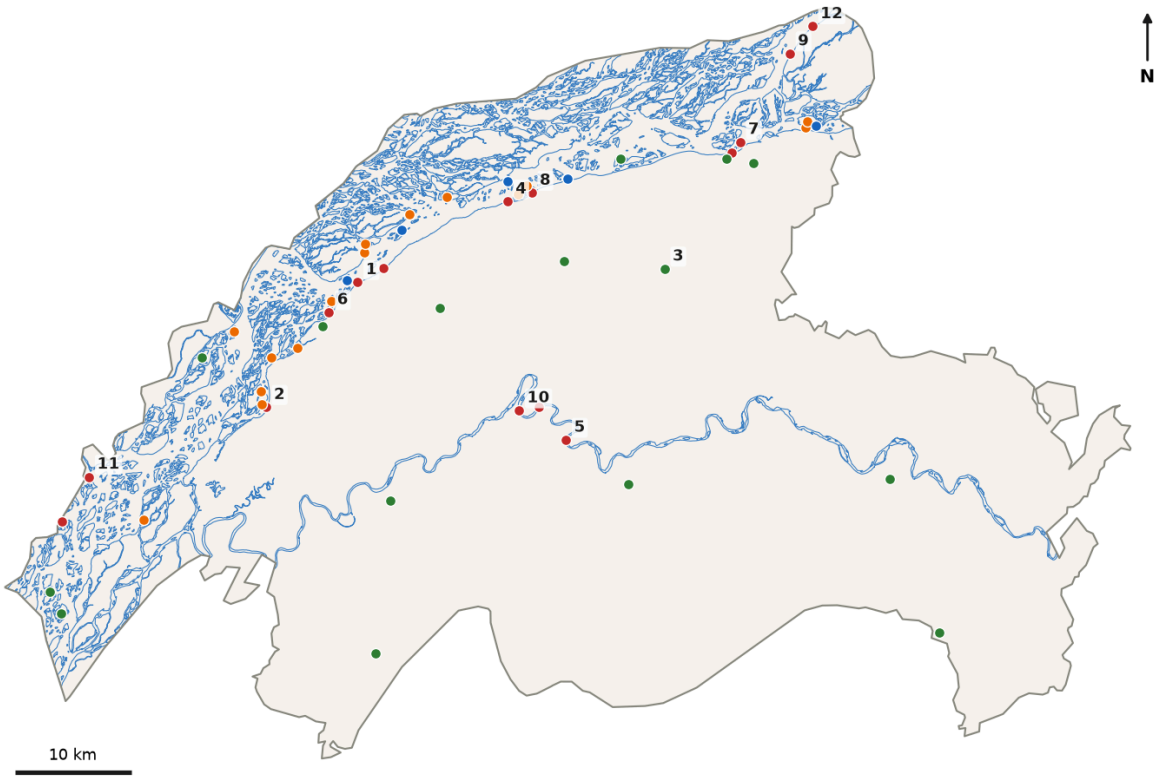

Immediate · Before monsoon · Routine · Monitor

Numbers are the site ranks in the table. Blue lines: river bank today (SWiFT-Bank). Grey line: district boundary.

Change since the last report

Compared with the report of 26-10-2026: bank erosion +27.2 ha, char loss +386.9 ha, sites for immediate action -2.

Priority sites for field verification (top 12 of 50)

Rank	Site	Type	Urgency	Lead agency	Area (ha)	Bank retreat (m/yr)	People within 500 m	Nearest place	Location
1	S2611-01	Bank erosion	Immediate	Water Resources	71.0	31	5,008	Dibrugarh	27.4553 94.8526
2	S2611-02	Bank erosion	Immediate	Water Resources	35.3	70	1,347	Changamari Habi	27.3596 94.7713
3	S2611-03	Vegetation loss	Routine	Soil Conservation	114.1	–	3,904	Bhatiu	27.4619 95.1188
4	S2611-04	Bank erosion	Immediate	Water Resources	13.9	39	2,009	Naguli Ghat	27.5159 94.9835
5	S2611-05	Bank erosion	Immediate	Water Resources	16.8	40	3,330	Lengeri Gaon	27.3306 95.0310
6	S2611-06	Bank erosion	Immediate	Water Resources	31.5	86	1,082	Changamari Habi	27.4323 94.8272
7	S2611-07	Bank erosion	Immediate	Water Resources	74.1	60	407	Nakapur	27.5591 95.1863
8	S2611-08	Bank erosion	Immediate	Water Resources	10.6	32	1,212	Naguli Ghat	27.5223 95.0046
9	S2611-09	Bank erosion	Immediate	Water Resources	72.9	84	245	Nakapur	27.6268 95.2308
10	S2611-10	Bank erosion	Immediate	Water Resources	8.1	16	2,024	Lengeri Gaon	27.3540 94.9907
11	S2611-11	Bank erosion	Immediate	Water Resources	14.6	41	996	Dhemaji	27.3074 94.6173
12	S2611-12	Bank erosion	Immediate	Water Resources	56.9	88	47	Borghuli	27.6476 95.2509

What to do

Bank erosion. Inform the Water Resources Department for emergency bank protection (geobags, porcupines) before the monsoon. Alert the circle office and the district disaster management authority.

Char or sandbar lost. Loss inside the river channel. No structural work; keep watch. If people live on the char, inform them and the circle office.

Likely bank erosion (AI). Predicted by the AI model, not yet seen. Check in the field before the monsoon; if bank cutting is seen, treat it as active bank erosion.

Vegetation loss. Check the cause (harvest, tea pruning, clearing). If a slope or bank was cleared, restore cover with grass, cover crops or trees.

About this report

This report is made automatically every two weeks from Sentinel-2 satellite images. River bank erosion is mapped with SWiFT-Bank, a tested sub-pixel method at 10 m; vegetation loss, bare soil and soil-loss risk use 20 m layers. Areas of bank erosion and char loss are land lost to the river. People within 500 m are counted from WorldPop 2020 and are an upper estimate. All sites must be confirmed in the field before works are planned.

Full maps, data downloads and the field form: https://sites.google.com/dibru.ac.in/dibrugarhsoil/dibrugarh-district