

No. Laporan / Report No. : 23/MGS/53/II/2026

Revisi / Revision : R0

Tgl. Laporan / Report Date : 29 January 2026

Halaman/Pages : 1 dari 2

INFORMASI PROYEK / PROJECT INFORMATION

Nama Proyek / Project Name

BSI Candrian Waste Dump Extension Study

Lokasi Proyek / Location : Banyuwangi - JAWA TIMUR

No. PO / PO Number : PO-GQT-001

IDENTITAS KLIEN / CLIENT INFORMATION

Klien / Client : PT. GEOLAND QUATRO TECHNOLAB

Alamat / Address : Kab. Bandung - JAWA BARAT

INFORMASI CONTOH / SAMPLE INFORMATION

Kode Laboratorium / Laboratory Id.

26-001-DS-001

No. Contoh / Sample Id. : BH-04R1-SPT 15

Kedalaman / Depth (m) : #N/A

Jenis Contoh / Sample Type : Disturbed Sample

Deskripsi Tanah / Soil Description : Lempung / Clay

Warna Tanah / Soil Color :

Tgl. Diterima / Date Received : 05 January 2026

Tgl. Pengujian / Date Tested : 25 April 2026

UJI KUAT TEKAN BEBAS
UNCONFINED COMPRESSION TEST

SNI 3638:2012

INFORMASI BENDA UJI / SPECIMEN INFORMATION

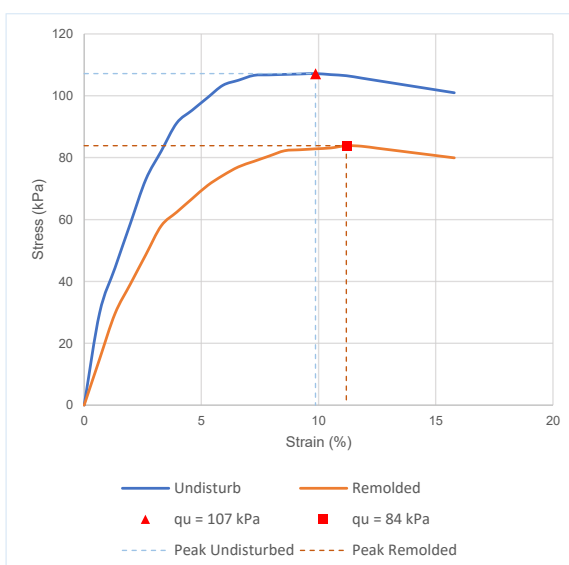
Contoh/Sample	Tidak Terganggu / Undisturbed	Cetak Ulang / Remolded
Diameter Awal / Initial diameter (mm)	38,00	38,00
Tinggi Awal / Initial Height (mm)	76,00	76,00
Luas Penampang Awal / Initial area (mm ²)	1134,11	1134,11
Kadar Air / Moisture Content (%)	8,15	8,98
Berat Isi Basah / Wet Density (g/cm ³)	2,01	1,97
Berat Isi Kering / Dry Density (g/cm ³)	1,86	1,81

HASIL PENGUJIAN / TEST RESULT

Contoh/Sample	Tidak Terganggu / Undisturbed	Cetak Ulang / Remolded
Kuat Tekan Bebas / Unconfined Compressive Strength, q_u (kPa)	107,17	83,87
Kuat Geser Tak Terdrainase / Undrained Shear Strength, S_u (kPa)	53,59	41,93
Regangan Saat Keruntuhan / Strain at Failure (%)	9,87	11,18
Sensitivitas / Sensitivity, S_t (-)	1,28	

GRAFIK

GRAFIK TEGANGAN VS REGANGAN / STRESS VS STRAIN CURVE

DIUJI OLEH /
TESTED BYNOUFAL
Teknisi/Analisis

Tgl./Date : 28/01/26

DIPERIKSA OLEH /
CHECKED BY

-

Koordinator Teknis

Tgl./Date : 28/01/26

DISETUI OLEH /
APPROVED BYA.SUMARTADJI
Kepala Laboratorium

Tgl./Date : 28/01/26

SCAN FOR REPORT VERIFICATION

KETERANGAN /
NOTES

- Laporan hasil Uji ini hanya berlaku untuk contoh yang diuji
- Dilarang memperbanyak laporan tanpa ijin tertulis dari Laboratorium Mekanika Tanah PT. TERRAFORMA GEOTEKNIK INDONESIA.
- Laboratorium tidak bertanggung jawab atas kegiatan pengambilan dan transportasi contoh yang dilakukan oleh pihak lain.

- This test report applies only to the tested sample.
- This report shall not be reproduced except in full without written approval from PT. TERRAFORMA GEOTEKNIK INDONESIA Soil Mechanics Laboratory.
- The laboratory is not responsible for sampling, handling and sample transportation conducted by others.

23-MINEARTH-RM-LHU-UCT-R0

No. Laporan / Report No. : 23/MGS/53/II/2026
Revisi / Revision : R0

Tgl. Laporan / Report Date : 29 January 2026

Halaman/Pages : 2 dari 2

LAMPIRAN / APPENDIX

FOTO PENGUJIAN

FOTO PENGUJIAN

CATATAN / NOTES :

DIUJI OLEH /
TESTED BY


NOUFAL

Teknisi/Analisis

Tgl./Date : 28/01/26


DIPERIKSA OLEH /
CHECKED BY

-

Koordinator Teknis

Tgl./Date : 28/01/26

DISETUJUI OLEH /
APPROVED BY


A.SUMARTADJI

Kepala Laboratorium

Tgl./Date 28/01/26

SCAN FOR REPORT VERIFICATION