


Trainings ▾

Inspect for Reuse

Inspect for the following defects:


- Broken electrical wiring
- Sending unit malfunction
- Loose or broken plumbing.

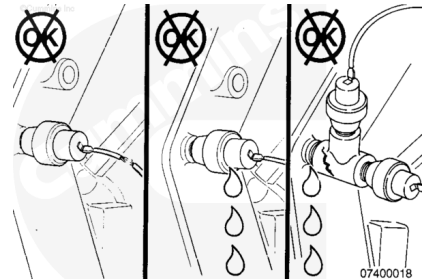

Use a reference gauge of known accuracy to verify the reading of the suspect gauge.

Connect the line from the master gauge at location (1) or (2) as shown, to the rear of the oil filters.

1. 3.175 mm [1/8 in] pipe thread.
2. 6.35 mm [1/4 in] pipe thread.

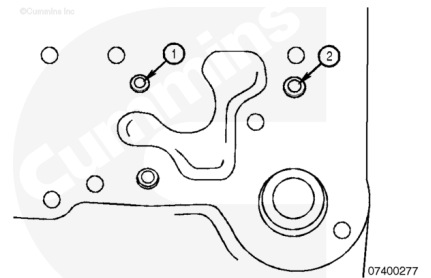

Measurements

	kpa	psi
Minimum Gauge Capacity	830	120

Operate the engine. Compare the pressure reading of the master gauge and the suspect gauge.

The sending unit **must** be replaced if it is defective.