
Flood Situation Report

Area: 34.488°N 72.578°E (148.6 km²) Flood date: 2025-08-16 Generated: 2026-10-10 04:06 UTC

Flood / debris impact detected

Educational prototype generated automatically from satellite data. Not an official emergency map.

0.04 km²	2.36 km²	0	1.9 km	2	0
Flood water	Debris / mud	Buildings likely hit	Roads affected	Bridges hit	Settlements cut off

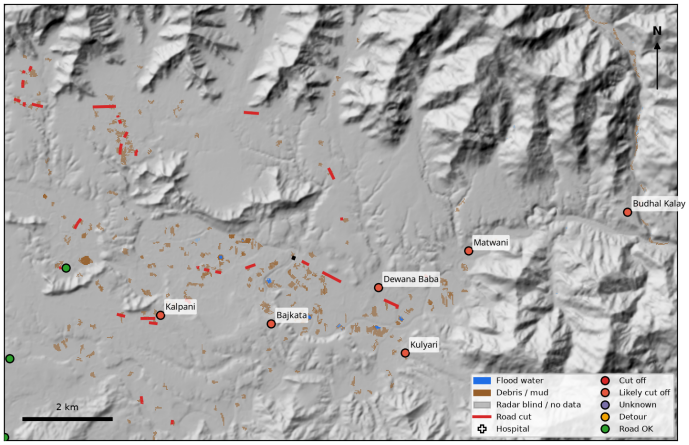

Settlements that lost or changed road access to a hospital

#	Settlement	Road access now	Buildings	Nearest hospital (before)	Before	Now
1		Likely cut off	0	Government Hospital Pacha Kala	19.8 km, 22 min	no route
2	Bajkata	Likely cut off	0	Government Hospital Pacha Kala	22.7 km, 30 min	no route
3		Likely cut off	0	Government Hospital Pacha Kala	25.8 km, 29 min	no route
4		Likely cut off	0	Government Hospital Pacha Kala	27.8 km, 32 min	no route
5		Likely cut off	0	Government Hospital Pacha Kala	28.4 km, 32 min	no route

+ 1 more (full list: dashboard / priority_list.csv)

Can we get there? Roads and bridges

Blocked or damaged roads (names from the pre-event map)

- Amnawar - Shalbandai Road: 0.35 km affected, 34.511°N 72.544°E
- Chagharzai Road: 0.11 km affected, 34.497°N 72.629°E
- unnamed secondary: 0.25 km affected, 34.467°N 72.528°E
- + 3 more

Bridges likely hit

- Tango Bridge, 34.480°N 72.566°E
- bridge on unnamed tertiary, 34.493°N 72.653°E

Helicopter access for settlements cut off by road

mapped helipad: none within 5 km; flat open ground 0.4 km (34.468°N 72.537°E) :[Likely cut off] •
• Bajkata [Likely cut off]: mapped helipad: none within 5 km; flat open ground 0.3 km (34.468°N 72.558°E)
mapped helipad: none within 5 km; flat open ground 0.5 km (34.478°N 72.583°E) :[Likely cut off] •
• + 3 more (full list: dashboard / priority_list.csv)

Flat open ground = slope at most 7°, at least 60 m clear, away from detected flood or debris and mapped buildings or power lines. Not checked: trees, unmapped wires or buildings, soft ground, debris the map missed. Confirm from the air. Distances are straight-line.

Data used

- Sentinel-1 radar: before 2025-08-04, after 2025-08-16 (track des-107, 12 days apart)
- Sentinel-1 radar: before 2025-08-08, after 2025-08-20 (track asc-173, 12 days apart)
- Sentinel-2 optical: second sensor (99% of area cloud-free); confirms radar and adds what only it sees (low confidence)
- OpenStreetMap as of 2025-08-14 (before the event)
- AI segmentation model: used, combined with rule-based detection
- Debris class only in mountain terrain (UNEP-WCMC definition); 100% of this area is mountain

Confidence and limits

- 0.28 km² of the flood/debris area is medium or high confidence.
- Sentinel satellites revisit an area only every few days: this system maps damage after the fact and cannot warn of a sudden glacier or lake outburst. Areas marked grey were hidden from the radar and are unknown, not safe. Road access uses mapped roads only. 'Likely cut off' rests on low-confidence detections (debris counts as confident only when a second radar pass or Sentinel-2 confirms it); 'Unknown' means the last route crosses roads the radar could not see. Travel times use nominal speeds per road class. Rows are ranked by priority: certainty, settlement size (mapped buildings), extra time.
- Before-images taken on or before 2025-08-14 (set by the operator: the area was still dry then). Change between that date and the after-image includes the whole build-up of the flood, and also any other change in that period (crops, construction).

Contains modified Copernicus Sentinel data 2026. Produced using Copernicus WorldDEM-30 © DLR e.V. 2010–2014 and © Airbus Defence and Space GmbH 2014–2018 provided under COPERNICUS by the European Union and ESA; all rights reserved. © OpenStreetMap contributors. Model trained on Kuro Siwo: Bountos et al., 2024 (NeurIPS Datasets & Benchmarks). Run hkh_buner_aoi11_full.