

SME01403 — Lee Health Imaging and Radiology - Outpatient MRI MRI

Lee Health · Philips MRI · Fort Myers, FL · Jul 7 – Aug 6 monitor data (1,462 captures) · analyzed 2026-08-06

COMPRESSOR

ON

recovered Aug 1 14:18Z · 7 cycles from Jul 9 23:48Z

PRESSURE NOW

33 mbar

33% of the 100 mbar line · easing

EVENT PEAK

275 mbar

Jul 14 07:48Z · 175 mbar over threshold

TEMP ALARM

TRIGGERED


45 readings · Jul 11 06:18Z → Jul 25 21:48Z

HELIUM


57.4%

–4.50 pts · level falling

HE PRESSURE — JUL 7 → AUG 6 (daily range, mbar · orange shade = the event window)

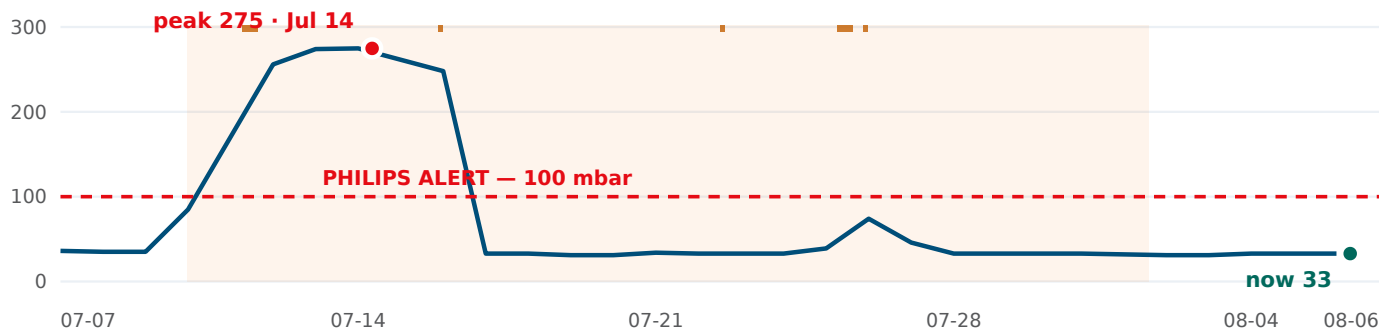

HELIUM LEVEL — JUL 7 → AUG 6 (daily reading, %)

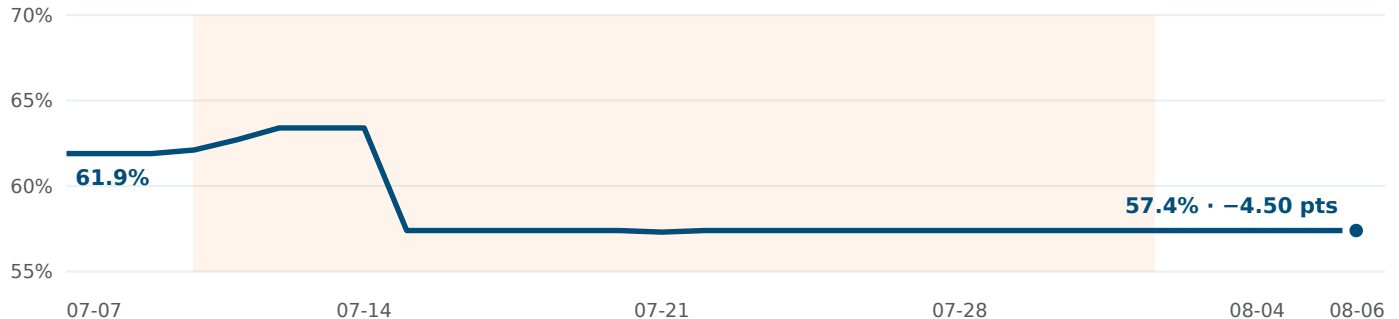

Timeline (UTC): Baseline Jul 7 – Jul 9: pressure held 35–36 mbar, helium 61.9–61.9%. **Jul 9 23:48Z: the compressor stopped** and then cycled on/off 7 times through Aug 1 14:18Z (73 readings off). A compressor temperature alarm was triggered Jul 11 06:18Z → Jul 25 21:48Z (45 readings — not continuous, it re-triggered 4 times; amber strip on the pressure chart). He pressure rose from 35 to a **peak of 275 mbar at Jul 14 07:48Z** — 175 mbar over the 100 mbar line (+2 mbar/h avg on the ramp). **The compressor recovered Aug 1 14:18Z** and has held since. Helium fell to **57.4%** (–4.50 points vs baseline). No quench. Pressure now reads 33 mbar (Aug 6 07:48Z) — 33% of the line.

CURRENT — AUG 6 (last readings)

Compressor ON. He pressure 33 mbar (07:48Z). Helium 57.4%.

RATES

Pressure –2 mbar vs baseline (35 → 33); peak 275. Ramp averaged +2 mbar/h. Helium –4.50 points.

DATA NOTES

1,462 captures · 27 valid pressure · 39 valid helium readings. Charts show the daily min-max range with the daily last value. Tech Room Temp 18.0–23.2 °C in window. Host clock ~36 min off vs capture time — times shown use capture time.