

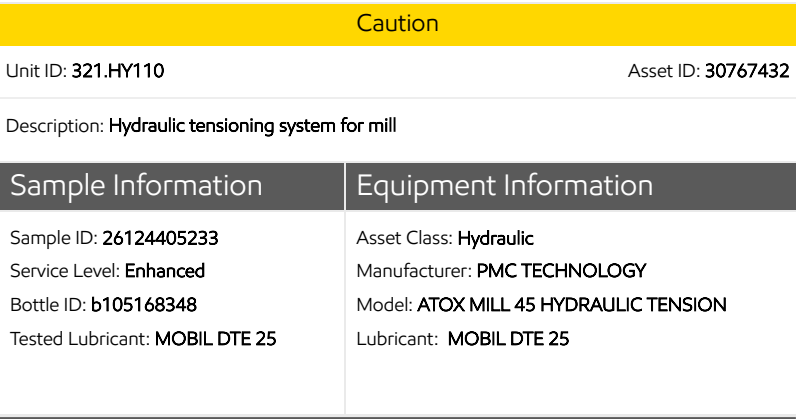
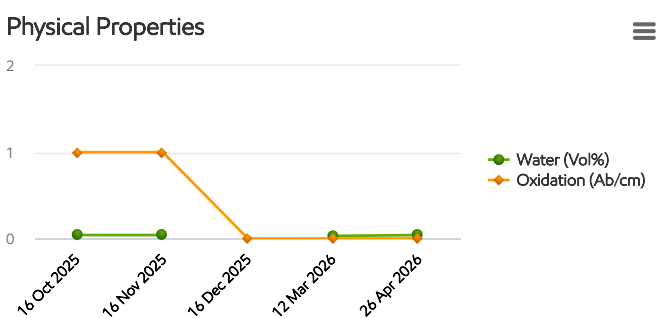


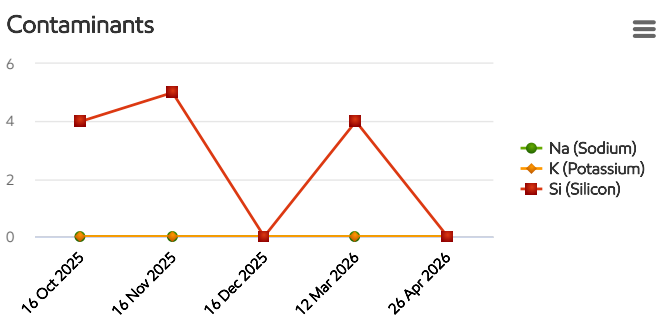

Sample Data & Trends

Date	Viscosity (cSt)
16 Oct 2025	44.7
16 Nov 2025	44.0
16 Dec 2025	45.2
12 Mar 2026	47.8
26 Apr 2026	48.2

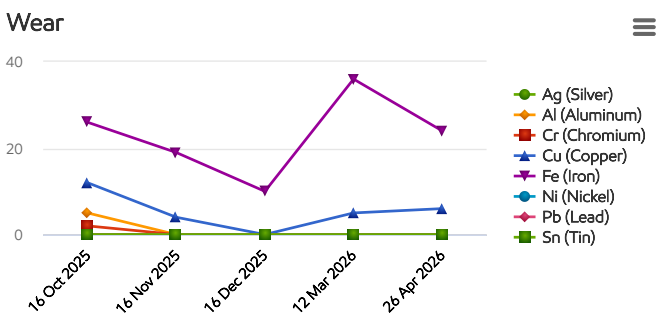

	Caution	
	Unit ID: 321.HY110	Asset ID: 30767432
	Description: Hydraulic tensioning system for mill	
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26124405233 Service Level: Enhanced Bottle ID: b105168348 Tested Lubricant: MOBIL DTE 25	Asset Class: Hydraulic Manufacturer: PMC TECHNOLOGY Model: ATOX MILL 45 HYDRAULIC TENSION Lubricant: MOBIL DTE 25
Recommendation/Comments		
ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
26 Apr 2026 11:21 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:		