

Handover of well NO 34/4-19 S Omega S

The well responsibility is hereby transferred

From D&W to the asset (permanent plugged, temporary abandoned well)

Signatures

I have reviewed the handover documentation and accept the handover of the well based on the information provided in this document and its references.

D&W OC Leader

Date

License Responsible

Date

Table of contents

1	Handover Certificate from D&W to O&M	3
1.1	Design confirmation	3
1.2	Well design	3
1.3	WBS well barriers	4
1.4	Pressure test charts	5
1.5	Non-conformances.....	7
1.6	Visual survey of seabed.....	8
1.6.1	Visual survey of the well location including potential pilot well	8
1.6.2	Visual survey of the well location including potential pilot well	8
1.7	Document findings	8
1.8	Samples	8

1 Handover Certificate from D&W to O&M

1.1 Design confirmation

The well is handed over from D&W according to governing requirements and with qualified barriers established.

D&W Scope and findings


1.2 Well design

Well: NO 34/4-19 S Omega S Field: Exploration Rig: Deepsea Atlantic											WELL SCHEMATIC As Done				All depths refer to RKB RKB-MSL = 30 m		
HOLE		CASING/LINER			LOT / FIT	TOC/TOL		CSG. SHOE		RKB	Max PP	Min FG	Fluid				
SIZE	TVD MD	SIZE	TYPE / RAD. MARKERS	CENTRALIZERS	[SG]	TVD	MD	TVD	MD		[SG]	[SG]	[SG]				
SB	410																
Cap-X 21	431 431	Cap-X	Interval: 410 m - 431 m		N/A			431	431		0.95	0.95	SW+Sweeps				
26" 803	1234 1234	20"	Interval: 410 m - 1234 m Type: 133lb/ft, NT-95DE, NSMAX-GR Drift: 18.854"	1/3 - up to 437 m 1/1 - up to 1196 m 2/1 - Shoe track	FTT: 1.53 sg	Seabed	Seabed	1234	1234		1.0	0.95	SW+Sweeps				
17 1/2" 868	2055 2102	14"	Interval: 410 m - 2091.4 m Type: 114lb/ft, P-110, Vam Top KB Drift: 12.504"	Centec Slider II Slick - up to 412 1/1 - up to 1892m 2/1 - Shoe track	XLOT: 1.72 sg (FPP)	1865 1891 1997	1891 2037.5	2045.7	2091.4		1.37	1.58	OBM 1.40 - 1.42				
12 1/4" 1218	3155 3320	9 7/8"	Interval: 2037.5 m - 3319 m Type: 66.4lb/ft, P-110, Vam21 CWD S+ST Drift: 8.620"	Centec Slider II Slick - up to 2049 1/1 - up to 2909m 2/1 - Shoe track	XLOT: 1.95 sg (FPP)	2789	2919	3154.27	3319		1.48	1.77	OBM 1.42 - 1.57				
8 1/2" 800	3903 4120	OH	Interval: 3320 m - 4120 m					3903	4120	Heather Fm Brent Gp	3634 mMD 3812.5 mMD	1.57	1.95	OBM 1.57 - 1.66			

Note: FG (fracture gradient) is based on FPP (fracture propagation pressure).

Note: FG (fracture gradient) is based on FPP (fracture propagation pressure).

1.3 WBS well barriers

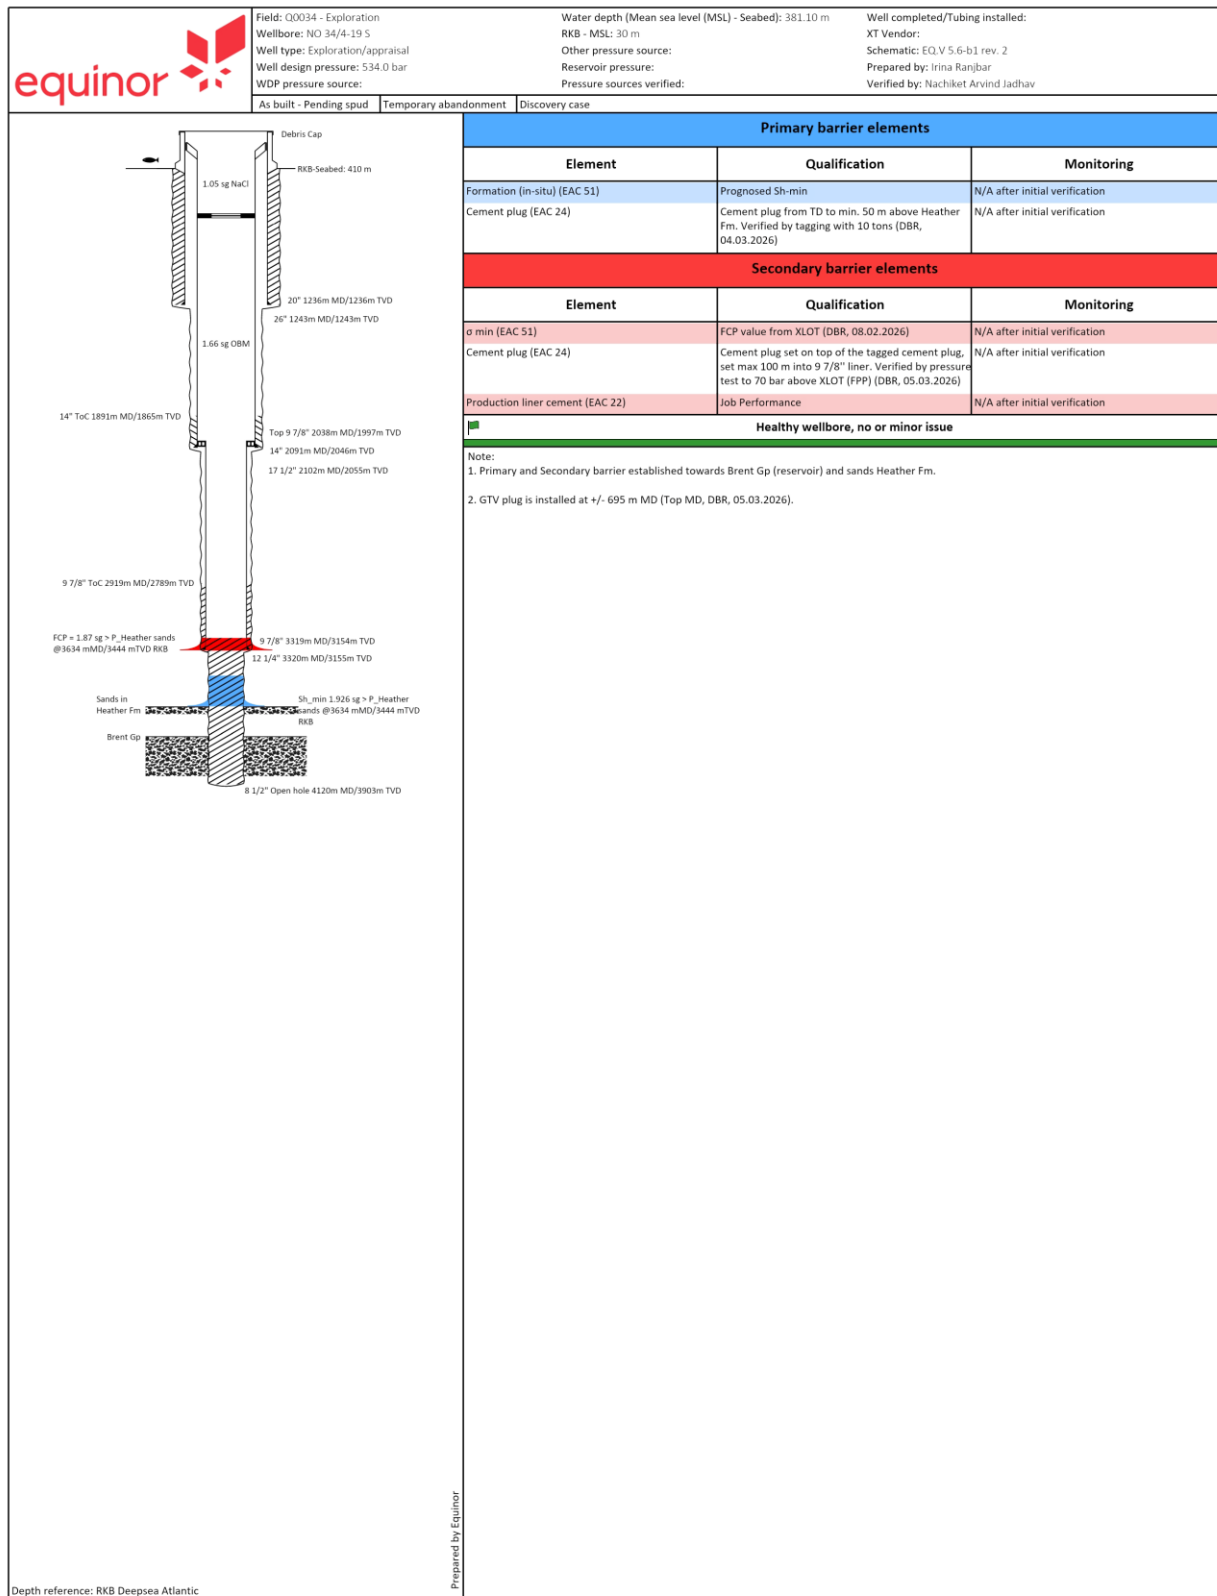

1.4 Pressure test charts


The casing strings have been tested to the following pressures:

Casing size		Surface pressure	Mud weight	Operation Date
34/4-19 S	20" casing	172 bars	1.03sg SW	28.01.2026
	14" casing	502 bars	1.42sg OBM	03.02.2026
	9 7/8" liner	310 bars	1.58sg OBM	07.02.2026

Note: Casing and top of cement (TOC) depths are specified in the Well Schematic in chapter 1.2


Pressure Test of 20" casing

20" casing was tested to 170 bars (DBR # 8, 28/01/2026).

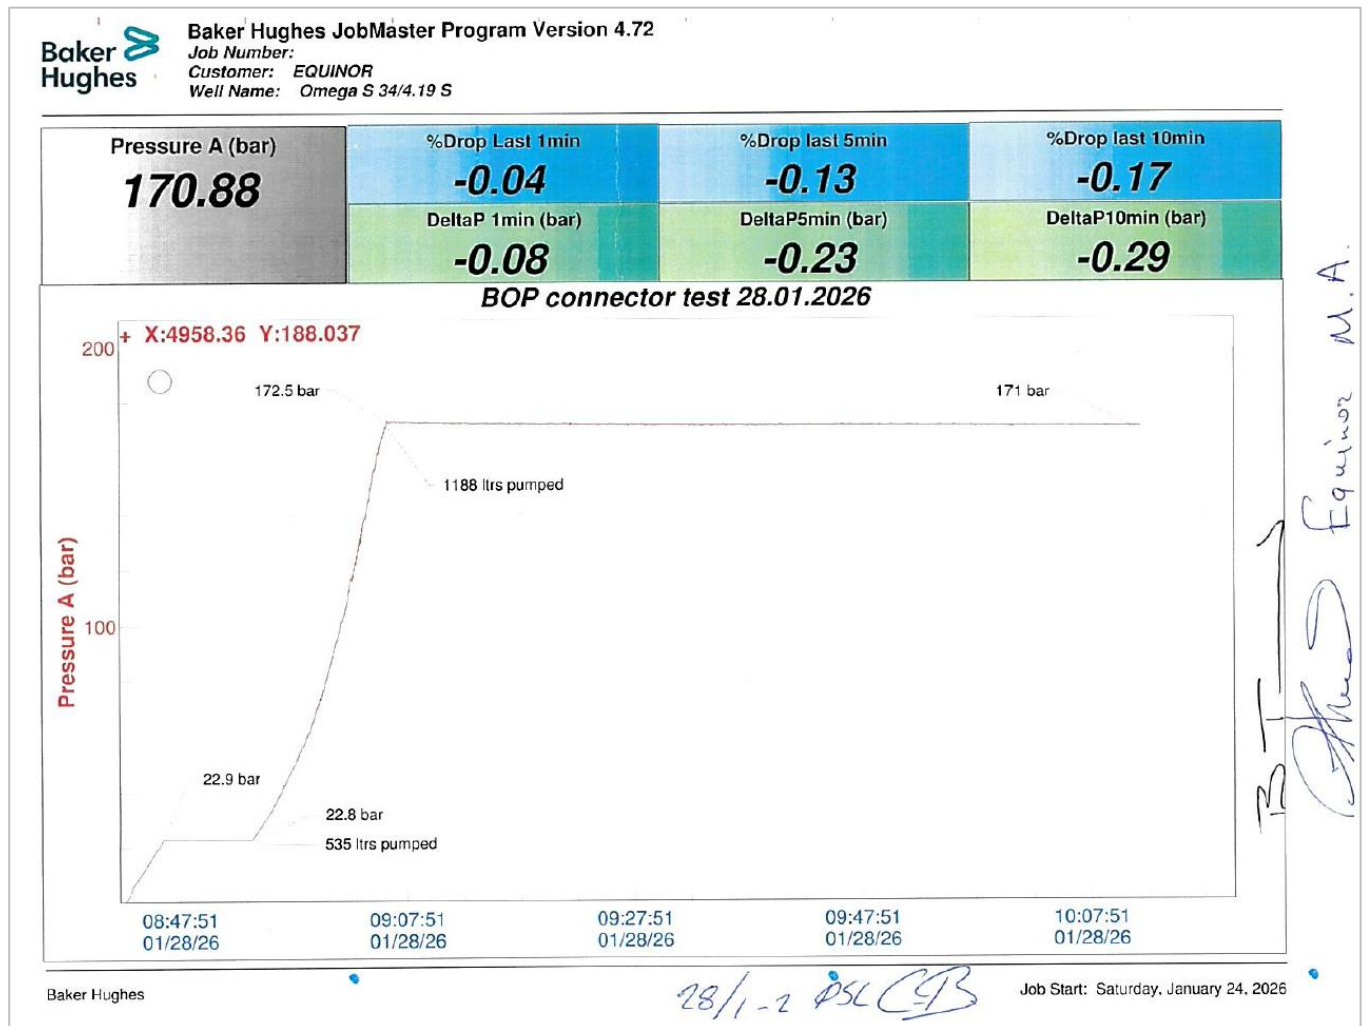


Pressure Test of 14" casing

14" casing was tested to 502 bars (DBR # 14, 03/02/2026).

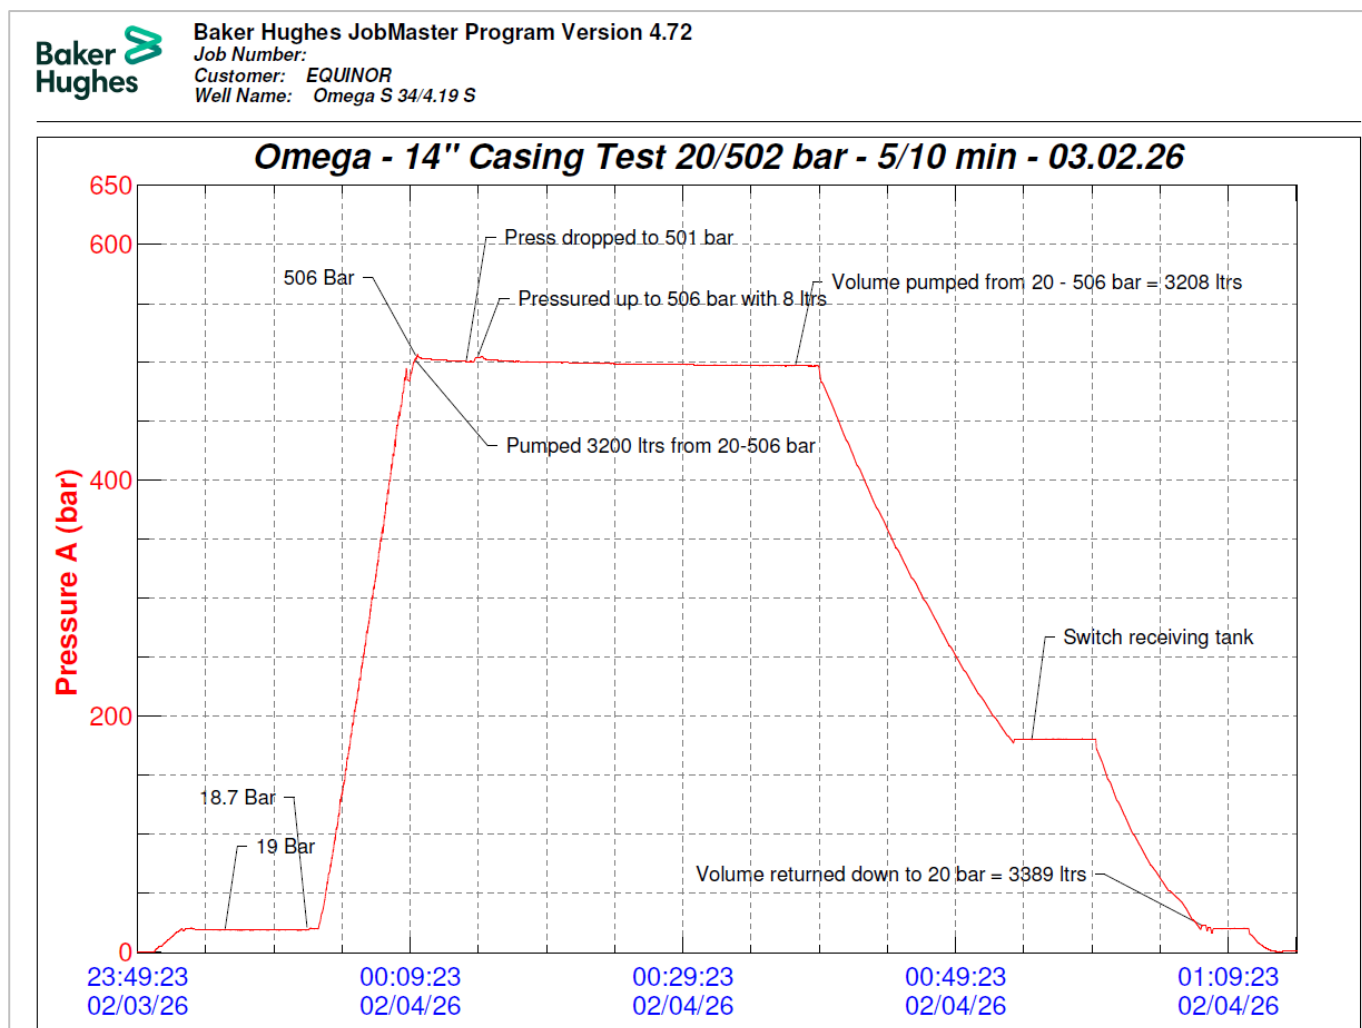

Pressure Test of 9 7/8" liner

9 7/8" liner was tested to 310 bars (DBR # 18, 07/02/2026).

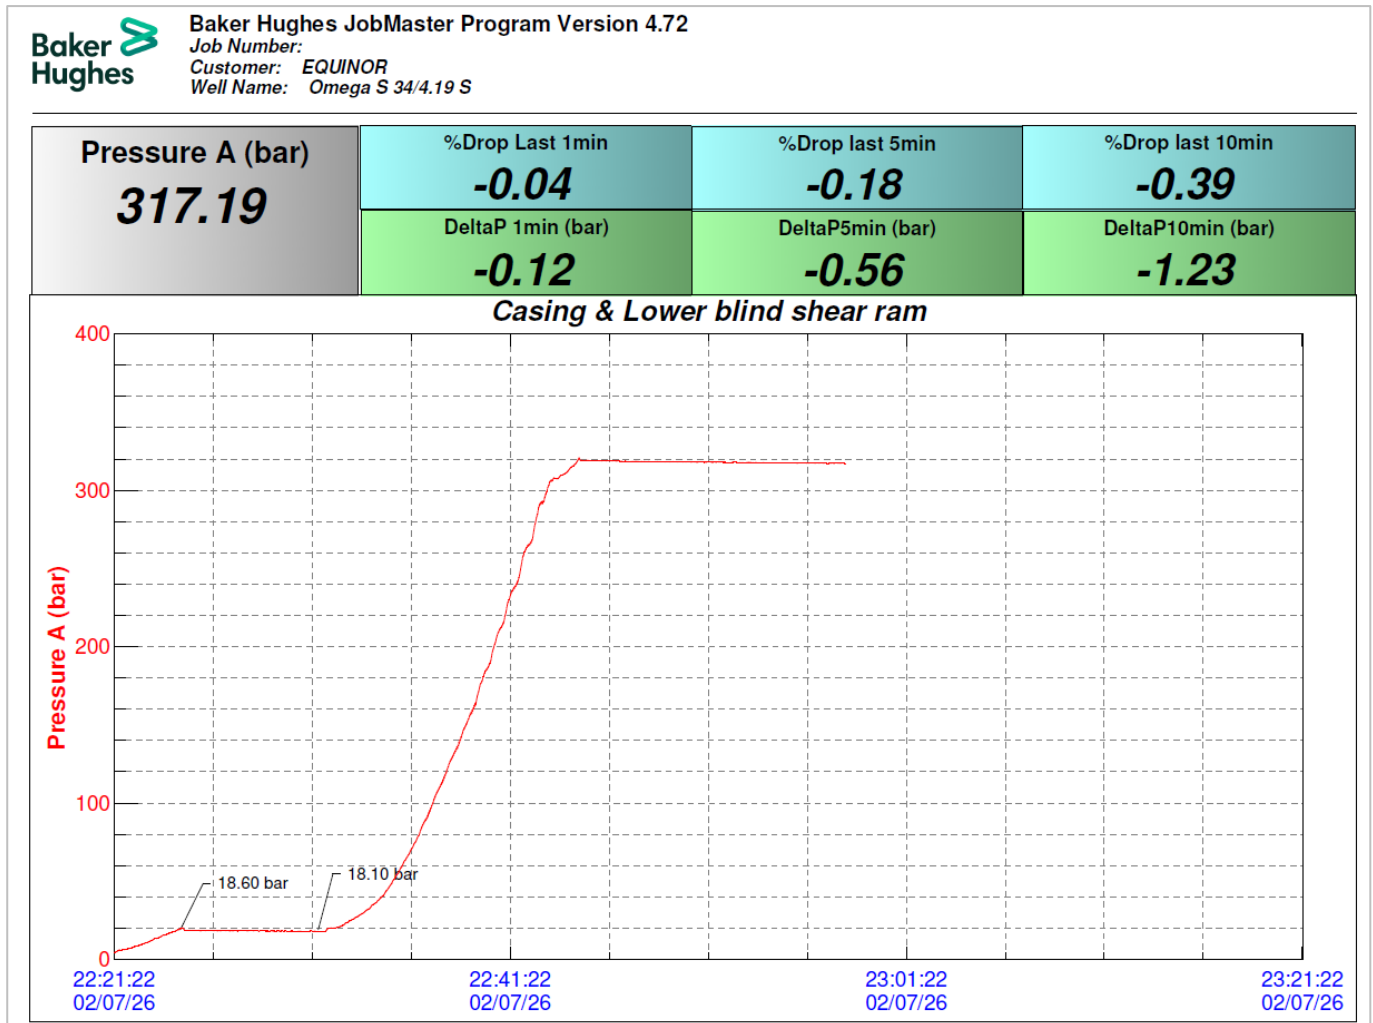

1.5 Non-conformances

N/A

1.6 Visual survey of seabed

1.6.1 Visual survey of the well location including potential pilot well

ROV seabed survey has been taken on March 6th, 2026, and is located on [34/4-19 S Omega S SharePoint](#) (Report and archive → Asset EOW documents → End of well from other Vendors).

1.6.2 Visual survey of the well location including potential pilot well

N/A

1.7 Document findings

CAP-X area is free for debris (manmade objects, concrete residues excluded.) No bubbles and NO visible seepage have been observed.

Category	Range (l/min)
1	<0,01
2	0,01-0,1
3	0,1-0,5
4	0,5-1
5	1-5
6	>5

Well no.	Depth	Debris	Time start survey at seabed	Time stop survey at seabed	Bubbles observed	Rate	Category	Gas sample
34/4-19 S	376 m	N/A	06:25:22	06:26:50	N	n/a	1	N

1.8 Samples

N/A

Samples to be sent to: Applied Petroleum Technology AS, Instituttveien 18, 2007 Kjeller. Attn: Geir Hansen / Per Erling Johansen

1.9 Observation program

If temporary abandonment reference is made to TR3507 SR-124954

SR-124954 - For a temporarily abandoned subsea well, an observation program shall be established. Observation frequency to be supported by a risk assessment and not to exceed 1 year.

Justification	To periodically ensure no leak from a temporarily abandoned well. Ref. Norsok D-010 rev. 5 ch. 10.5.1.
Interpretation guidance	Observation of wells without monitoring could be visual, or by other methods and is recommended if feasible. A yearly ROV inspection will fulfil this requirement.

If temporary abandonment reference is made to TR3507 SR-131849

SR-131849 - Wells without monitoring of the primary well barrier envelope shall maximum be temporarily abandoned for no more than:

- 2 years - for exploration wells
- 3 years - for development wells

Justification	To ensure establishment of plans for permanent abandonment or further use within the given time limit. Ref. Norsok D-010 rev. 5 ch. 10.5.1.
Interpretation guidance	Time periods mentioned above should be adequate for sufficient decision making / planning and start execution of a D&W operation (permanent abandonment or slot recovery). Monitoring in this context is of well barrier elements towards formations according to table 1, row b and f).