


- Error list:
- 1) Voltage drop on AMS1117 to high, min battery voltage 3.9V
 - 2) I2C_CSx should be I2C_SCLx
 - 3) I2C_SCL should be pulled up to 3.3V
 - 4) LDO on ESP32C3 module should be removed
 - 5) Battery "+" and "-" reversed on PCB silkscreen
 - 6) R6 should be 100k, R1 should be 390k
 - 7) Charge current should be lower (0.5A)

Sheet: /		
File: AudMix.kicad_sch		
Title:		
Size: A4	Date:	Rev:
KiCad E.D.A. 8.0.3		Id: 1/6

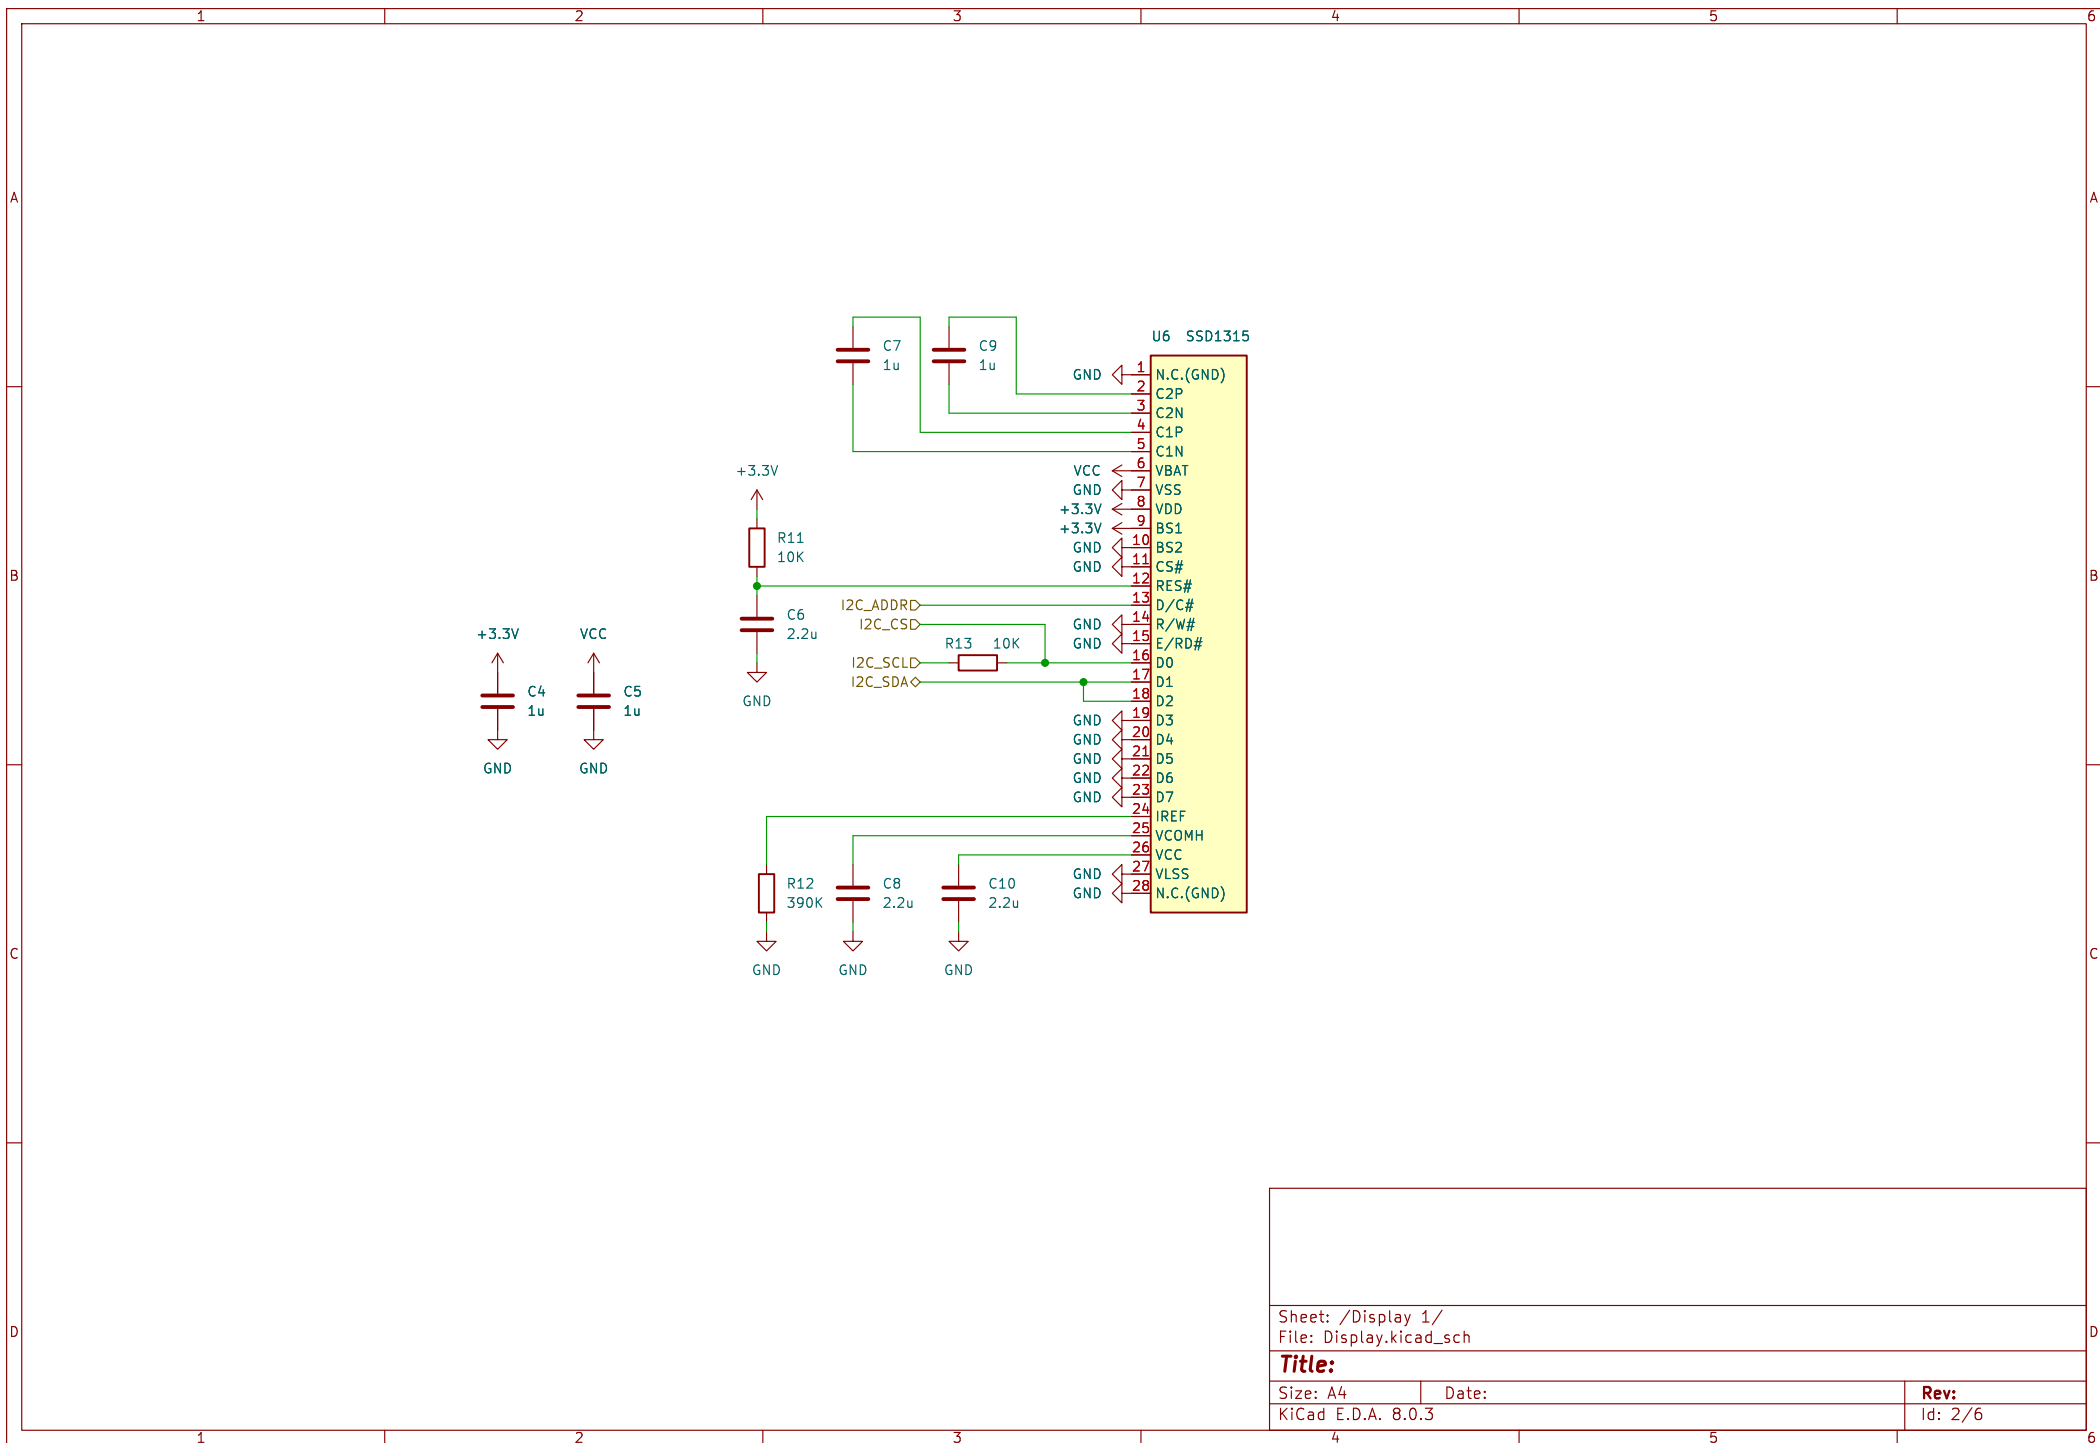

Id: 3/6

Id: 4/6

