

AN1200.24

Recommended SX1276 Settings for LoRaWAN Network Operation

Table of Content

1	Introduction	3
2	Uplink Transmissions	3
2.1	LoRa Mode	3
2.2	GFSK Mode	4
3	Downlink Reception Slots Following an Uplink	5
3.1	LORA Mode	6
3.1.1	Register Settings	6
3.1.2	RX Window Precise Timing	6
3.2	GFSK Mode	12
3.2.1	Register Settings	12
3.2.2	RX Window Precise Timing in GFSK Mode	14
4	Random Number Generation for Cryptography	15

1 Introduction

This application note presents the recommended setup of the SX1276 radio transceiver operating in a LoRaWAN network.

2 Uplink Transmissions

2.1 LoRa Mode

Uplink transmissions can use the following LoRa settings:

1. LoRa modulation with 125 kHz bandwidth, SF7 to SF12.
2. LoRa modulation with 250 kHz bandwidth, SF7 only. Corresponding to the high speed channel

The following radio settings should be used:

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegOpMode (0x01)	LongRangeMode[7] Mode[2:0]	'1' '011'	LoRa mode enabled Tx mode
RegPaRamp (0x0A)	PaRamp[3:0]	'1000'	50 us PA Ramp-up time
RegModemConfig1 (0x1D)	Bw[7:4]	'0111' or '1000'	'0111' for 125kHz modulation Bandwidth '1000' for 250kHz modulation Bandwidth
	CodingRate[3:1]	'001'	4/5 error coding rate
	ImplicitHeaderModeOn[0]	'0'	Packets have up-front header
RegModemConfig2 (0x1E)	SpreadingFactor[7:4]	'0111' to '1100'	with 125kHz bandwidth : '0111' (SF7) = 6kbit/s '1100' (SF12) = 300 bit/s (only SF7 is supported with 250kHz BW)
	RxPayloadCrcOn[2]	'1'	CRC enable
RegModemConfig3 (0x26)	LowDataRateOptimize[3]	'0' or '1'	'0' when Spreading Factor is <= 10 '1' when Spreading Factor is >= 11
RegSyncWord (0x39)	LoRa sync word	0x34	Set sync word for LoRaWAN networks (default is 0x12 for other networks)
RegInvertIQ (0x33)	IQ inversion bits	0x27	This is the default value
RegInvertIQ2 (0x3B)	IQ inversion bits	0x1d	This is the default value

All registers not explicitly mentioned can stay with their default value.

2.2 GFSK Mode

The LoRaWAN specification defines a high speed uplink channel using 50kbit/s GFSK modulation. The following radio settings should be used (all settings omitted should be left to their default value)

General and Transmitter settings

- Modulation = FSK
- Fdev = +/-25kHz (modulation index = 1)
- Bit rate setting = 50kbit/s
- Gaussian filter ON
- Filter setting : BT=0.5
- Output Power setting: hardware dependent
- PA selection: hardware dependent

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegOpMode (0x01)	LongRangeMode[7]	'0'	FSK/OOK mode enable
	ModulationType[6:5]	'00'	FSK Modulation scheme
	Mode[2:0]	'011'	Tx mode
RegPaRamp (0x0A)	ModulationShaping[6:5]	'10'	Gaussian filter BT = 0.5
RegBitrateMsb (0x02)	BitRate[15:8]	0x02	BitRate set to 50kbps
RegBitrateLsb (0x03)	BitRate[7:0]	0x80	
RegFdevMsb (0x04)	Fdev[13:8]	0x01	Frequency deviation set to +/-25kHz
RegFdevLsb (0x05)	Fdev[7:0]	0x99	

Frame and Packet Handler settings

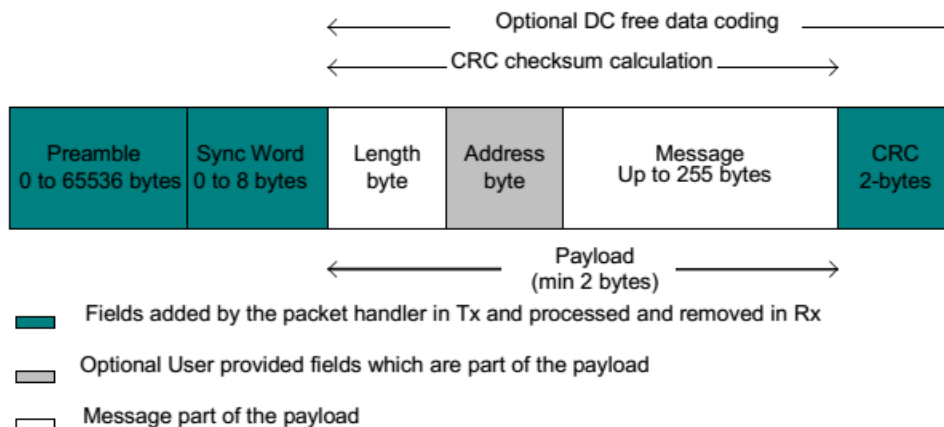


Figure 1: Packet Handler Format

- Packet Mode : this mode inserts a PHY header to support variable payload length
- Preamble Length = 5 bytes
- Sync Word= 3 bytes : 0xC194C1
- Variable Length frame format
- DC-free data encoding = Whitening
- CrcOn=1, CrcAutoclearOn=1

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegPreambleMsb (0x25)	PreambleSize[15:8]	0x00	5 Bytes of preamble for each packet
RegPreambleLsb (0x26)	PreambleSize[7:0]	0x05	
RegSyncConfig (0x27)	AutoRestartRxMode[7:6]	'00'	AutoRestart OFF
	PreamblePolarity[5]	'0'	Preamble 0xAA
	SyncOn[4]	'1'	Sync Address enable
	SyncSize[2:0]	'002'	3 Bytes of Sync Word
RegPacketConfig1 (0x30)	PacketFormat[7]	'1'	Variable length packets
	DcFree[6:5]	'10'	Whitening encoding enable
	CrcOn[4]	'1'	Enable CRC calculation
	CrcAutoClearOff[3]	'0'	Clear FIFO when CRC check fails
	AddressFiltering[2:1]	'00'	No address filtering
	CrcWhiteningType[0]	'0'	CCITT CRC and Whitening implementation
RegPacketConfig2 (0x31)	DataMode[6]	'1'	Packet Mode
RegSyncValue1 (0x28)	SyncValue[63:56]	0xC1	Sync Address is 0xC194C1
RegSyncValue2 (0x29)	SyncValue[55:48]	0x94	
RegSyncValue3 (0x2A)	SyncValue[47:40]	0xC1	

3 Downlink Reception Slots Following an Uplink

A LoRaWAN node opens two reception slots for potential downlink communications after each uplink transmissions. The delay between the end of a transmission (signaled by the TxDone IRQ) and the beginning of the reception slot is constant and defined extremely precisely to minimize the reception current overhead on the end-point side. Most of the time this reception slot will not be used by the gateways, id no frame will be received. Therefore, to minimize the current consumption the radio is programmed to listen to the channel for the minimum time required to detect with certainty the presence or absence of a preamble. In the absence of a preamble, the radio goes back to stand-by mode.

3.1 LORA Mode

3.1.1 Register Settings

In LoRa mode this is achieved simply by using the Receive Single mode.

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegOpMode (0x01)	LongRangeMode[7] Mode[2:0]	'1' '110'	LoRa mode enable Receive Single mode
RegLna (0x0C)	LnaGain[7:5] LnaBoostHf[1:0]	'001' '11'	LNA gain set to the maximum value LNA Boost enable
RegModemConfig1 (0x1D)	Bw[7:4] CodingRate[3:1] ImplicitHeaderModeOn[0]	'0111' or '1000' '001' '0'	'0111' for 125kHz modulation Bandwidth '1000' for 250kHz modulation Bandwidth 4/5 error coding rate Packets have up-front header
RegModemConfig2 (0x1E)	SpreadingFactor[7:4] RxPayloadCrcOn[2] SymbTimeout[1:0]	'0111' to '1100' '1' '00'	with 125kHz bandwidth : '0111' (SF7) = 6kbit/s '1100' (SF12) = 300 bit/s (only SF7 is supported with 250kHz BW) CRC enable
RegSymbTimeoutLsb (0x1F)	SymbTimeout[7:0]	0x05 or 0x08	0x05 when Spreading Factor is >= 10 0x08 when Spreading Factor is <= 9 Length of the receiver window in symbols. If no preamble is detected during this time , the receiver goes back to stand-by
RegModemConfig3 (0x26)	LowDataRateOptimize[3] AgcAutoOn[2]	'0' or '1' '1'	'0' when Spreading Factor is <= 10 '1' when Spreading Factor is >= 11 LNA gain set by internal AGC loop
RegMaxPayloadLength (0x23)	PayloadMaxLength[7:0]	0x40	Sets the maximum possible downlink payload size to 64 bytes. Packets with payload greater than this threshold will not be demodulated, receiver will immediately go back to "stand-by" low power mode
RegSyncWord (0x39)	LoRa sync word	0x34	Set sync word for LoRaWAN networks (default is 0x12 for other networks)
RegInvertIQ (0x33)	IQ inversion bits	0x67	Optimised for inverted IQ
RegInvertIQ2 (0x3B)	IQ inversion bits	0x19	Optimised for inverted IQ
Test36 (0x36)	See SX1276 errata note	0x02	500kHz Rx optimization
Test3a (0x3a)	See SX1276 errata note	0x64	500kHz Rx optimization

3.1.2 RX Window Precise Timing

This paragraph explains the optimal RX start-up time and RX slot duration for the given timing precision reachable by the end-device.

The downlink preamble transmitted by the gateways contains 8 symbols. The receiver requires 5 symbols to detect the preamble and synchronize. Therefore there must be a 5 symbols overlap between the receive window and the transmitted preamble.

The gateway always initiates the transmission of the preamble 1 sec +/- 20uSec after the end of the uplink. Therefore the beginning of the downlink preamble can be considered as a perfectly precise reference for the rest of this calculation.

Notation:

BW	Signal modulation bandwidth in Hz
SF	LORA spreading factor : 7 to 12
T _{symb}	Duration of a LORA symbol = $\frac{2^{SF}}{BW}$ sec
RXwindow	Length of the receive window
RXoffset	Offset in sec between the optimal receiver turn-on time and the actual start of the gateway transmission
RXerror	Maximum timing error of the receiver. The receiver will turn-on in a [-RXerror : +RXerror] sec interval around RXoffset
T_RX_early	Earliest time at which the receiver can start and synchronize on the downlink preamble
T_RX_late	Latest time at which the receiver can start and synchronize on the downlink preamble

Those variables are illustrated in the following diagram:

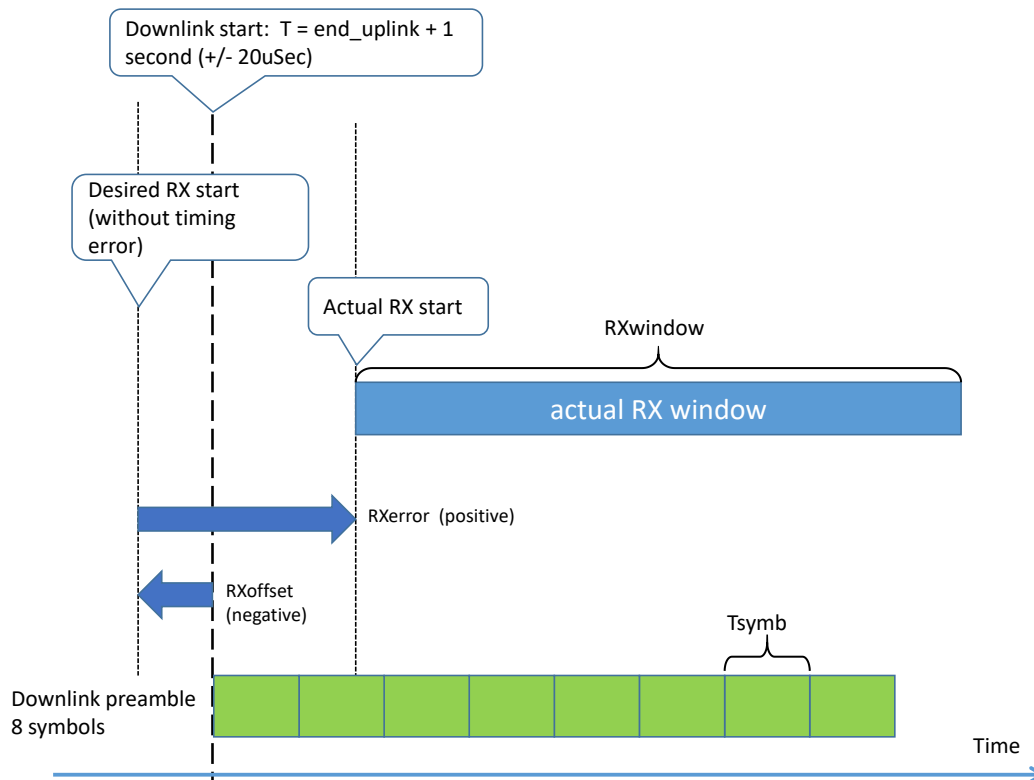


Figure 2: Typical Rx Window Timing

The following diagram illustrates the positioning of the earliest and latest possible receive windows to achieve 5 overlapping symbols with the downlink preamble:

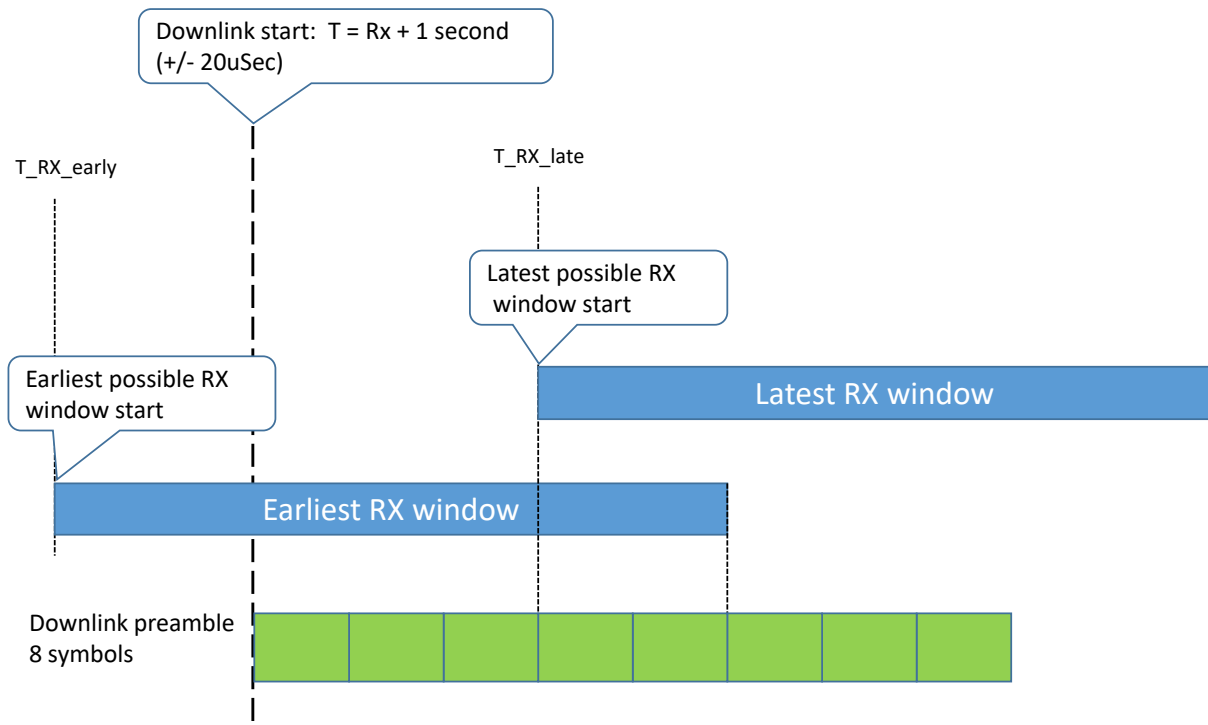


Figure 3: Worst Case Rx Window Timings

From this diagram the following equation can be deduced:

- $T_{RX_late} = 3 \times T_{symb}$
- $T_{RX_early} = 5 \times T_{symb} - RX_{window}$

Additionally the difference between t_{RX_late} and T_{RX_early} corresponds to the maximum timing error range of the receiver therefore:

- $T_{RX_late} - T_{RX_early} = 2 \times RX_{error}$

To allow this maximum timing error range the receiver should be programmed to ideally turn-on at the mid-point between T_{RX_late} and T_{RX_early} , therefore:

- $RX_{offset} = (T_{RX_late} + T_{RX_early})/2$

So assuming the RX_{error} parameter is set (RX_{error} is a direct consequence of a given design, it depends on the oscillator precision, temperature drift, ...)

We can deduce:

- $RX_{window} = 2 \times T_{symb} + 2 \times RX_{error}$
- $RX_{offset} = 4 \times T_{symb} - RX_{window}/2$

Because the minimum RX_{window} must be at least 5 symbols long, the system always tolerates at least an RX_{error} of at least $1.5 \times T_{symb}$

Numerical application:**The sensor can achieve a +/- 1.5mSec timing drift after a 1sec sleep period and is using SF7/125kHz**

At SF7/125kHz $T_{\text{symb}} = 1\text{mSec}$

So we set $RX_{\text{error}} = 1.5\text{mSec}$

We deduce $RX_{\text{window}} = 2 \times T_{\text{symb}} + 2 \times RX_{\text{error}}$
 $= 2 \times 128 / 125e3 + 3e-3 = 5\text{mSec}$

The RX_{window} is expressed in symbol unit in the SX1276 transceiver, at SF7 a symbol is 1mSec long therefore the RX_{window} corresponds to 5 symbols.

The sensor will be programmed to start with $RX_{\text{offset}} = 4 \times T_{\text{symb}} - RX_{\text{window}}/2$
 $= 4e-3 - 2.5e-3 = 1.5e-3$.

Without timing error, the receiver should turn on exactly 1.5mSec after the beginning of the downlink preamble.

The sensor can achieve a +/- 20mSec timing drift after a 1sec sleep period and is using SF7/125kHz

$RX_{\text{window}} = 2 \times T_{\text{symb}} + 2 \times RX_{\text{error}} = 42\text{mSec}$, this is larger than 5 symbols, therefore we set RX_{window} to the immediately greater or equal length which is an integer multiple of T_{symb}

- $RX_{\text{window}} = 42 \times T_{\text{symb}} = 42\text{mSec}$

Then:

- $RX_{\text{offset}} = 4 \times T_{\text{symb}} - RX_{\text{window}}/2 = -17\text{mSec}$

The receiver should be programmed to start 17mSec before the start of the downlink preamble

The same sensor but now using SF10/125kHz instead of SF7

At SF10/125kHz $T_{\text{symb}} = 8.2\text{mSec}$

$RX_{\text{window}} = 2 \times T_{\text{symb}} + 2 \times RX_{\text{error}} = 56.4\text{mSec}$, this is larger than 5 symbols, therefore we set RX_{window} to the immediately greater or equal length which is an integer multiple of T_{symb}

- $RX_{\text{window}} = 7 \times T_{\text{symb}} = 57.4\text{mSec}$

Then:

- $RX_{\text{offset}} = 4 \times T_{\text{symb}} - RX_{\text{window}}/2 = 4.1\text{mSec}$

The receiver should be programmed to start 4.1mSec after the start of the downlink preamble

The following tables give a few numerical examples for various SF / BW / timing error sets:

Rxerror +/- 1.5 mSec
BW 125 kHz

SF	Tsymb	RXoffset	RX window	
	(mSec)	(mSec)	Symb	mSec
7	1.0	1.5	5.0	5.1
8	2.0	3.1	5.0	10.2
9	4.1	6.1	5.0	20.5
10	8.2	12.3	5.0	41.0
11	16.4	24.6	5.0	81.9
12	32.8	49.2	5.0	163.8

Rxerror +/- 20 mSec
BW 250 kHz

SF	Tsymb	RXoffset	RX window	
	(mSec)	(mSec)	Symb	mSec
7	0.5	-18.7	81.0	41.5
8	1.0	-17.4	42.0	43.0
9	2.0	-14.3	22.0	45.1
10	4.1	-8.2	12.0	49.2
11	8.2	4.1	7.0	57.3
12	16.4	24.6	5.0	81.9

Rxerror +/- 20 mSec
BW 250 kHz

SF	Tsymb	RXoffset	RX window	
	(mSec)	(mSec)	Symb	mSec
7	0.5	-18.7	81.0	41.5
8	1.0	-17.4	42.0	43.0
9	2.0	-14.3	22.0	45.1
10	4.1	-8.2	12.0	49.2
11	8.2	4.1	7.0	57.3
12	16.4	24.6	5.0	81.9

3.2 GFSK Mode

3.2.1 Register Settings

Receiver-specific settings

- RxBw=50kHz // single side Carson BW=50kHz
- AfcBw=83.3kHz // assuming +/-30ppm of LO misalignment at 869.525 MHz
- AgcAuto=On
- Preamble Detection On, over 2 Bytes, Number of samples in error = 10
- AfcAutoOn
- AfcAutoClearOn
- RxTrigger=Preamble
- LnaBoost=On

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegLna (0x0C)	LnaGain[7:5]	'001'	LNA gain set to the highest gain
	LnaBoostHf[1:0]	'11'	LNA Boost enable
RegRxConfig (0x0D)	RestartRxOnCollision[7]	'0'	No restart on collision
	RestartRxWithoutPllLock[6]	'0'	
	RestartRxWithPllLock[5]	'0'	
	AfcAutoOn[4]	'1'	Corrects frequency offset
	AgcAutoOn[3]	'1'	Automatic gain control
	RxTrigger[2:0]	'110'	Trigs on preamble only
RegRxBw (0x12)	RxBwMant[4:3]	'01'	Receiver Bandwidth =50kHz SSB
	RxBwExp[2:0]	'011'	
RegAfcBw (0x13)	RxBwMantAfc[4:3]	'10'	Receiver Bandwidth =83.3kHz SSB for AFC
	RxBwExpAfc[2:0]	'010'	
RegPreambleDetect (0x1F)	PreambleDetectorOn[7]	'1'	Preamble detector enable
	PreambleDetectorSize[6:5]	'01'	Preamble detection over 2 bytes
	PreambleDetectorTol[4:0]	'01010'	10 chip errors tolerated over detection
RegSyncConfig (0x27)	AutoRestartRxMode[7:6]	'00'	AutoRestart OFF
	PreamblePolarity[5]	'0'	Preamble 0xAA
	SyncOn[4] SyncSize[2:0]	'1' '002'	Sync Address enable 3 Bytes of Sync Word
RegPacketConfig1 (0x30)	PacketFormat[7]	'1'	Variable length packets
	DcFree[6:5]	'10'	Whitening encoding enable
	CrcOn[4]	'1'	Enable CRC calculation
	CrcAutoClearOff[3]	'1'	PayloadReady IRQ will always be generated at the end of the frame, CRC must be checked through dedicated flag
	AddressFiltering[2:1]	'00'	No address filtering
	CrcWhiteningType[0]	'0'	CCITT CRC and Whitening implementation
RegPacketConfig2 (0x31)	DataMode[6]	'1'	Packet Mode
RegSyncValue1 (0x28)	SyncValue[63:56]	0xC1	Sync Address is 0xC194C1
RegSyncValue2 (0x29)	SyncValue[55:48]	0x94	
RegSyncValue3 (0x2A)	SyncValue[47:40]	0xC1	

Expected performance: @ BER=0.1% = -109dBm (confirmed with PER on a short packet)

Operation Flowchart for Receiver

The following flowchart shows how the receiver should be operated for each reception slot in GFSK mode.

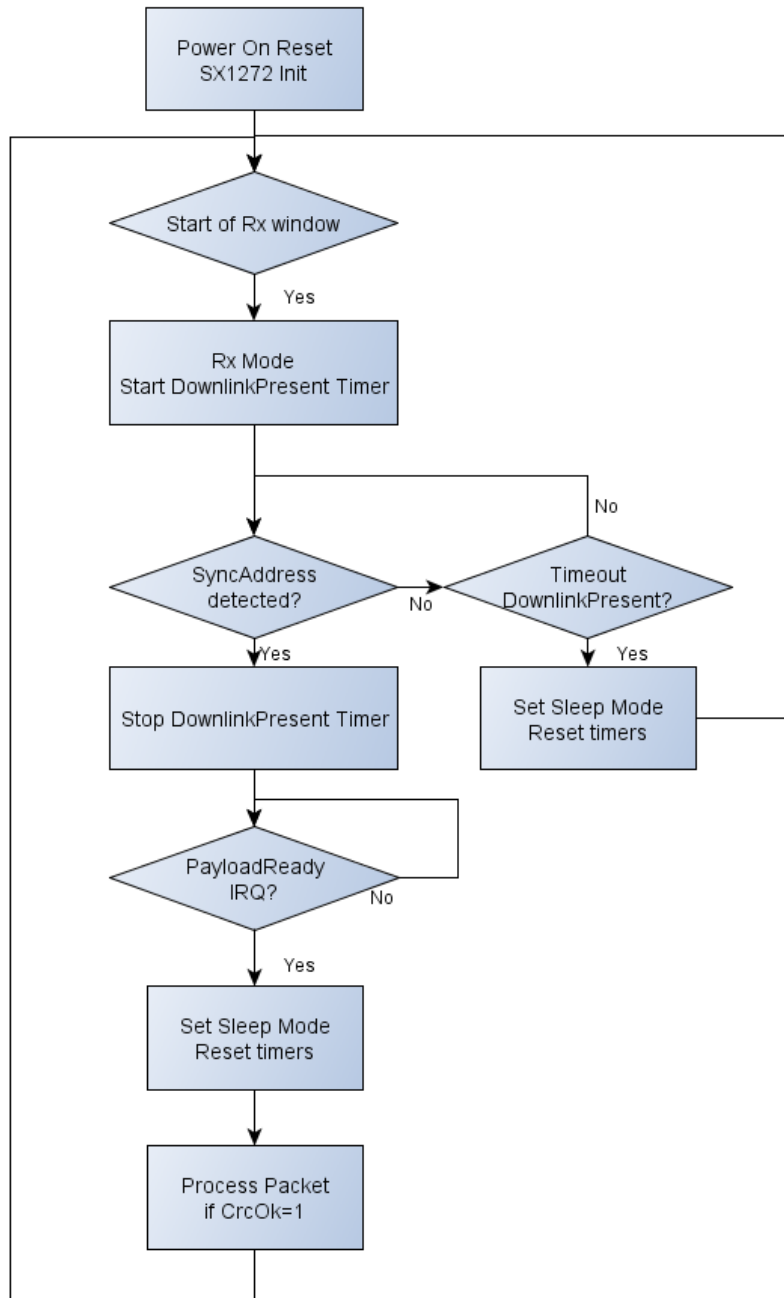


Figure 4: FSK Rx Operation Flowchart

DownlinkPresent timeout : timer started when the device is set to Rx mode. Sized to only leave the receiver open for a short amount of time when the downlink command is expected. It is meant to capture 5 bytes of Preamble + 2 Bytes of Sync Word + margin, so should be set to 1.3ms.

The “*SyncAddress*” interrupt can be mapped to the DIO2 line of the SX1276 or can alternatively be polled through the SPI interface.

The “*PayloadReady*” interrupt can be mapped to the DIO0 line of the SX1276, or polled through the SPI interface.

3.2.2 RX Window Precise Timing in GFSK Mode

We note FSKbitrate the bit rate of the GFSK modulation in bit per sec

The GFSK frame preamble is 8 bytes long (5 bytes preamble + 3 bytes sync word), therefore the RX window and the beginning of the TX preamble must overlap on $8 \times 8 / \text{FSKbitrate}$ sec

The LoRaWAN v3 only supports a single GFSK bit rate = 50kbits/sec

Therefore the overlap must be equal or greater than 1.3mSec

So using the same notation than in the LORA section we have:

- $T_{RX_late} = 0$
- $T_{RX_early} = 1.3\text{mSec} - \text{RXwindow}$

Similarly we can deduce that for 50kbit/sec GFSK the minimal RXwindow is:

- $\text{RXwindow} = 1.3\text{mSec} + 2 \times \text{RXerror}$

and

- $\text{RXoffset} = - \text{RXwindow} / 2$

4 Random Number Generation for Cryptography

The LoRaWAN MAC software layer requires the generation of truly random numbers for cryptography purposes. This can be achieved using the naturally random noise of the radio channel.

The recommended way to generate a random binary number is the following:

Radio receiver settings:

SX1276 Register (address)	Register bit field (bit #)	Values	Note
RegOpMode (0x01)	LongRangeMode[7] Mode[2:0]	'1' '101'	LoRa mode enable Receive Continuous mode
RegModemConfig1 (0x1D)	Bw[7:4] CodingRate[3:1] ImplicitHeaderModeOn[0]	'0111' '001' '0'	'0111' for 125kHz modulation Bandwidth 4/5 error coding rate Packets have up-front header
RegModemConfig2 (0x1E)	SpreadingFactor[7:4]	'0111'	'0111' (SF7) = 6kbit/s

To generate an N bit random number, perform N read operation of the register RegRssiWideband (address 0x2c) and use the LSB of the fetched value. The value from RegRssiWideband is derived from a wideband (4MHz) signal strength at the receiver input and the LSB of this value constantly and randomly changes.

The RegRssiValue register (at address 0x1b) should not be used for random number generation. It has been experimentally measured that if a constant CW input power is applied at the receiver input inside the current receiver channel the LSB of the RegRssiValue register may be constant or strongly biased.

© Semtech 2015

All rights reserved. Reproduction in whole or in part is prohibited without the prior written consent of the copyright owner. The information presented in this document does not form part of any quotation or contract, is believed to be accurate and reliable and may be changed without notice. No liability will be accepted by the publisher for any consequence of its use. Publication thereof does not convey nor imply any license under patent or other industrial or intellectual property rights. Semtech assumes no responsibility or liability whatsoever for any failure or unexpected operation resulting from misuse, neglect improper installation, repair or improper handling or unusual physical or electrical stress including, but not limited to, exposure to parameters beyond the specified maximum ratings or operation outside the specified range.

SEMTECH PRODUCTS ARE NOT DESIGNED, INTENDED, AUTHORIZED OR WARRANTED TO BE SUITABLE FOR USE IN LIFE-SUPPORT APPLICATIONS, DEVICES OR SYSTEMS OR OTHER CRITICAL APPLICATIONS. INCLUSION OF SEMTECH PRODUCTS IN SUCH APPLICATIONS IS UNDERSTOOD TO BE UNDERTAKEN SOLELY AT THE CUSTOMER'S OWN RISK. Should a customer purchase or use Semtech products for any such unauthorized application, the customer shall indemnify and hold Semtech and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs damages and attorney fees which could arise.

Contact Information

Semtech Corporation
Wireless Sensing and Timing Products Division
200 Flynn Road, Camarillo, CA 93012
Phone: (805) 498-2111 Fax: (805) 498-3804
E-mail: support_rf_na@semtech.com
Internet: <http://www.semtech.com>
