

Laser PM2.5 Sensor specification

Product model: SDS011
Version: V1.3



Nova Fitness Co.,Ltd


2015-10-9

Contents

| | |
|--------------------------------------|----|
| OVERVIEW..... | 1 |
| CHARACTERISTICS..... | 1 |
| SCOPE OF APPLICATION..... | 2 |
| WORKING PRINCIPLE..... | 2 |
| TECHNICAL PARAMETERS..... | 2 |
| POWER REQUIREMENT..... | 3 |
| ABOUT SERVICE LIFE..... | 4 |
| PRODUCT SPECIFICATIONS..... | 4 |
| 1.Product size..... | 4 |
| 2. Interface specification..... | 4 |
| THE UART COMMUNICATION PROTOCOL..... | 5 |
| PWM output description..... | 6 |
| Schematic diagram of output: | 7 |
| EXTENDED FUNCTIONALITY..... | 7 |
| INSTALLATION SIZE..... | 7 |
| PACKAGE..... | 10 |
| MATTERS NEEDING ATTENTION..... | 11 |
| CONTACT..... | 11 |

Overview

The SDS011 using principle of laser scattering, can get the particle concentration between **0.3 to 10 μ m** in the air. It with digital output and built-in fan is stable and reliable.

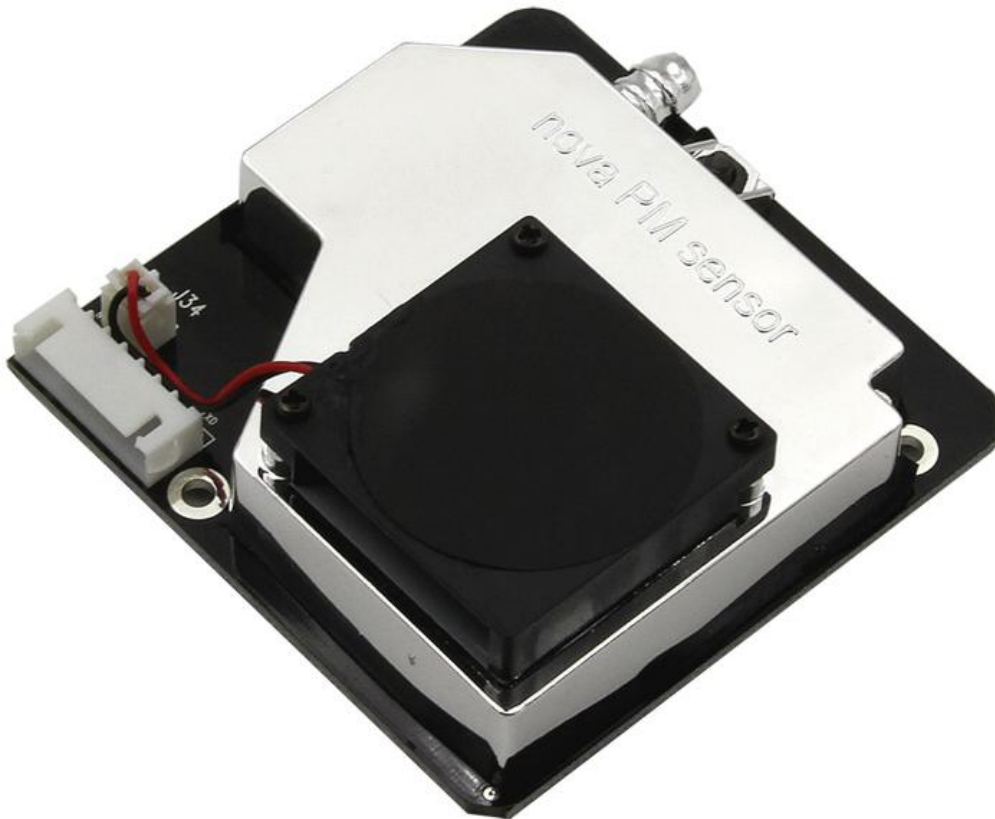

Characteristics

1. Accurate and Reliable: laser detection, stable, good consistency;
2. Quick response: response time is less than 10 seconds when the scene changes;
3. Easy integration: UART output (or IO output can be customized), fan built-in;
4. High resolution: resolution of 0.3 μ g/m³;

5.Certification: products have passed CE/FCC/RoHS certification.

Scope of application

Detector of PM2.5;Purifier.

Working principle

Using laser scattering principle:

Light scattering can be induced when particles go through the detecting area. The scattered light is transformed into electrical signals and these signals will be amplified and processed. The number and diameter of particles can be obtained by analysis because the signal waveform has certain relations with the particles diameter.

Technical Parameters

| No | Item | Parameter | Note |
|----|------------------------|--|----------------|
| 1 | Measurement parameters | PM2.5,PM10 | |
| 2 | Range | 0.0-999.9 $\mu\text{g} / \text{m}^3$ | |
| 3 | Rated voltage | 5V | |
| 4 | Rated current | 70mA \pm 10mA | |
| 5 | Sleep current | <4 mA | Lase&Fan sleep |
| 6 | Temperature range | Storage environment: -20 ~ +60 $^{\circ}\text{C}$ | |



| | | | |
|----|-----------------------------------|--|---------------|
| | | Work environment: -10 ~ +50℃ | |
| 7 | Humidity range | Storage environment: Max 90% | |
| | | Work environment: Max 70% | |
| 8 | Air pressure | 86KPa~110KPa | |
| 9 | Corresponding time | 1s | |
| 10 | Serial data output frequency | 1Hz | |
| 11 | Minimum resolution of particle | 0.3 μm | |
| 12 | Counting yield | 70%@0.3μm 98%@0.5μm | |
| 13 | Relative error | Maximum of ± 15% and ±10μg/m ³ | 25℃, 50%RH |
| 14 | Product size | 71x70x23mm | |
| 15 | Certification | CE/FCC/RoHS | |

Power requirement

Power Voltage: 4.7~5.3V

Power supply: >1W

Supply voltage ripple: <20mV

About service life

Service life is the key parameter of laser dust sensor. The laser diode in this sensor has high quality and its service life is up to 8000 hours. If you need real-time data (such as detector), you can use the default configuration that measures at the frequency of 1time per second. On the occasion of real-time demand is not high (such as filter, air quality monitoring, etc.), you can use the discontinuous working method to prolong the service life. For example, you can start the sensor for 30 seconds per minutes. If you have any other requirements, please contact us, we are willing to serve for manufacturers and developers.

Product specifications

1.Product size

L*W*H=71*70*23mm

2.Interface specification

| No | Name | Comment |
|----|-------|---|
| 1 | NC | Not Connect |
| 2 | 1μm | PM2.5: 0-999μg/m ³ ;PWM Output |
| 3 | 5V | 5V Input |
| 4 | 2.5μm | PM10: 0-999 μg/m ³ ;PWM Output |
| 5 | GND | Ground |

| | | |
|---|---|------------------------|
| 6 | R | RX of UART (TTL) @3.3V |
| 7 | T | TX of UART (TTL) @3.3V |

PS: The distance between each pin is 2.54mm.

The UART communication protocol

Bit rate : 9600

Data bit : 8

Parity bit: NO

Stop bit : 1

Data Packet frequency: 1Hz

| The number of bytes | Name | Content |
|---------------------|----------------|-----------------|
| 0 | Message header | AA |
| 1 | Commander No. | C0 |
| 2 | DATA 1 | PM2.5 Low byte |
| 3 | DATA 2 | PM2.5 High byte |
| 4 | DATA 3 | PM10 Low byte |
| 5 | DATA 4 | PM10 High byte |
| 6 | DATA 5 | ID byte 1 |
| 7 | DATA 6 | ID byte 2 |
| 8 | Check-sum | Check-sum |
| 9 | Message tail | AB |

Check-sum: Check-sum=DATA1+DATA2+...+DATA6 。


PM2.5 value: $PM2.5 (\mu g / m^3) = ((PM2.5 \text{ High byte} * 256) + PM2.5 \text{ low byte}) / 10$

PM10 value: $PM10 (\mu g / m^3) = ((PM10 \text{ high byte} * 256) + PM10 \text{ low byte}) / 10$

PWM output description

| | |
|--|---------------------|
| Range of PM2.5 value | 0-999 $\mu g / m^3$ |
| Range of PM10 value | 0-999 $\mu g / m^3$ |
| Cycle | 1004ms $\pm 1\%$ |
| High level output time at the beginning of the whole cycle | 2ms |
| The middle time of this cycle | 1000ms $\pm 1\%$ |
| Low level output time at the end of the whole cycle | 2ms |

Schematic diagram of output:

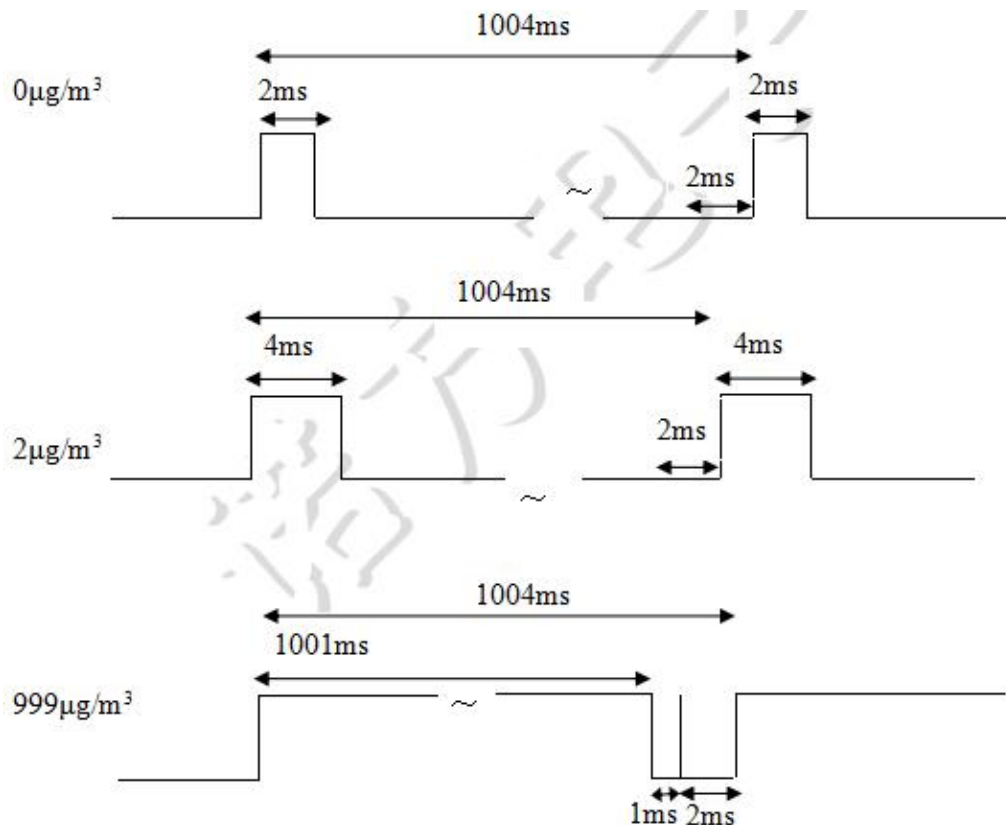


Extended functionality

1. Manual hibernation(Sleep and wake up)
2. Timed hibernate(Cycle to work)
3. User ID setting
4. Set data reporting mode(Active report and query report)
5. Version number query


If you have any other requirements, please contact us.


Installation size

1. Basic structure



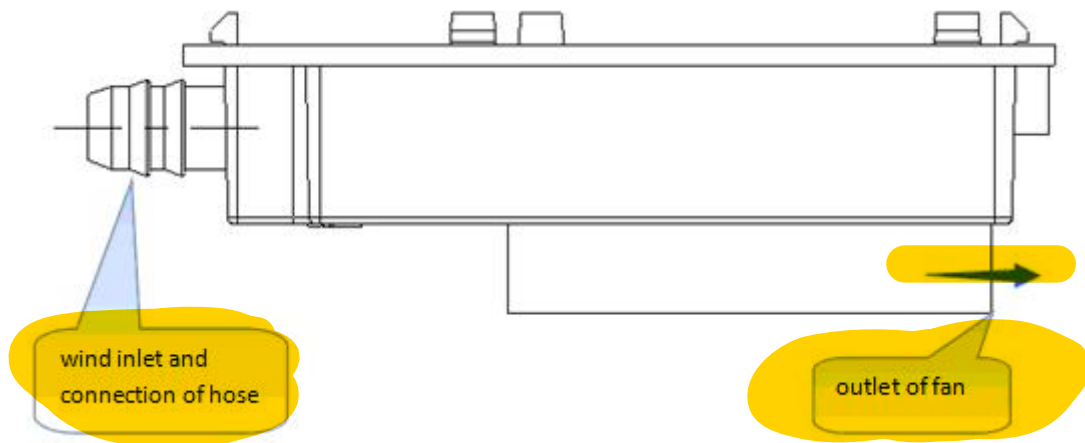


2. Basic dimensions

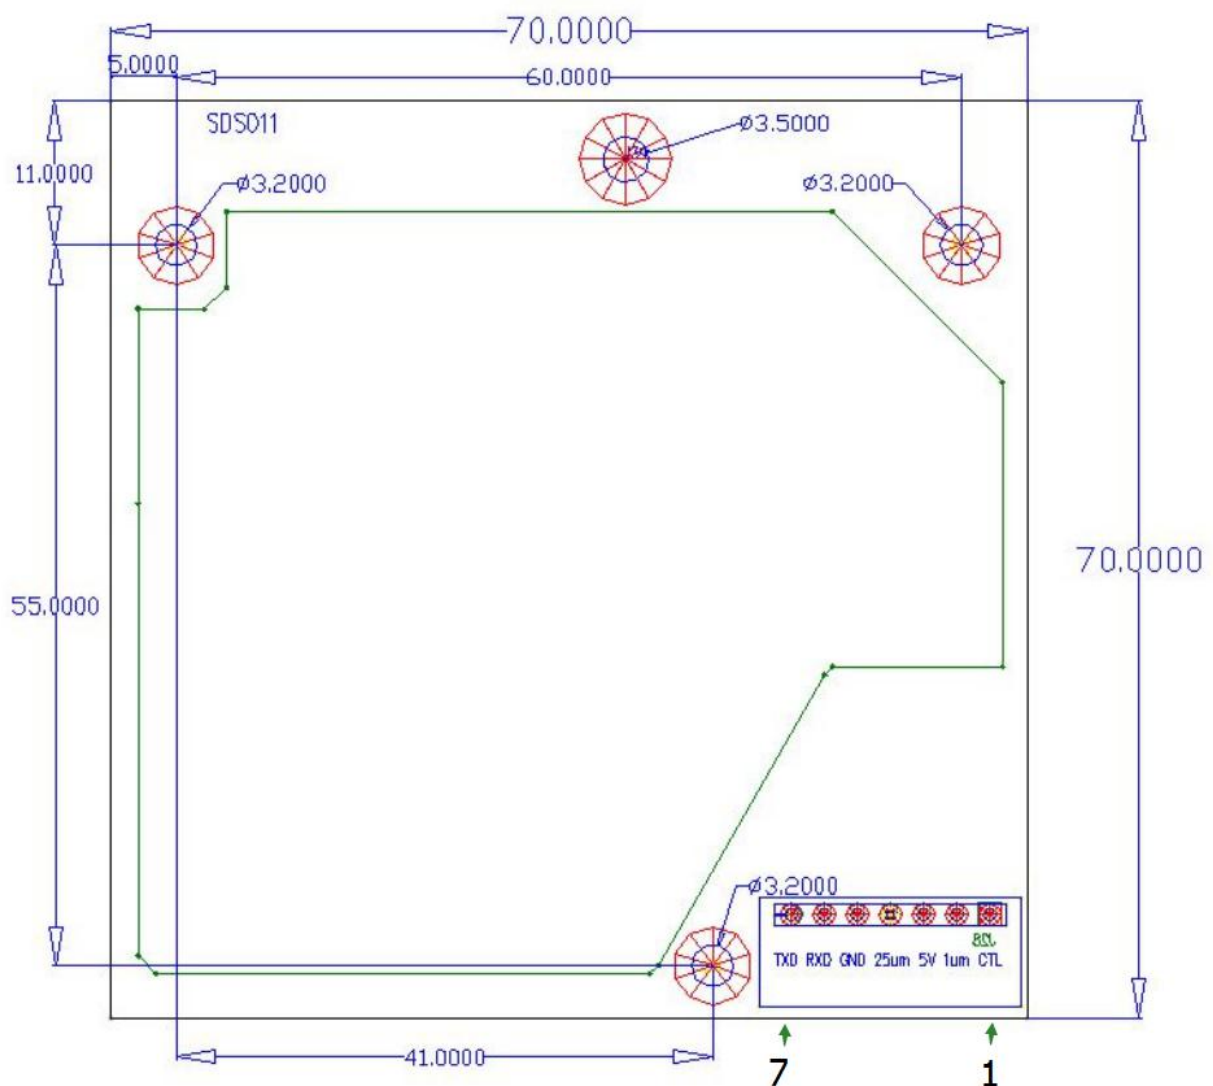

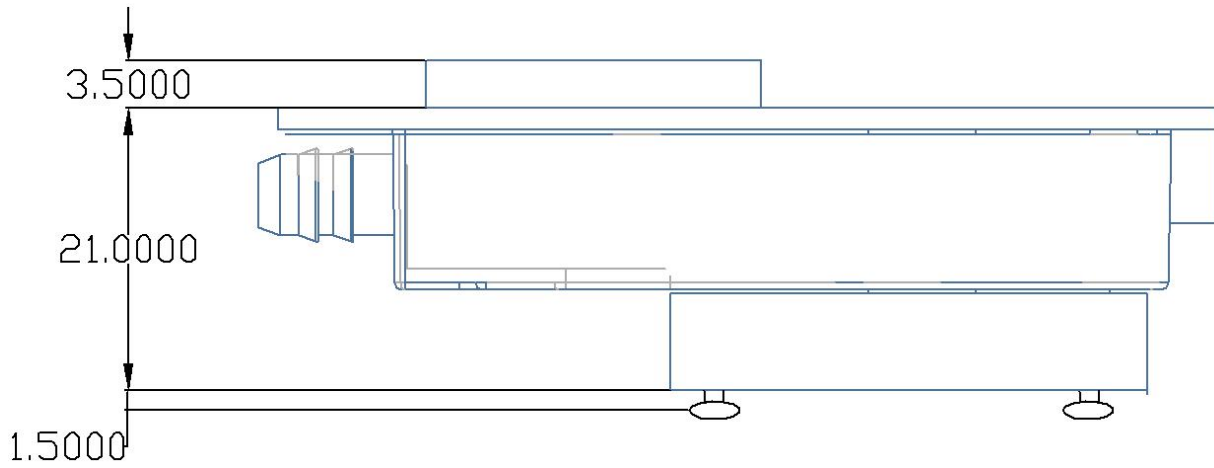

3. Recommended installation direction

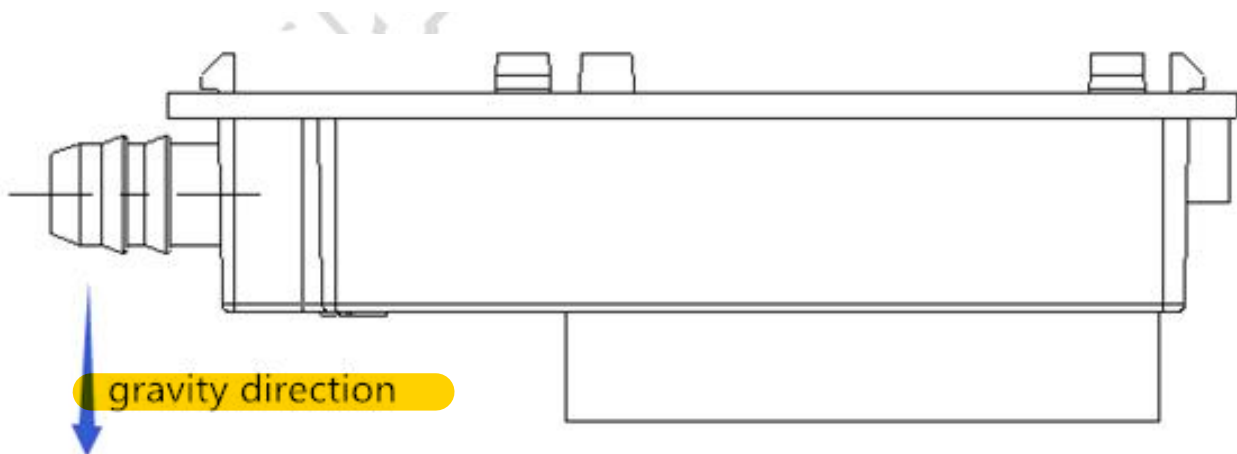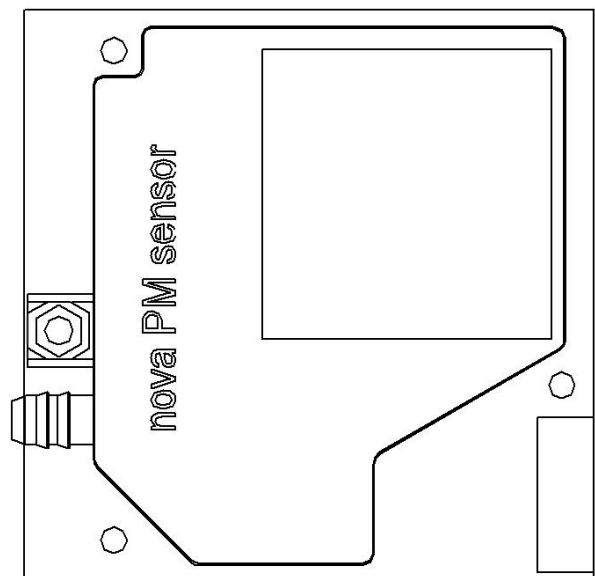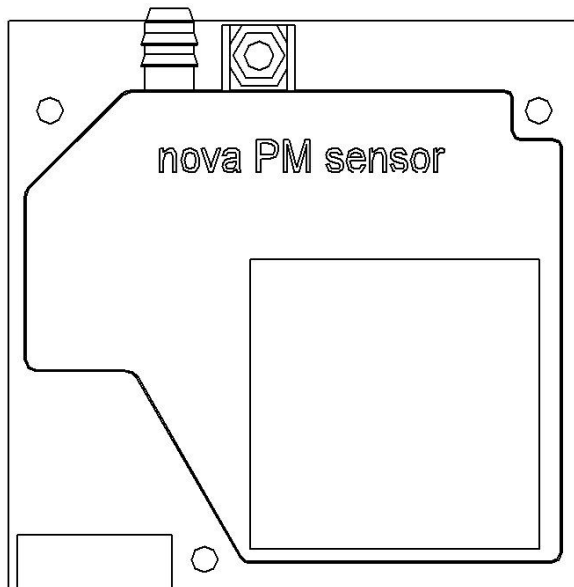

4. Hose connection: optional. It can be connected with the hose of 6mm inner diameter and 8mm external diameter. The hose cannot be longer

than 1m, the shorter the better. The hose must keep the air flowing.

5. Prevent glare: the sensor has shading device inside, so it can work normally under the common light. You should pay attention to prevent the inlet, outlet from direct light.

6. Keep the inlet and outlet unobstructed.

Package



There are 24 sensors on each floor



Each box: $4 \times 24 = 96$

Matters needing attention

1. In the context of the sensor power supply;
2. Note the process design to ensure smoothness and stability of sensor airflow;
3. Please ensure that the sensor to work under normal conditions of temperature and humidity;
4. Avoid severe vibration during transport, so as not to affect the accuracy of detection and accuracy;
5. Follow this specification is the correct sensor installation.
6. Do not light into the air inlet.

Contact

Nova Fitness Co.,Ltd

TEL : +86-0531-82868288

FAX: +86-0531-82868198

www.inovafitness.com