

1. Description


1.1. Project

Project Name	TRY
Board Name	custom
Generated with:	STM32CubeMX 5.0.0
Date	12/25/2018

1.2. MCU

MCU Series	STM32F4
MCU Line	STM32F407/417
MCU name	STM32F407ZGTx
MCU Package	LQFP144
MCU Pin number	144

2. Pinout Configuration

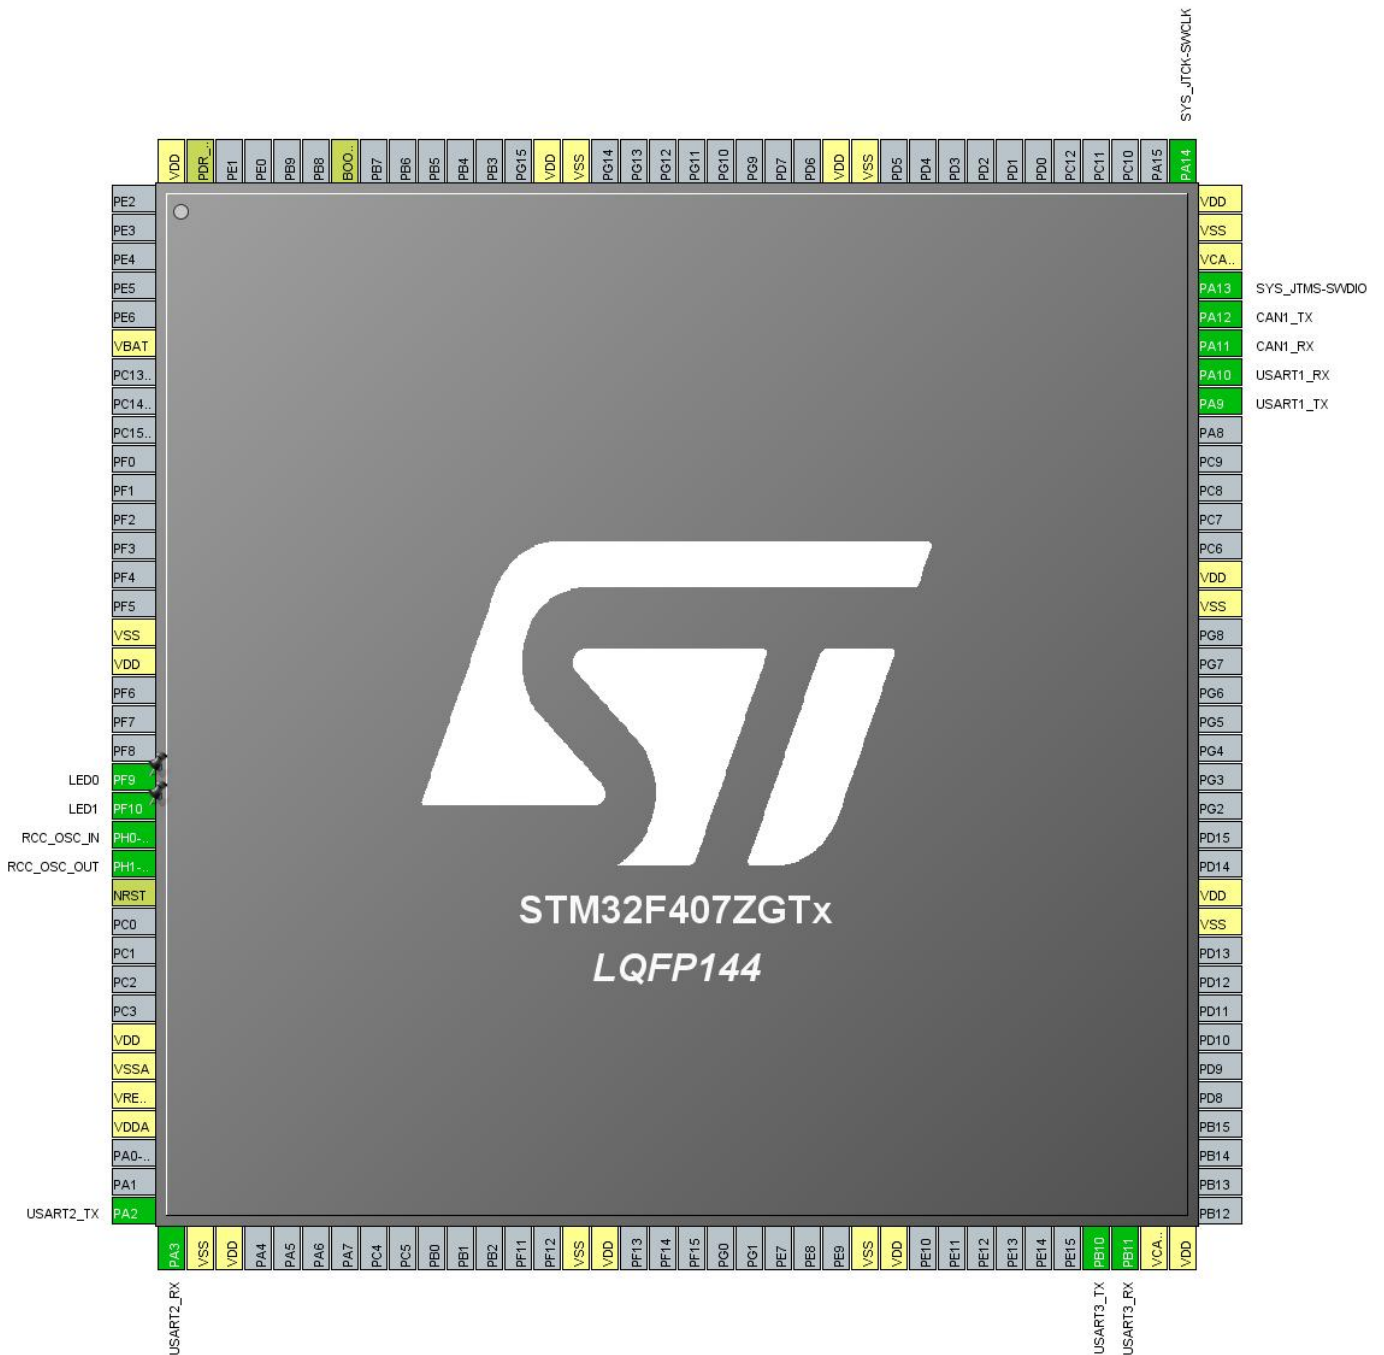


3. Pins Configuration

Pin Number LQFP144	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
6	VBAT	Power		
16	VSS	Power		
17	VDD	Power		
21	PF9 *	I/O	GPIO_Output	LED0
22	PF10 *	I/O	GPIO_Output	LED1
23	PH0-OSC_IN	I/O	RCC_OSC_IN	
24	PH1-OSC_OUT	I/O	RCC_OSC_OUT	
25	NRST	Reset		
30	VDD	Power		
31	VSSA	Power		
32	VREF+	Power		
33	VDDA	Power		
36	PA2	I/O	USART2_TX	
37	PA3	I/O	USART2_RX	
38	VSS	Power		
39	VDD	Power		
51	VSS	Power		
52	VDD	Power		
61	VSS	Power		
62	VDD	Power		
69	PB10	I/O	USART3_TX	
70	PB11	I/O	USART3_RX	
71	VCAP_1	Power		
72	VDD	Power		
83	VSS	Power		
84	VDD	Power		
94	VSS	Power		
95	VDD	Power		
101	PA9	I/O	USART1_TX	
102	PA10	I/O	USART1_RX	
103	PA11	I/O	CAN1_RX	
104	PA12	I/O	CAN1_TX	
105	PA13	I/O	SYS_JTMS-SWDIO	
106	VCAP_2	Power		
107	VSS	Power		
108	VDD	Power		

Pin Number LQFP144	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
109	PA14	I/O	SYS_JTCK-SWCLK	
120	VSS	Power		
121	VDD	Power		
130	VSS	Power		
131	VDD	Power		
138	BOOT0	Boot		
143	PDR_ON	Reset		
144	VDD	Power		

* The pin is affected with an I/O function

4. Clock Tree Configuration

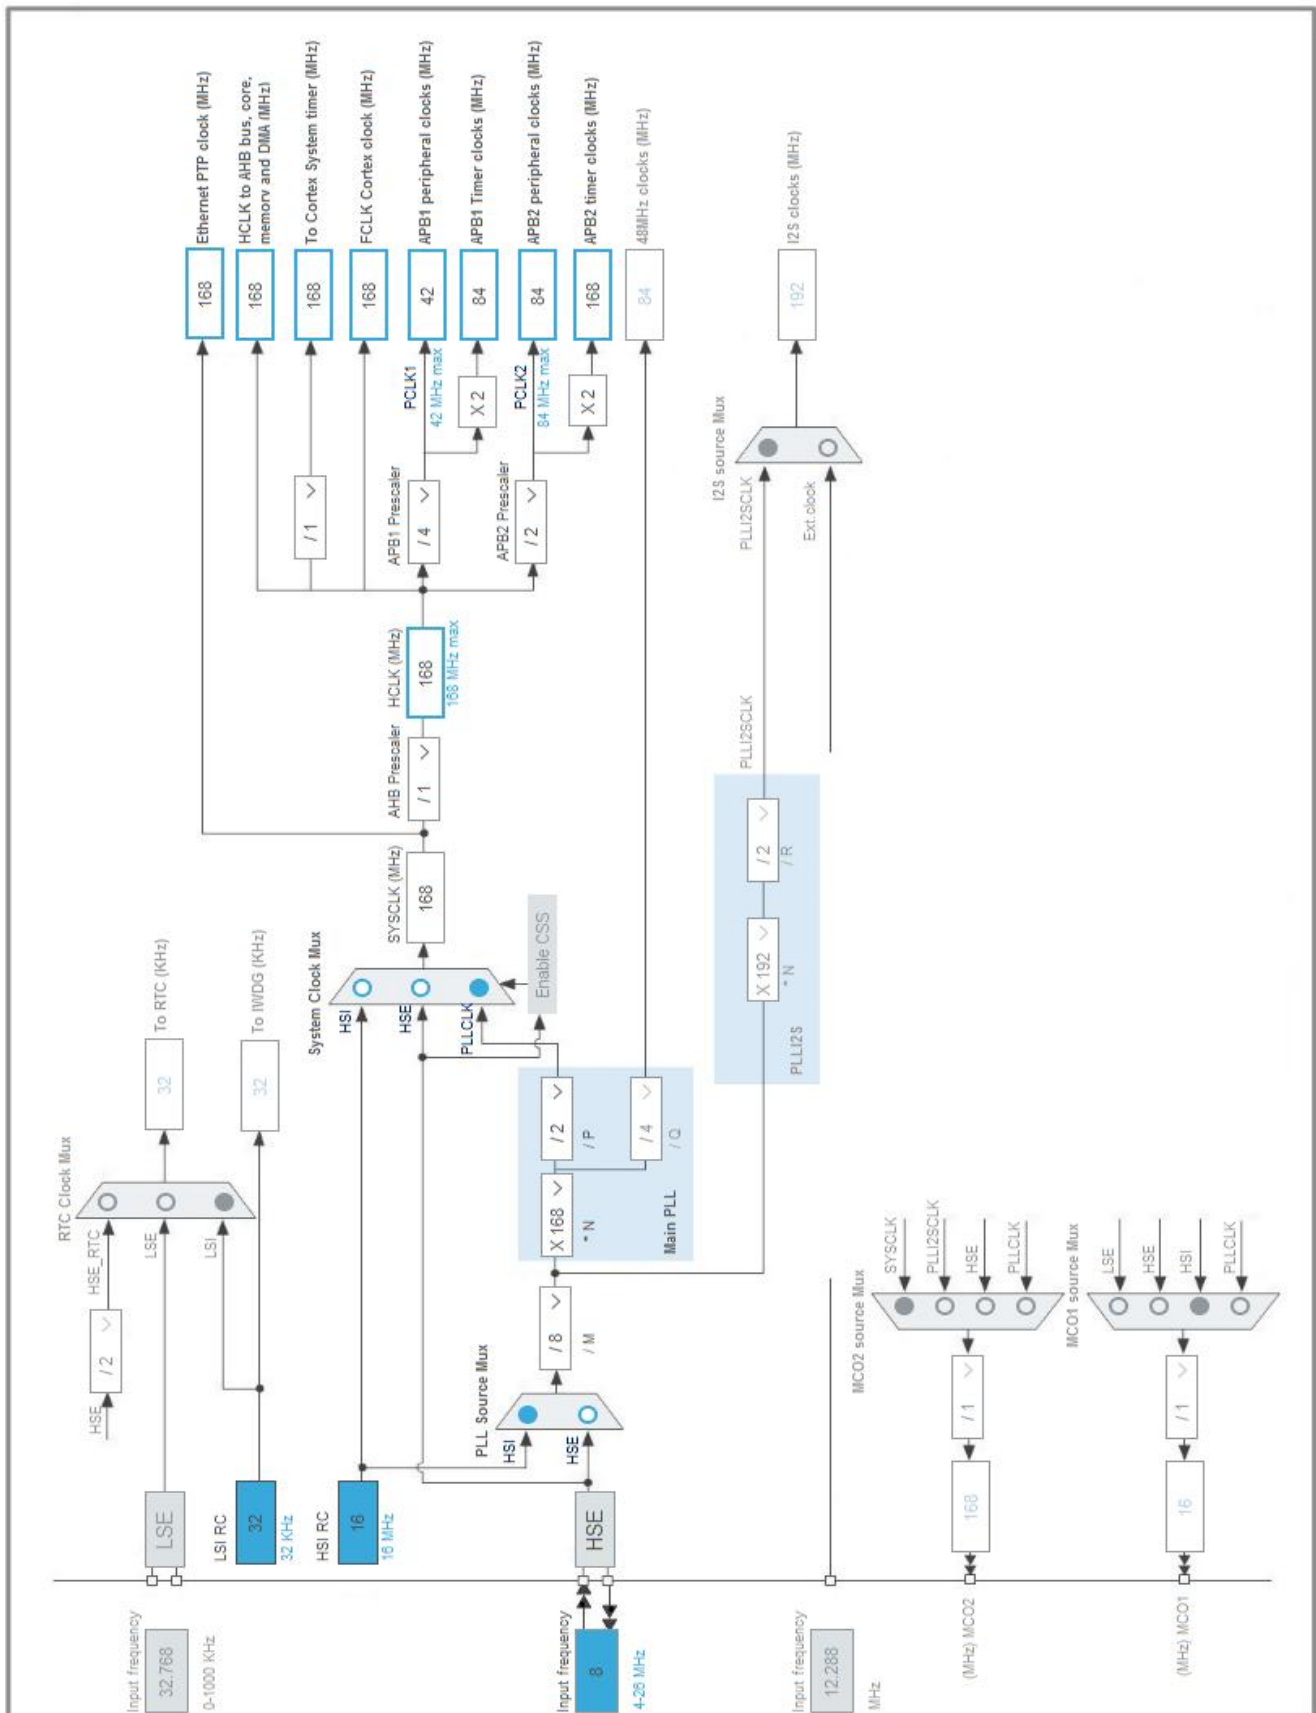

5. Software Project

5.1. Project Settings

Name	Value
Project Name	TRY
Project Folder	E:\RM\TRY
Toolchain / IDE	MDK-ARM V5
Firmware Package Name and Version	STM32Cube FW_F4 V1.23.0

5.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy all used libraries into the project folder
Generate peripheral initialization as a pair of '.c/.h' files	Yes
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power consumption)	No

6. Power Consumption Calculator report

6.1. Microcontroller Selection

Series	STM32F4
Line	STM32F407/417
MCU	STM32F407ZGTx
Datasheet	022152_Rev8

6.2. Parameter Selection

Temperature	25
Vdd	3.3

7. IPs and Middleware Configuration

7.1. CAN1

mode: Mode

7.1.1. Parameter Settings:

Bit Timings Parameters:

Prescaler (for Time Quantum)	3 *
Time Quantum	71.42857142857143 *
Time Quanta in Bit Segment 1	9 Times *
Time Quanta in Bit Segment 2	4 Times *
ReSynchronization Jump Width	1 Time

Basic Parameters:

Time Triggered Communication Mode	Disable
Automatic Bus-Off Management	Disable
Automatic Wake-Up Mode	Disable
No-Automatic Retransmission	Disable
Receive Fifo Locked Mode	Disable
Transmit Fifo Priority	Enable *

Advanced Parameters:

Operating Mode	Normal
----------------	--------

7.2. RCC

High Speed Clock (HSE): Crystal/Ceramic Resonator

7.2.1. Parameter Settings:

System Parameters:

VDD voltage (V)	3.3
Instruction Cache	Enabled
Prefetch Buffer	Enabled
Data Cache	Enabled
Flash Latency(WS)	5 WS (6 CPU cycle)

RCC Parameters:

HSI Calibration Value	16
HSE Startup Timeout Value (ms)	100
LSE Startup Timeout Value (ms)	5000

Power Parameters:

Power Regulator Voltage Scale	Power Regulator Voltage Scale 1
-------------------------------	---------------------------------

7.3. SYS

Debug: Serial Wire

Timebase Source: SysTick

7.4. TIM3

Clock Source : Internal Clock

7.4.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	8399 *
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	39 *
Internal Clock Division (CKD)	No Division

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

7.5. TIM4

Clock Source : Internal Clock

7.5.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	8399 *
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	9 *
Internal Clock Division (CKD)	No Division

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

7.6. USART1

Mode: Asynchronous

7.6.1. Parameter Settings:

Basic Parameters:

Baud Rate	115200
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples

7.7. USART2

Mode: Asynchronous

7.7.1. Parameter Settings:

Basic Parameters:

Baud Rate	100000 *
Word Length	8 Bits (including Parity)
Parity	Even *
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples

7.8. USART3

Mode: Asynchronous

7.8.1. Parameter Settings:

Basic Parameters:

Baud Rate	115200
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
----------------	----------------------

Over Sampling

16 Samples

7.9. FREERTOS

mode: Enabled

7.9.1. Config parameters:

Versions:

FreeRTOS version	9.0.0
CMSIS-RTOS version	1.02

Kernel settings:

USE_PREEMPTION	Enabled
CPU_CLOCK_HZ	SystemCoreClock
TICK_RATE_HZ	1000
MAX_PRIORITIES	7
MINIMAL_STACK_SIZE	128
MAX_TASK_NAME_LEN	16
USE_16_BIT_TICKS	Disabled
IDLE_SHOULD_YIELD	Enabled
USE_MUTEXES	Enabled
USE_RECURSIVE_MUTEXES	Disabled
USE_COUNTING_SEMAPHORES	Disabled
QUEUE_REGISTRY_SIZE	8
USE_APPLICATION_TASK_TAG	Disabled
ENABLE_BACKWARD_COMPATIBILITY	Enabled
USE_PORT_OPTIMISED_TASK_SELECTION	Enabled
USE_TICKLESS_IDLE	Disabled
USE_TASK_NOTIFICATIONS	Enabled

Memory management settings:

Memory Allocation	Dynamic
TOTAL_HEAP_SIZE	15360
Memory Management scheme	heap_4

Hook function related definitions:

USE_IDLE_HOOK	Disabled
USE_TICK_HOOK	Disabled
USE_MALLOC_FAILED_HOOK	Disabled
USE_DAEMON_TASK_STARTUP_HOOK	Disabled
CHECK_FOR_STACK_OVERFLOW	Disabled

Run time and task stats gathering related definitions:

GENERATE_RUN_TIME_STATS	Disabled
USE_TRACE_FACILITY	Disabled

USE_STATS_FORMATTING_FUNCTIONS Disabled

Co-routine related definitions:

USE_CO_ROUTINES Disabled

MAX_CO_ROUTINE_PRIORITIES 2

Software timer definitions:

USE_TIMERS Disabled

Interrupt nesting behaviour configuration:

LIBRARY_LOWEST_INTERRUPT_PRIORITY 15

LIBRARY_MAX_SYSCALL_INTERRUPT_PRIORITY 5

7.9.2. Include parameters:

Include definitions:

vTaskPrioritySet Enabled

uxTaskPriorityGet Enabled

vTaskDelete Enabled

vTaskCleanUpResources Disabled

vTaskSuspend Enabled

vTaskDelayUntil Disabled

vTaskDelay Enabled

xTaskGetSchedulerState Enabled

xTaskResumeFromISR Enabled

xQueueGetMutexHolder Disabled

xSemaphoreGetMutexHolder Disabled

pcTaskGetTaskName Disabled

uxTaskGetStackHighWaterMark Disabled

xTaskGetCurrentTaskHandle Disabled

eTaskGetState Disabled

xEventGroupSetBitFromISR Disabled

xTimerPendFunctionCall Disabled

xTaskAbortDelay Disabled

xTaskGetHandle Disabled

*** User modified value**

8. System Configuration

8.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
CAN1	PA11	CAN1_RX	Alternate Function Push Pull	No pull-up and no pull-down	Very High *	
	PA12	CAN1_TX	Alternate Function Push Pull	No pull-up and no pull-down	Very High *	
RCC	PH0-OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
	PH1-OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
SYS	PA13	SYS_JTMS-SWDIO	n/a	n/a	n/a	
	PA14	SYS_JTCK-SWCLK	n/a	n/a	n/a	
USART1	PA9	USART1_TX	Alternate Function Push Pull	Pull-up	Very High *	
	PA10	USART1_RX	Alternate Function Push Pull	Pull-up	Very High *	
USART2	PA2	USART2_TX	Alternate Function Push Pull	Pull-up	Very High *	
	PA3	USART2_RX	Alternate Function Push Pull	Pull-up	Very High *	
USART3	PB10	USART3_TX	Alternate Function Push Pull	Pull-up	Very High *	
	PB11	USART3_RX	Alternate Function Push Pull	Pull-up	Very High *	
GPIO	PF9	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LED0
	PF10	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LED1

8.2. DMA configuration

DMA request	Stream	Direction	Priority
USART2_RX	DMA1_Stream5	Peripheral To Memory	Very High *

USART2_RX: DMA1_Stream5 DMA request Settings:

Mode: **Circular ***
Use fifo: Disable
Peripheral Increment: Disable
Memory Increment: **Enable ***
Peripheral Data Width: Byte
Memory Data Width: Byte

8.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority
Non maskable interrupt	true	0	0
Hard fault interrupt	true	0	0
Memory management fault	true	0	0
Pre-fetch fault, memory access fault	true	0	0
Undefined instruction or illegal state	true	0	0
System service call via SWI instruction	true	0	0
Debug monitor	true	0	0
Pendable request for system service	true	15	0
System tick timer	true	15	0
DMA1 stream5 global interrupt	true	5	0
CAN1 TX interrupts	true	5	0
CAN1 RX0 interrupts	true	5	0
TIM3 global interrupt	true	5	0
TIM4 global interrupt	true	5	0
USART1 global interrupt	true	5	0
USART2 global interrupt	true	5	0
USART3 global interrupt	true	5	0
PVD interrupt through EXTI line 16	unused		
Flash global interrupt	unused		
RCC global interrupt	unused		
CAN1 RX1 interrupt	unused		
CAN1 SCE interrupt	unused		
FPU global interrupt	unused		

* User modified value

9. Software Pack Report