

1. Description


1.1. Project

Project Name	WS2812Bv1
Board Name	WS2812Bv1.0
Generated with:	STM32CubeMX 4.25.0
Date	04/10/2018

1.2. MCU

MCU Series	STM32F1
MCU Line	STM32F103
MCU name	STM32F103C8Tx
MCU Package	LQFP48
MCU Pin number	48

2. Pinout Configuration

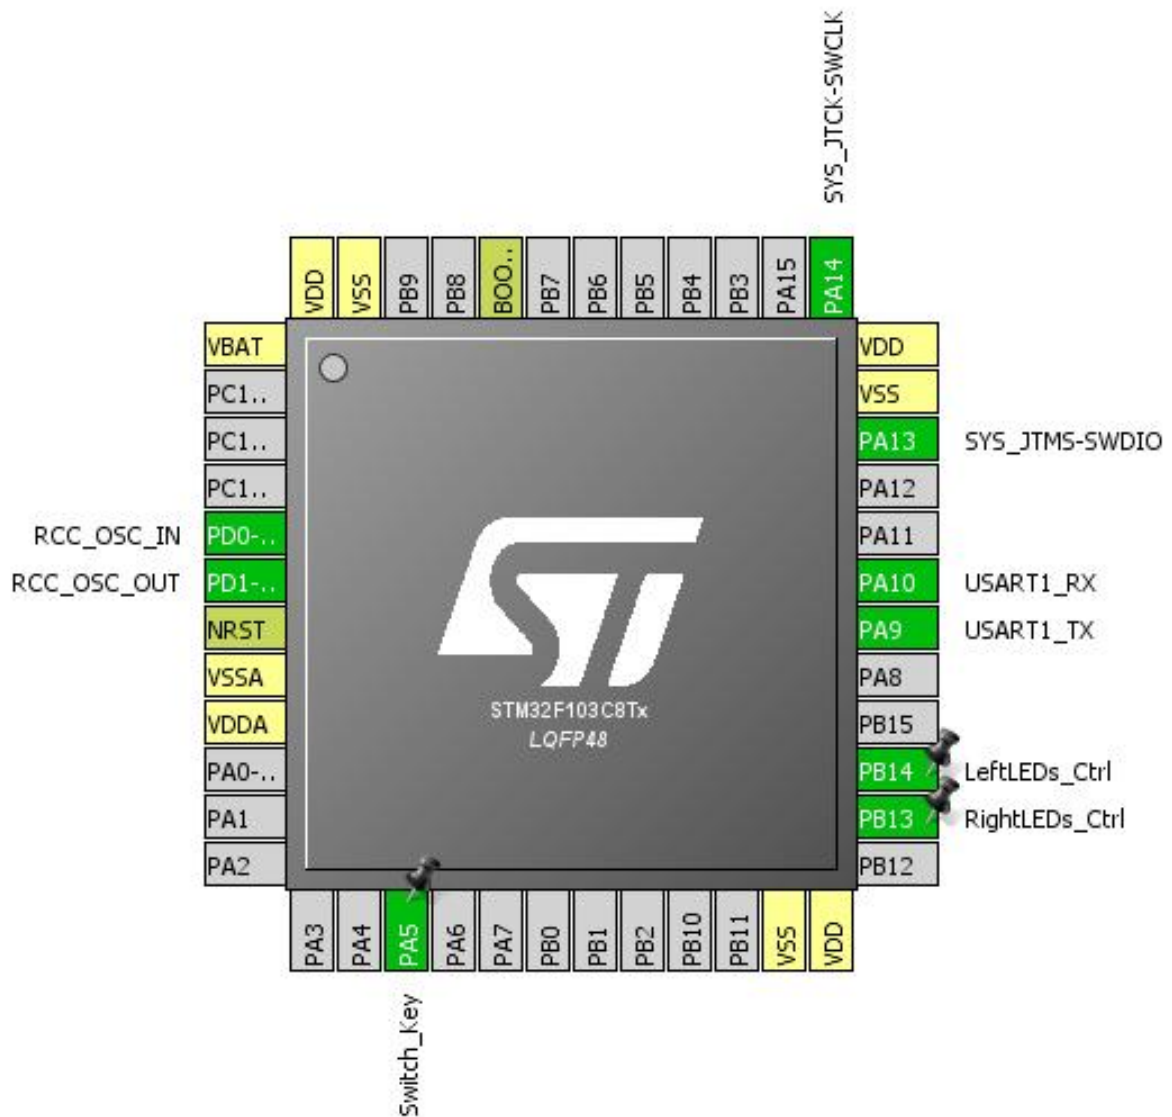

3. Pins Configuration

Pin Number LQFP48	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VBAT	Power		
5	PD0-OSC_IN	I/O	RCC_OSC_IN	
6	PD1-OSC_OUT	I/O	RCC_OSC_OUT	
7	NRST	Reset		
8	VSSA	Power		
9	VDDA	Power		
15	PA5	I/O	GPIO_EXTI5	Switch_Key
23	VSS	Power		
24	VDD	Power		
26	PB13 *	I/O	GPIO_Output	RightLEDs_Ctrl
27	PB14 *	I/O	GPIO_Output	LeftLEDs_Ctrl
30	PA9	I/O	USART1_TX	
31	PA10	I/O	USART1_RX	
34	PA13	I/O	SYS_JTMS-SWDIO	
35	VSS	Power		
36	VDD	Power		
37	PA14	I/O	SYS_JTCK-SWCLK	
44	BOOT0	Boot		
47	VSS	Power		
48	VDD	Power		

* The pin is affected with an I/O function

5. IPs and Middleware Configuration

5.1. RCC

High Speed Clock (HSE): Crystal/Ceramic Resonator

5.1.1. Parameter Settings:

System Parameters:

VDD voltage (V)	3.3
Prefetch Buffer	Enabled
Flash Latency(WS)	2 WS (3 CPU cycle)

RCC Parameters:

HSI Calibration Value	16
HSE Startup Timeout Value (ms)	100
LSE Startup Timeout Value (ms)	5000

5.2. SYS

Debug: Serial Wire

Timebase Source: SysTick

5.3. TIM3

mode: Clock Source

5.3.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	7200-1 *
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	1000-1 *
Internal Clock Division (CKD)	No Division
auto-reload preload	Disable

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

5.4. USART1

Mode: Asynchronous

5.4.1. Parameter Settings:

Basic Parameters:

Baud Rate	115200
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples

* User modified value

6. System Configuration

6.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
RCC	PD0-OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
	PD1-OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
SYS	PA13	SYS_JTMS-SWDIO	n/a	n/a	n/a	
	PA14	SYS_JTCK-SWCLK	n/a	n/a	n/a	
USART1	PA9	USART1_TX	Alternate Function Push Pull	n/a	High *	
	PA10	USART1_RX	Input mode	No pull-up and no pull-down	n/a	
GPIO	PA5	GPIO_EXTI5	External Interrupt Mode with Rising edge trigger detection	No pull-up and no pull-down	n/a	Switch_Key
	PB13	GPIO_Output	Output Push Pull	n/a	High *	RightLEDs_Ctrl
	PB14	GPIO_Output	Output Push Pull	n/a	High *	LeftLEDs_Ctrl

6.2. DMA configuration

nothing configured in DMA service

6.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority
Non maskable interrupt	true	0	0
Hard fault interrupt	true	0	0
Memory management fault	true	0	0
Prefetch fault, memory access fault	true	0	0
Undefined instruction or illegal state	true	0	0
System service call via SWI instruction	true	0	0
Debug monitor	true	0	0
Pendable request for system service	true	0	0
System tick timer	true	0	0
EXTI line[9:5] interrupts	true	0	0
TIM3 global interrupt	true	0	0
USART1 global interrupt	true	0	0
PVD interrupt through EXTI line 16	unused		
Flash global interrupt	unused		
RCC global interrupt	unused		

* User modified value

7. Power Consumption Calculator report

7.1. Microcontroller Selection

Series	STM32F1
Line	STM32F103
MCU	STM32F103C8Tx
Datasheet	13587_Rev17

7.2. Parameter Selection

Temperature	25
Vdd	3.3

8. Software Project

8.1. Project Settings

Name	Value
Project Name	WS2812Bv1.0
Project Folder	E:\Users\bertz\Documents\GitHub\001STM32_WS2812B\WS2812Bv1.0
Toolchain / IDE	EWARM
Firmware Package Name and Version	STM32Cube FW_F1 V1.6.1

8.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy all used libraries into the project folder
Generate peripheral initialization as a pair of '.c/.h' files	Yes
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power consumption)	No

9. Software Pack Report