

1. Description


1.1. Project

Project Name	lusto_motor_control
Board Name	NUCLEO-F103RB
Generated with:	STM32CubeMX 4.26.0
Date	08/18/2018

1.2. MCU

MCU Series	STM32F1
MCU Line	STM32F103
MCU name	STM32F103RBTx
MCU Package	LQFP64
MCU Pin number	64

2. Pinout Configuration

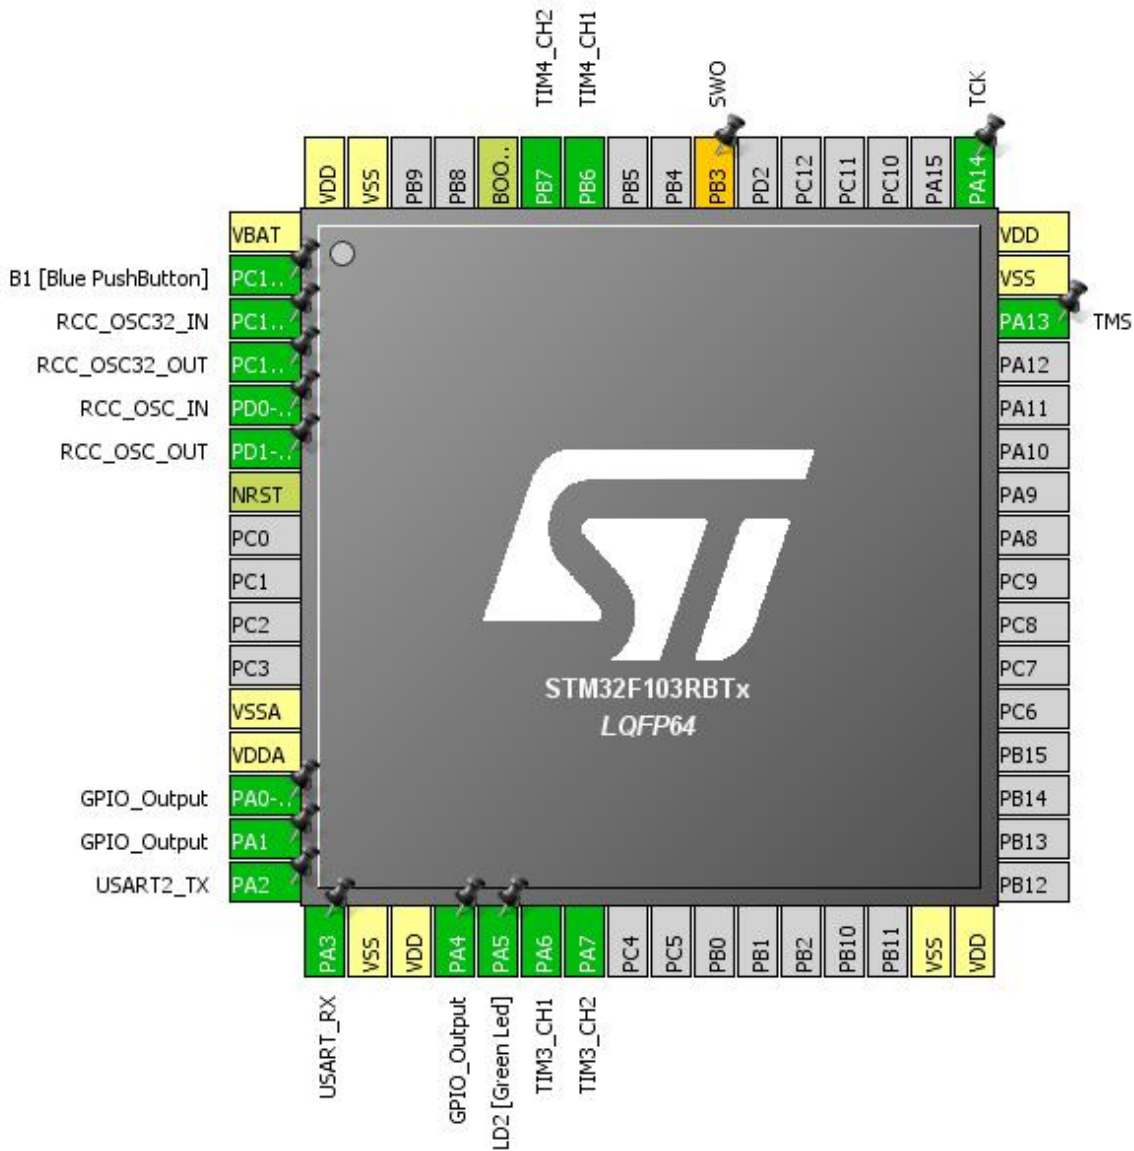


3. Pins Configuration

Pin Number LQFP64	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VBAT	Power		
2	PC13-TAMPER-RTC	I/O	GPIO_EXTI13	B1 [Blue PushButton]
3	PC14-OSC32_IN	I/O	RCC_OSC32_IN	
4	PC15-OSC32_OUT	I/O	RCC_OSC32_OUT	
5	PD0-OSC_IN	I/O	RCC_OSC_IN	
6	PD1-OSC_OUT	I/O	RCC_OSC_OUT	
7	NRST	Reset		
12	VSSA	Power		
13	VDDA	Power		
14	PA0-WKUP *	I/O	GPIO_Output	
15	PA1 *	I/O	GPIO_Output	
16	PA2	I/O	USART2_TX	
17	PA3	I/O	USART2_RX	USART_RX
18	VSS	Power		
19	VDD	Power		
20	PA4 *	I/O	GPIO_Output	
21	PA5 *	I/O	GPIO_Output	LD2 [Green Led]
22	PA6	I/O	TIM3_CH1	
23	PA7	I/O	TIM3_CH2	
31	VSS	Power		
32	VDD	Power		
46	PA13	I/O	SYS_JTMS-SWDIO	TMS
47	VSS	Power		
48	VDD	Power		
49	PA14	I/O	SYS_JTCK-SWCLK	TCK
55	PB3 **	I/O	SYS_JTDO-TRACESWO	SWO
58	PB6	I/O	TIM4_CH1	
59	PB7	I/O	TIM4_CH2	
60	BOOT0	Boot		
63	VSS	Power		
64	VDD	Power		

* The pin is affected with an I/O function

** The pin is affected with a peripheral function but no peripheral mode is activated

4. Clock Tree Configuration

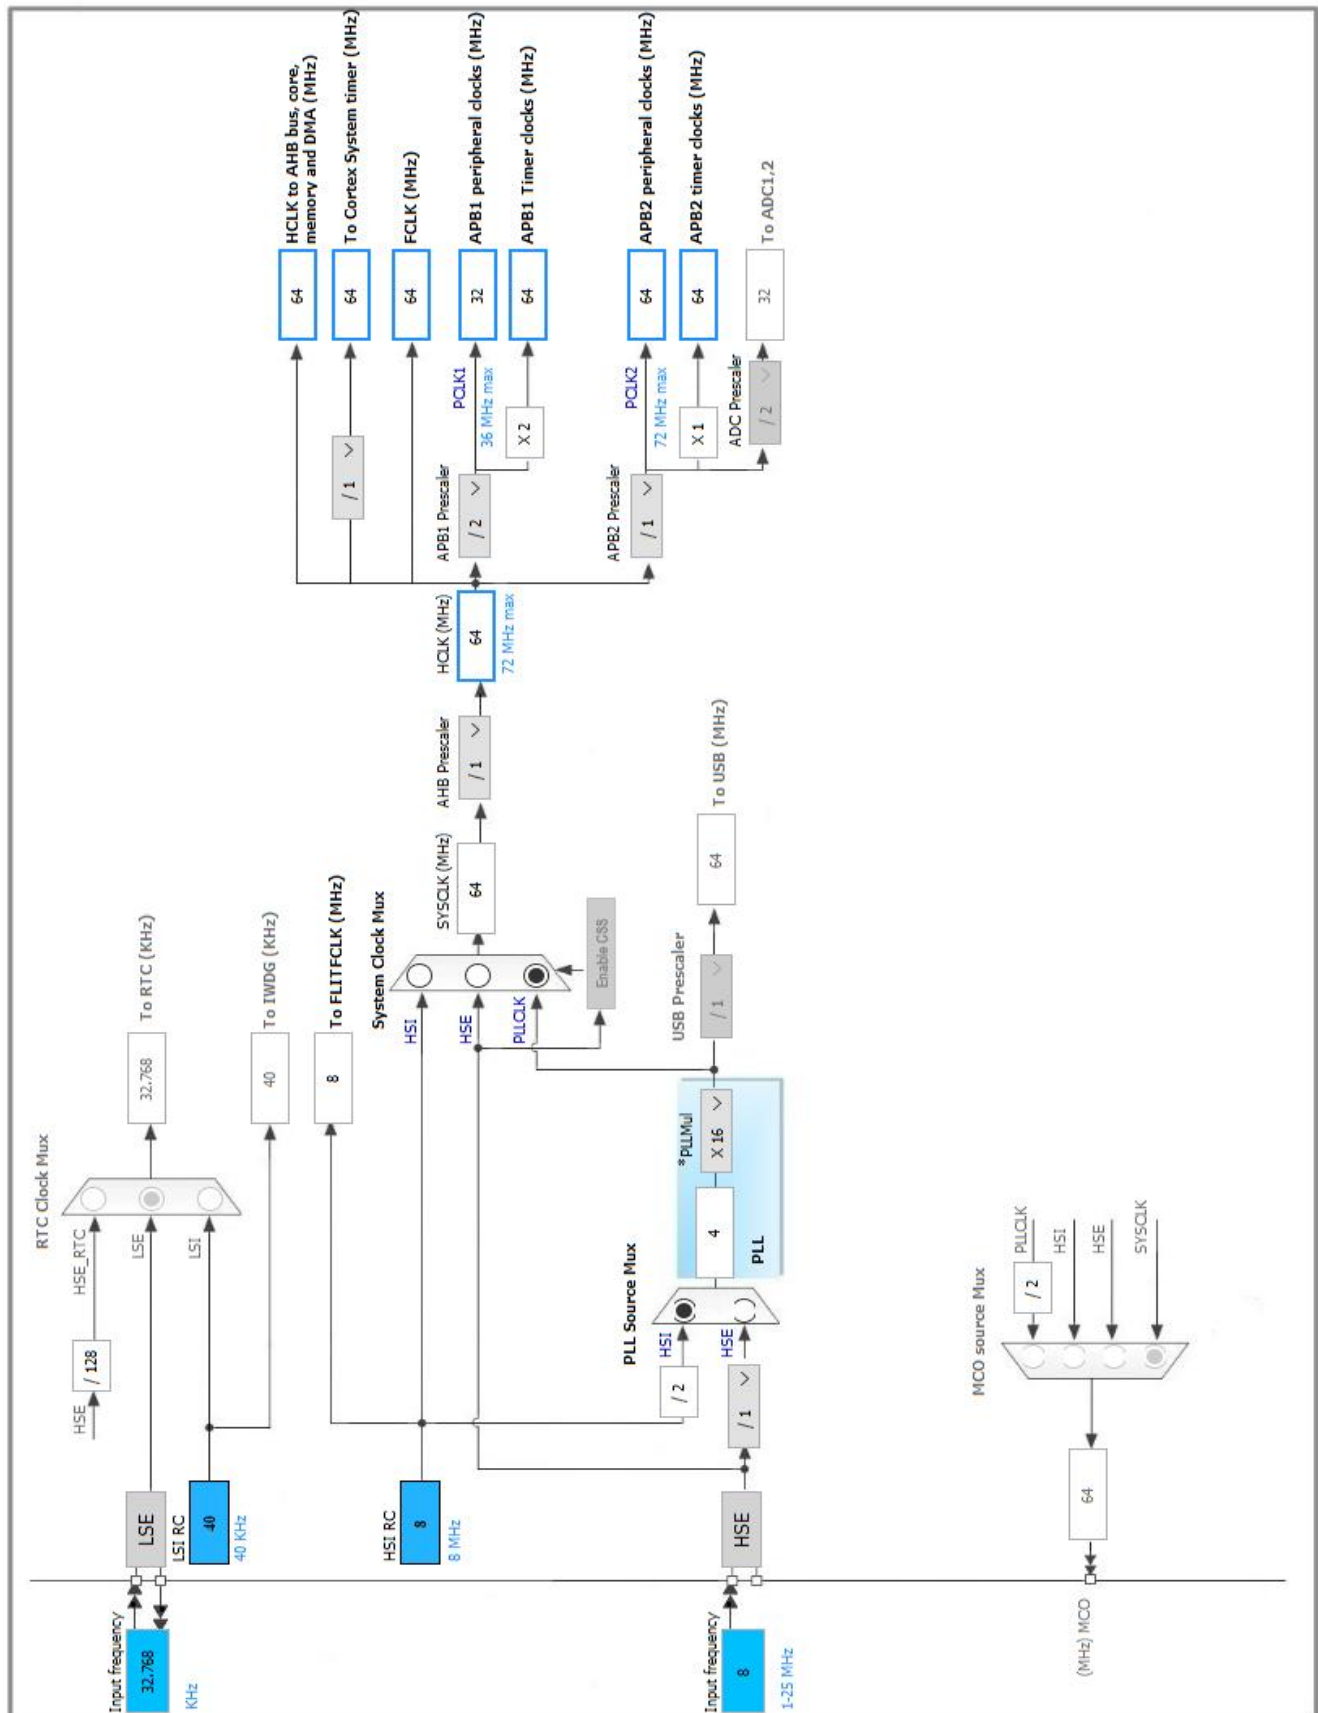

5. IPs and Middleware Configuration

5.1. RCC

High Speed Clock (HSE): BYPASS Clock Source

Low Speed Clock (LSE) : Crystal/Ceramic Resonator

5.1.1. Parameter Settings:

System Parameters:

VDD voltage (V)	3.3
Prefetch Buffer	Enabled
Flash Latency(WS)	2 WS (3 CPU cycle)

RCC Parameters:

HSI Calibration Value	16
HSE Startup Timeout Value (ms)	100
LSE Startup Timeout Value (ms)	5000

5.2. SYS

Debug: Serial Wire

Timebase Source: SysTick

5.3. TIM2

Clock Source : Internal Clock

5.3.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	10800-1 *
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	1000-1 *
Internal Clock Division (CKD)	No Division
auto-reload preload	Disable

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

5.4. TIM3

Combined Channels: Encoder Mode

5.4.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	0
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	0xFFFF *
Internal Clock Division (CKD)	No Division
auto-reload preload	Disable

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

Encoder:

Encoder Mode

Encoder Mode TI1 and TI2 *

____ Parameters for Channel 1 ____

Polarity	Rising Edge
IC Selection	Direct
Prescaler Division Ratio	No division
Input Filter	0

____ Parameters for Channel 2 ____

Polarity	Rising Edge
IC Selection	Direct
Prescaler Division Ratio	No division
Input Filter	0

5.5. TIM4

Channel1: PWM Generation CH1

Channel2: PWM Generation CH2

5.5.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value)	400-1 *
Counter Mode	Up
Counter Period (AutoReload Register - 16 bits value)	100-1 *
Internal Clock Division (CKD)	No Division
auto-reload preload	Enable *

Trigger Output (TRGO) Parameters:

Master/Slave Mode (MSM bit)	Disable (Trigger input effect not delayed)
Trigger Event Selection	Reset (UG bit from TIMx_EGR)

PWM Generation Channel 1:

Mode	PWM mode 1
Pulse (16 bits value)	0
Fast Mode	Enable *
CH Polarity	High

PWM Generation Channel 2:

Mode	PWM mode 1
Pulse (16 bits value)	0
Fast Mode	Enable *
CH Polarity	High

5.6. USART2

Mode: Asynchronous

5.6.1. Parameter Settings:

Basic Parameters:

Baud Rate	115200
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples

* User modified value

6. System Configuration

6.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
RCC	PC14-OSC32_IN	RCC_OSC32_IN	n/a	n/a	n/a	
	PC15-OSC32_OUT	RCC_OSC32_OUT	n/a	n/a	n/a	
	PD0-OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
	PD1-OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
SYS	PA13	SYS_JTMS-SWDIO	n/a	n/a	n/a	TMS
	PA14	SYS_JTCK-SWCLK	n/a	n/a	n/a	TCK
TIM3	PA6	TIM3_CH1	Input mode	Pull-up *	n/a	
	PA7	TIM3_CH2	Input mode	Pull-up *	n/a	
TIM4	PB6	TIM4_CH1	Alternate Function Push Pull	n/a	High *	
	PB7	TIM4_CH2	Alternate Function Push Pull	n/a	High *	
USART2	PA2	USART2_TX	Alternate Function Push Pull	n/a	Low	
	PA3	USART2_RX	Input mode	No pull-up and no pull-down	n/a	USART_RX
Single Mapped Signals	PB3	SYS_JTDO-TRACESWO	n/a	n/a	n/a	SWO
GPIO	PC13-TAMPER-RTC	GPIO_EXTI13	External Interrupt Mode with Rising edge trigger detection	No pull-up and no pull-down	n/a	B1 [Blue PushButton]
	PA0-WKUP	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	
	PA1	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	
	PA4	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	
	PA5	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD2 [Green Led]

6.2. DMA configuration

nothing configured in DMA service

6.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority
Non maskable interrupt	true	0	0
Hard fault interrupt	true	0	0
Memory management fault	true	0	0
Prefetch fault, memory access fault	true	0	0
Undefined instruction or illegal state	true	0	0
System service call via SWI instruction	true	0	0
Debug monitor	true	0	0
Pendable request for system service	true	0	0
System tick timer	true	0	0
TIM2 global interrupt	true	0	0
EXTI line[15:10] interrupts	true	0	0
PVD interrupt through EXTI line 16	unused		
Flash global interrupt	unused		
RCC global interrupt	unused		
TIM3 global interrupt	unused		
TIM4 global interrupt	unused		
USART2 global interrupt	unused		

* User modified value

7. Power Consumption Calculator report

7.1. Microcontroller Selection

Series	STM32F1
Line	STM32F103
MCU	STM32F103RBTx
Datasheet	13587_Rev17

7.2. Parameter Selection

Temperature	25
Vdd	3.3

8. Software Project

8.1. Project Settings

Name	Value
Project Name	lusto_motor_control
Project Folder	C:\Users\jw\Documents\lusto_motor_control
Toolchain / IDE	SW4STM32
Firmware Package Name and Version	STM32Cube FW_F1 V1.6.1

8.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy only the necessary library files
Generate peripheral initialization as a pair of '.c/.h' files	No
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power consumption)	No

9. Software Pack Report