




1. Table of Contents (This Page)
Created on Mon Apr 9 22:19:46 2012


2. component
3. solder
4. outline
5. plated-drill
6. unplated-drill
7. componentmask
8. soldermask
9. topsilk
10. bottomsilk
11. toppaste
12. bottompaste
13. topassembly
14. bottomassembly
15. fab

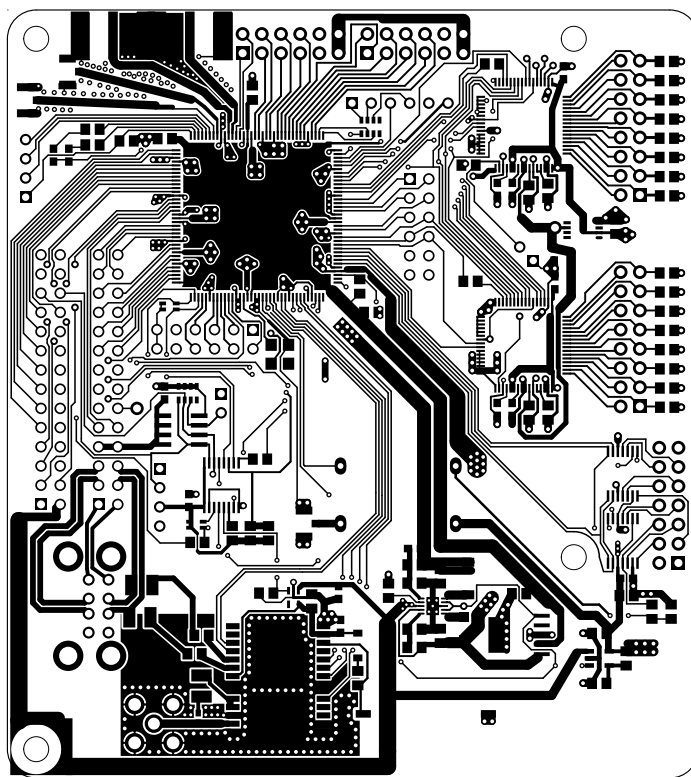

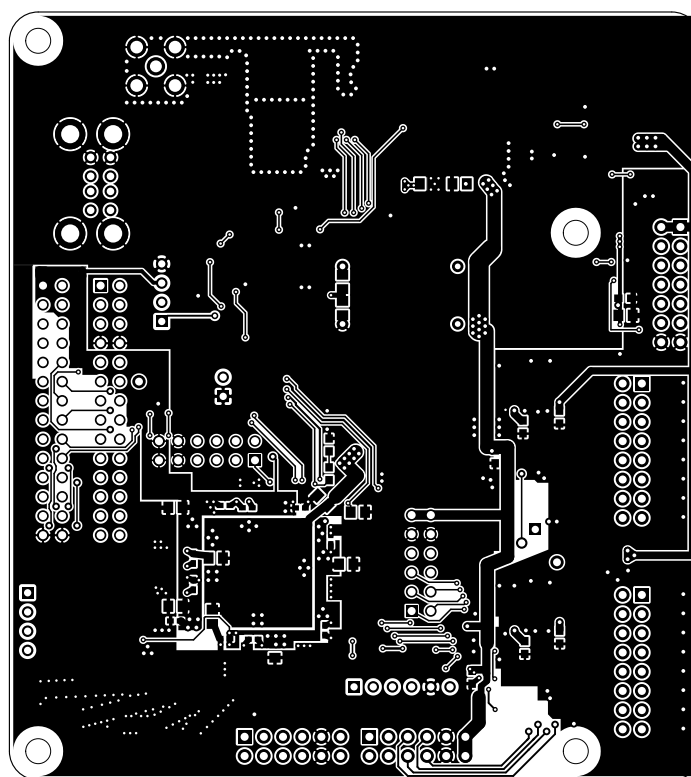



bottom (mirrored), scale = 1:1.000
pandadaq.pcb




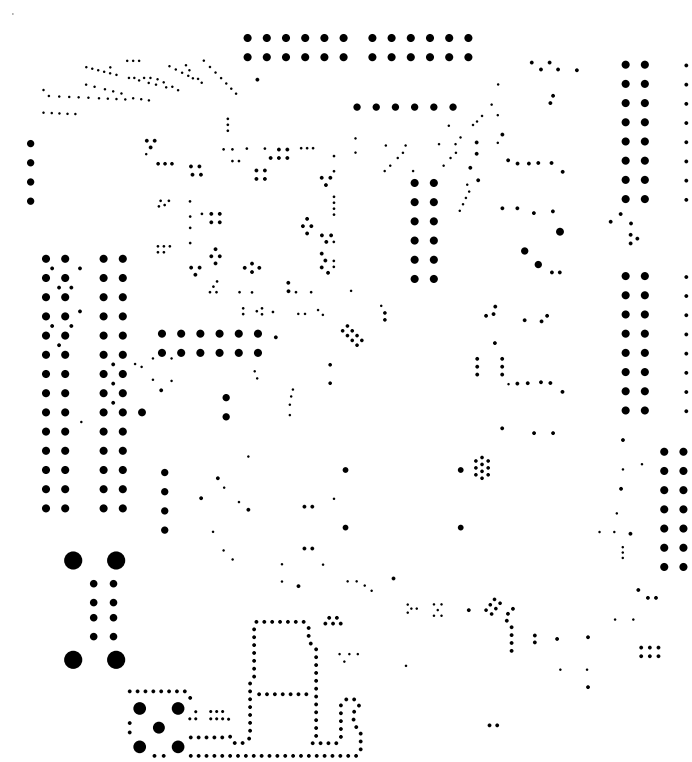





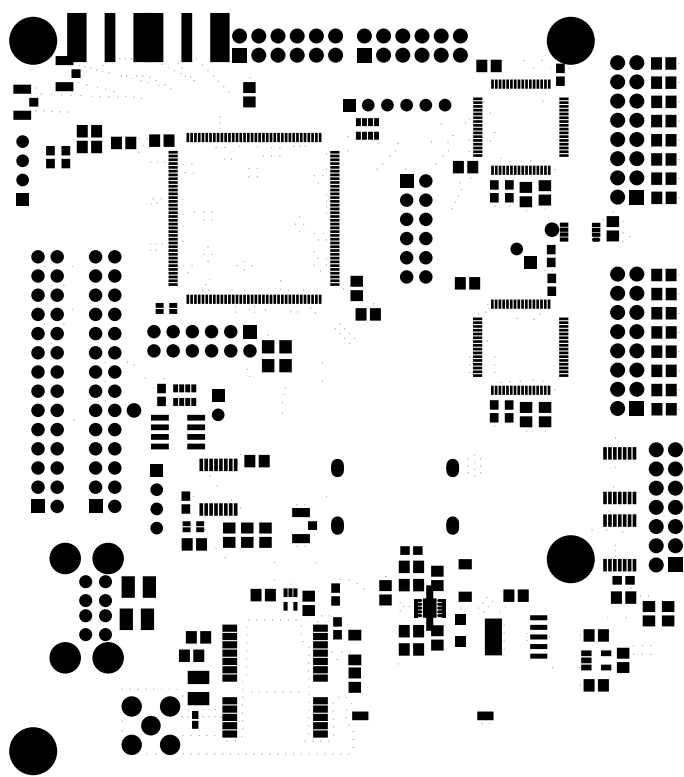


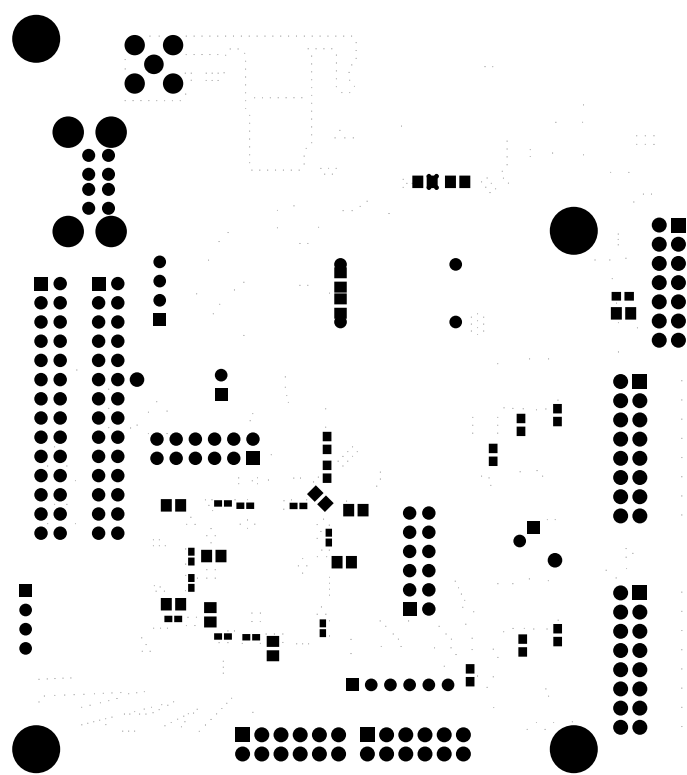





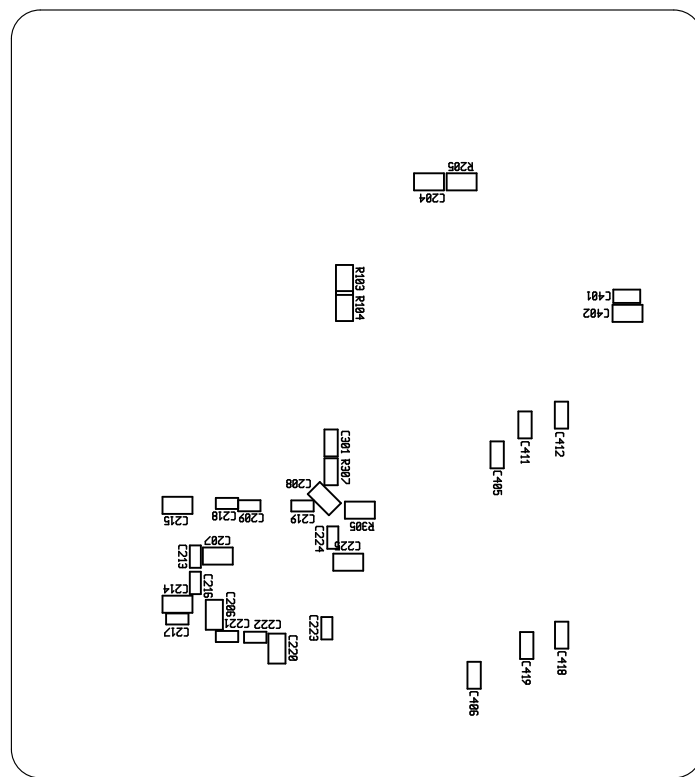

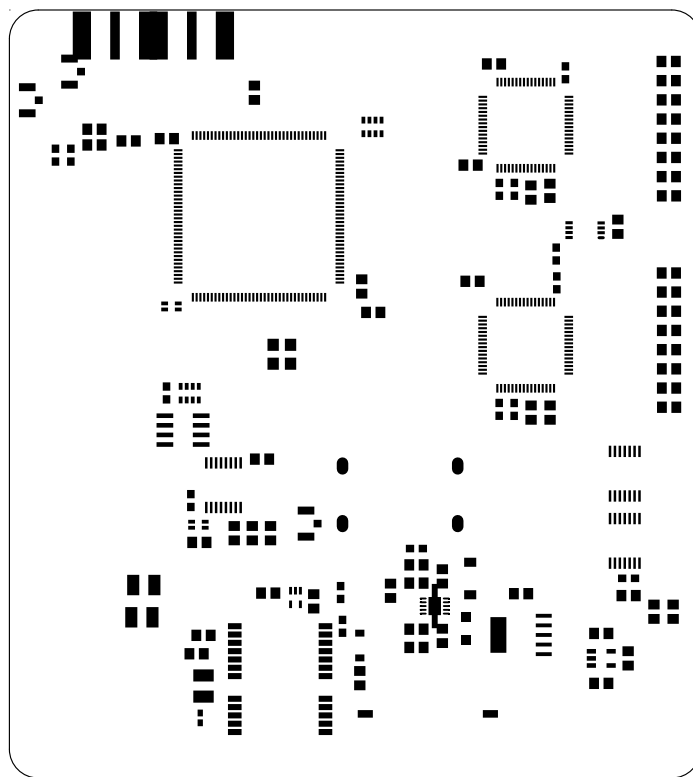

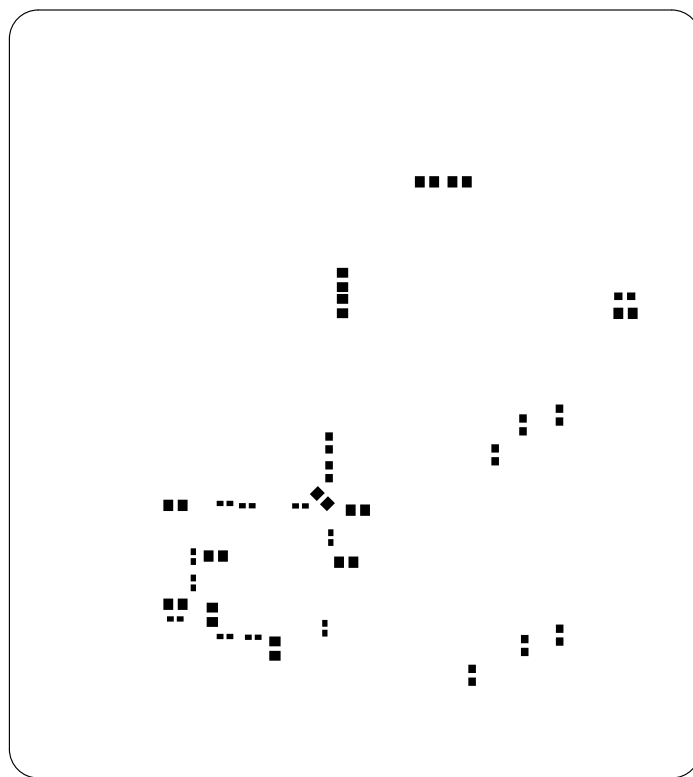



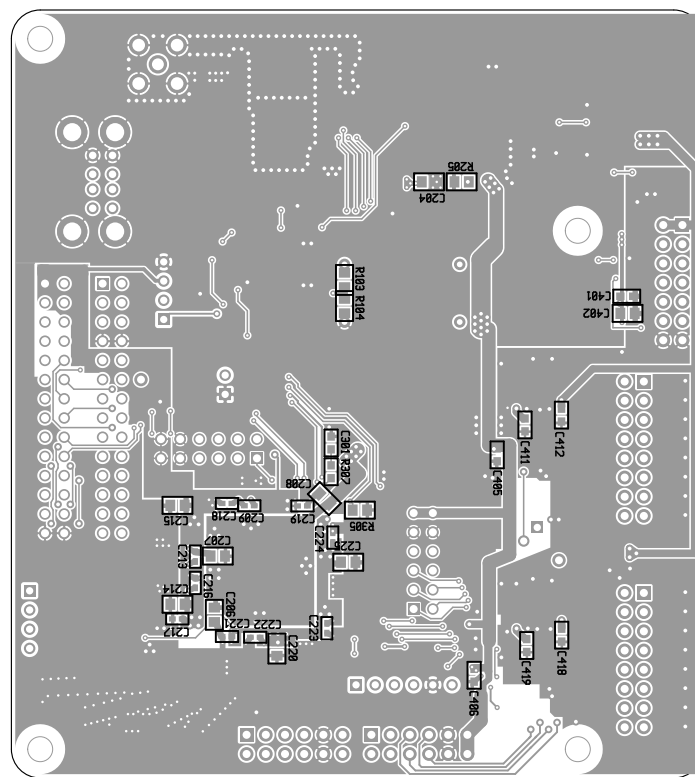

bottomassembly (mirrored), scale = 1:1.000
pandadaq.pcb


There are 14 different drill sizes used in this layout, 709 holes total

Symbol	Diam. (Inch)	Count	Plated?
˘	0.013	150	YES
+	0.014	49	YES
×	0.016	10	YES
•	0.019	31	YES
◻	0.020	274	YES
▽	0.030	4	YES
⊕	0.038	18	YES
⊗	0.039	8	YES
⊙	0.041	2	YES
◻	0.042	150	YES
⊙	0.052	1	YES
⊕	0.066	4	YES
⊗	0.094	4	YES
⊙	0.130	4	NO

Title: (unknown) - Fabrication Drawing

Author: Mark Haun

Date: Tue 10 Apr 2012 05:19:46 AM GMT UTC

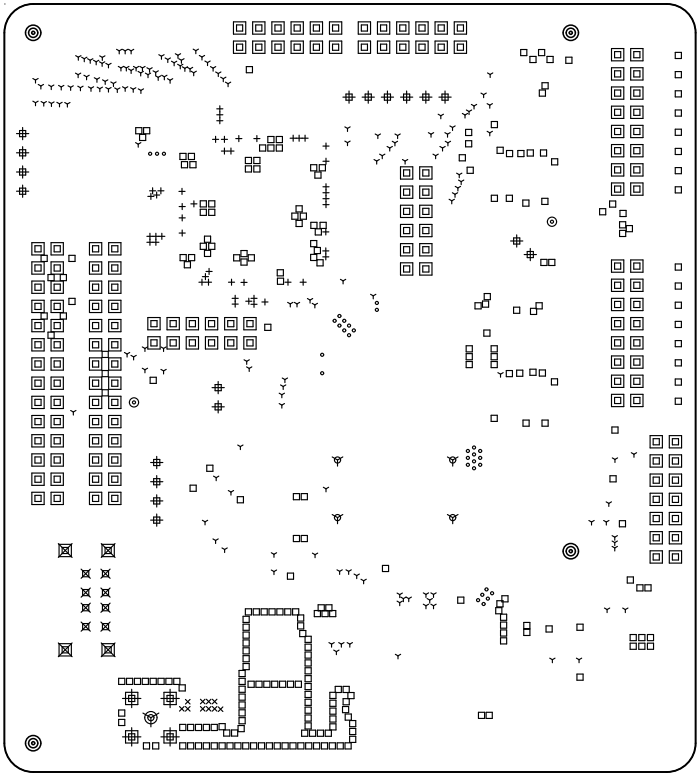

Board outline is the centerline of this path