
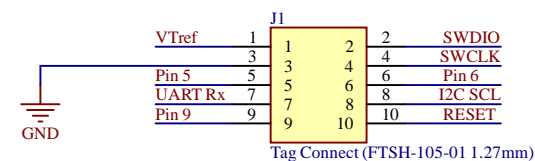


TC2030: DIP 1=ON 2,3,4=OFF
TC2050: DIP 1=OFF 2,3,4=ON

JLink Tx/Rx:
ON = signals connected to VCOM of JLink
OFF = signals only connected to header

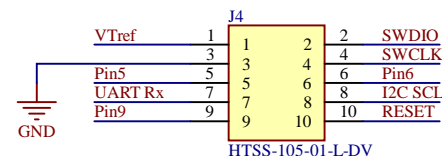


Tag-Connect TC2030 Cable

TC2030	FTSH-105	Signal
1	1	VTref
2	2	SWDIO
3	10	RESET
4	4	SWCLK
5	3,5,9	GND
6	6	Vin
	7,8 (NC)	--

Tag-Connect TC2050 Cable

TC2050	FTSH-105	Signal
1	1	VTref
2	2	SWDIO
3	3	GND
4	4	SWCLK
5	5	Vin
6	6	I2C SDA
7	7	JLink Rx
8	8	I2C SCL
9	9	JLink Tx
10	10	RESET

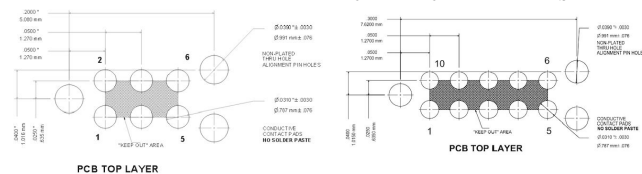

Tx, Rx signals are expressed from the point of view of the J-Link

