

Final Test Status: PASSED

Executed Test: HOT TEST SHORT Engine Serial Number: 86111184

Test Number: 1

Test Configuration

Engine Serial Number 86111184 **Test Specification Number** 95170 MODEL ISB6.7E5300 MOD_TYPE CM2880 TST_PAL **VOLTAGE** 25.00 PROD ID BFR SHUTOFF E ECMCOD FX80023.08

Test Information

Testbed: ZCK_TC01

Operator: Cummins Operator

Test Date: 2022-02-25 Test Start: 12:55:47

Test End:

Teststatus per Phase

Testpoint	Teststatus	Operator	PLC-Error	Meas.Err.	Mat. Review	ECM Error
SETUP	PASSED	0	0	0	0	0
COLD_CRANK	PASSED	0	0	0	0	0
COLD_CRANK_2	PASSED	0	0	0	0	0
ENGINE_START	PASSED	0	0	0	0	0
LOW_IDLE	PASSED	0	0	0	0	0
HIGH_IDLE	PASSED	0	0	0	0	0
RATED_HP	PASSED	0	0	0	0	0
TORQUE_PEAK	PASSED	0	0	0	0	0
LOW_IDLE_2	PASSED	0	0	0	0	0
ENGINE_SHUTDOWN	PASSED	0	0	0	0	0
FINAL_STATUS	PASSED	0	0	0	0	0



Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

Reject Codes

Code	Testpoint	Description	Type	Channel	Unit	Lower Limit	Value	Upper Limit
OVERRID	SETUP	Error on setting the parameter [SEND_OPERATION=r	ECM	-	-	0.00	0.00	0.00
OVERRID	ENGINE_START	Error on setting the parameter [SEND_OPERATION=r	ECM	-	-	0.00	0.00	0.00
OVERRID	ENGINE_START	Error on setting the parameter [T_Dual_Accelerator_E	ECM	-	-	0.00	0.00	0.00



Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

ECM Fault Codes

Testpoint	Number	Description	Masked	Active
LOW_IDLE	W_IDLE 249 OEM AMBIENT AIR TEMPERATURE HIGH ERROR		Α	А
LOW_IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
LOW_IDLE	584	STARTER RELAY CIRCUIT SHORTED LOW	Α	А
LOW_IDLE	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	Α
LOW_IDLE	1678	(Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Temperature Sens	Α	Α
LOW_IDLE	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	Α	Α
LOW_IDLE	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	Α
LOW_IDLE	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
LOW_IDLE	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	Α
LOW IDLE	3558	3558	Α	Α
LOW IDLE	3565	Metering valve circuit voltage above normal (SCR)	Α	Α
LOW IDLE	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	Α
LOW IDLE	3577	Purge valve circuit voltage above normal (SCR)	Α	Α
LOW IDLE	4173	Air pressure sensor circuit voltage below normal (SCR)	Α	Α
LOW IDLE	4174	DEF Temperature sensor circuit voltage above normal (SCR)	Α	Α
LOW IDLE	4177	Air pump valve circuit voltage below normal (SCR)	Α	Α
HIGH IDLE	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	Α
HIGH IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
HIGH IDLE	584	STARTER RELAY CIRCUIT SHORTED LOW	Α	A
HIGH IDLE	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	1	A
HIGH IDLE	1678	,	A	A
HIGH IDLE	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	A	A
HIGH IDLE	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	A	A
HIGH IDLE	2555	GHC LOW VOLTAGE ERROR #1	A	A
HIGH IDLE	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	A	A
HIGH IDLE	3558	3558	A	A
HIGH IDLE	3565	Metering valve circuit voltage above normal (SCR)	A	A
HIGH IDLE	3572	DEF pressure sensor circuit voltage below normal (SCR)	A	A
HIGH IDLE	3577	Purge valve circuit voltage above normal (SCR)	A	A
HIGH IDLE	4173	Air pressure sensor circuit voltage below normal (SCR)	A	A
HIGH IDLE	4174	DEF Temperature sensor circuit voltage above normal (SCR)	A	A
HIGH IDLE	4177	Air pump valve circuit voltage below normal (SCR)	A	A
RATED HP	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	A	A
RATED_III	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	A	A
RATED_III	584	STARTER RELAY CIRCUIT SHORTED LOW	A	A
RATED_HP	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit		A
RATED_III	1678	,	A	A
RATED_HP	1683	1683, Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	A	A
RATED_HP	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	A	A
RATED_HP	2555	GHC LOW VOLTAGE ERROR #1	A	A
RATED_HP	2771			
RATED_HP	3558	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	A	A
RATED_HP	3565	3558 Metaring valve sireuit valtage shave permel (SCD)	Α	A
		Metering valve circuit voltage above normal (SCR)	A	A
RATED_HP	3572	DEF pressure sensor circuit voltage below normal (SCR)	A	A
RATED_HP	3577	Purge valve circuit voltage above normal (SCR)	A	A
RATED_HP	4173	Air pressure sensor circuit voltage below normal (SCR)	A	A
RATED_HP	4174	DEF Temperature sensor circuit voltage above normal (SCR)	A	A
RATED_HP	4177	Air pump valve circuit voltage below normal (SCR)	A	A
TORQUE_PEAK	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	A
TORQUE_PEAK	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
TORQUE_PEAK	584	STARTER RELAY CIRCUIT SHORTED LOW	A	Α



Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

ECM Fault Codes

Testpoint	Number	Description	Masked	Active
TORQUE_PEAK	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	Α
TORQUE_PEAK	1678	,	Α	А
TORQUE_PEAK	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	A	Α
TORQUE_PEAK	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	А
TORQUE_PEAK	2555	GHC LOW VOLTAGE ERROR #1	A	Α
TORQUE_PEAK	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	А
TORQUE_PEAK	3558	3558	A	Α
TORQUE_PEAK	3565	Metering valve circuit voltage above normal (SCR)	Α	А
TORQUE_PEAK	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	A
TORQUE_PEAK	3577	Purge valve circuit voltage above normal (SCR)	Α	А
TORQUE_PEAK	4173	Air pressure sensor circuit voltage below normal (SCR)	Α	A
TORQUE_PEAK	4174	DEF Temperature sensor circuit voltage above normal (SCR)	Α	Α
TORQUE_PEAK	4177	Air pump valve circuit voltage below normal (SCR)	Α	Α
LOW_IDLE_2	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	А
LOW_IDLE_2	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	А
LOW_IDLE_2	584	STARTER RELAY CIRCUIT SHORTED LOW	Α	А
LOW_IDLE_2	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	А
LOW_IDLE_2	1678	,	Α	А
LOW_IDLE_2	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	Α	А
LOW_IDLE_2	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	Α
LOW_IDLE_2	2555	GHC LOW VOLTAGE ERROR #1	Α	A
LOW_IDLE_2	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	А
LOW_IDLE_2	3558	3558	Α	A
LOW_IDLE_2	3565	Metering valve circuit voltage above normal (SCR)	Α	Α
LOW_IDLE_2	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	Α
LOW_IDLE_2	3577	Purge valve circuit voltage above normal (SCR)	Α	Α
LOW_IDLE_2	4173	Air pressure sensor circuit voltage below normal (SCR)	Α	Α
LOW_IDLE_2	4174	DEF Temperature sensor circuit voltage above normal (SCR)	Α	Α
LOW_IDLE_2	4177	Air pump valve circuit voltage below normal (SCR)	Α	Α




Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

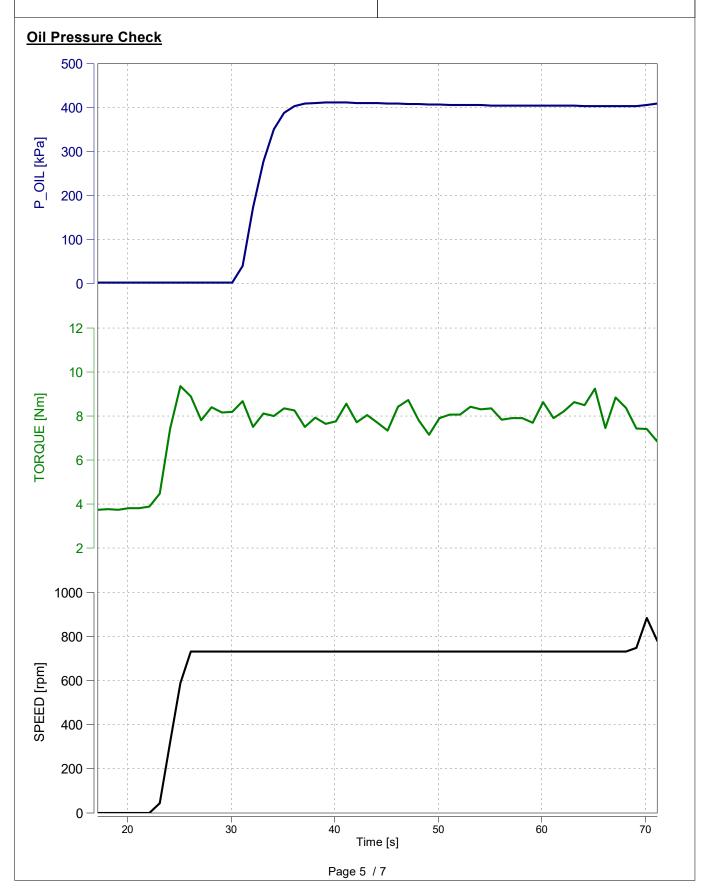




Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

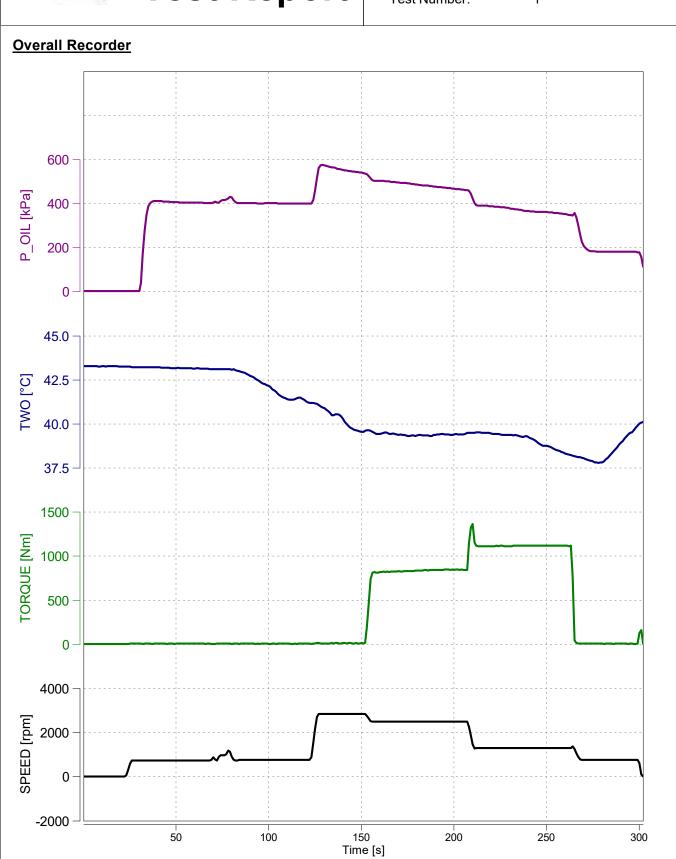

Page 6 / 7



Final Test Status: PASSED

Engine Serial Number: 86111184

Executed Test: HOT TEST SHORT

Test Number: 1

	Unit	Lower Limit	Value	Upper Limit	Status
LOW_IDLE					
SPEED	rpm	698.00	750.10	810.00	PASSED
P_OIL	kPa	75.00	400.65		PASSED
OPA_ANLG	-		4.85		
HIGH_IDLE					
SPEED	rpm	2800.00	2840.86	2900.00	PASSED
P_OIL	kPa		546.02		
RATED_HP					
SPEED	rpm	2498.00	2500.00	2502.00	PASSED
Р	kW	205.00	221.69	235.00	PASSED
FB_RATE	kg/h	43.00	48.19	55.00	PASSED
P_INTAKE	kPa		158.88		
P_OIL	kPa	275.00	469.47		PASSED
BLOW_VAL	kPa	0.10	1.48	3.00	PASSED
OPA_ANLG	-	0.00	4.85	15.00	PASSED
T_FUEL	°C	38.00	38.98	45.00	PASSED
P_FUEL	kPa		*		
T_TUR_IN	-		*		
TORQUE_PEAK					
SPEED	rpm		1299.99		
TORQUE	Nm	1018.00	1118.19	1192.00	PASSED
FB_RATE	kg/h	25.00	34.39	35.00	PASSED
BLOW_VAL	kPa	0.10	1.21	3.00	PASSED
OPA_ANLG	-	0.00	4.85	15.00	PASSED
T_FUEL	°C	38.00	39.15	45.00	PASSED
P_FUEL	kPa		*		
T_TUR_IN	-		*		
LOW_IDLE_2					
SPEED	rpm	600.00	751.88	800.00	PASSED
P_OIL	kPa	100.00	182.28		PASSED
OPA ANLG	-		4.85		