

# **Production Test Report**

#### Final Test Status: PASSED

Executed Test: HOT TEST SHORT Engine Serial Number: 86111369

Test Number: 3

#### **Test Configuration**

**Engine Serial Number** 86111369 **Test Specification Number** 94113 MODEL ISBe300\_e3 MOD\_TYPE CM2150e TST\_PAL **VOLTAGE** 25.00 PROD ID BAH SHUTOFF AX90113.05 E ECMCOD

#### **Test Information**

Testbed: ZCK\_TC01

Operator: Cummins Operator

#### Test Date: 2022-02-24 Test Start: 19:52:36

Test End:

#### Teststatus per Phase

Testpoint	Teststatus	Operator	PLC-Error	Meas.Err.	Mat. Review	ECM Error
SETUP	PASSED	0	0	0	0	0
COLD_CRANK	PASSED	0	0	0	0	0
COLD_CRANK_2	PASSED	0	0	0	0	0
ENGINE_START	PASSED	0	0	0	0	0
LOW_IDLE	PASSED	0	0	0	0	0
HIGH_IDLE	PASSED	0	0	0	0	0
RATED_HP	PASSED	0	0	0	0	0
TORQUE_PEAK	PASSED	0	0	0	0	0
LOW_IDLE_2	PASSED	0	0	0	0	0
ENGINE_SHUTDOWN	PASSED	0	0	0	0	0
FINAL_STATUS	PASSED	0	0	0	0	0



# Production Test Report

## Final Test Status: PASSED

Engine Serial Number: 86111369
Executed Test: HOT TEST SHORT

Test Number: 3

#### Reject Codes

Code	Testpoint	Description	Type	Channel	Unit	Lower Limit	Value	Upper Limit
OVERRID	SETUP	Error on setting the parameter [SEND_OPERATION=r	ECM	-	-	0.00	0.00	0.00



# Production Test Report

## Final Test Status: PASSED

Engine Serial Number: 86111369
Executed Test: HOT TEST SHORT

Test Number: 3

#### **ECM Fault Codes**

Testpoint	Number	Description	Masked	Active
LOW_IDLE	241	VSS CIRCUIT DATA INCORRECT	Α	Α
LOW_IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
LOW_IDLE	2555	GHC LOW VOLTAGE ERROR #1	А	A
HIGH_IDLE	241	VSS CIRCUIT DATA INCORRECT	Α	А
HIGH_IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	A
HIGH_IDLE	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
RATED_HP	241	VSS CIRCUIT DATA INCORRECT	Α	Α
RATED_HP	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
RATED_HP	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
TORQUE_PEAK	241	VSS CIRCUIT DATA INCORRECT	Α	Α
TORQUE_PEAK	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
TORQUE_PEAK	2555	GHC LOW VOLTAGE ERROR #1	Α	A
LOW_IDLE_2	241	VSS CIRCUIT DATA INCORRECT	Α	Α
LOW_IDLE_2	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
LOW_IDLE_2	2555	GHC LOW VOLTAGE ERROR #1	Α	Α




## Production Test Report

#### Final Test Status: PASSED

Engine Serial Number: 86111369
Executed Test: HOT TEST SHORT

Test Number: 3

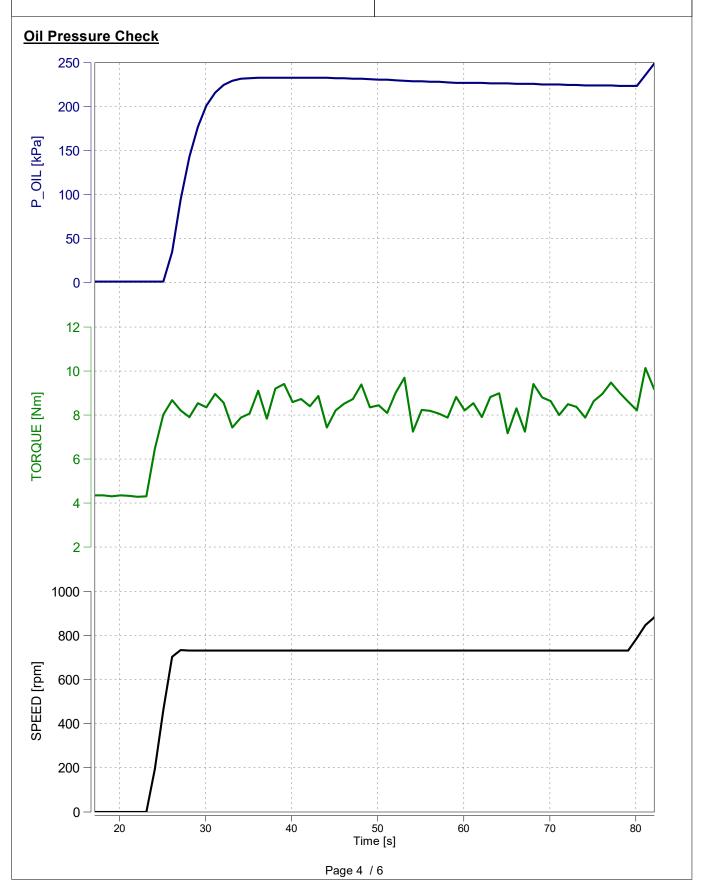




#### Final Test Status: PASSED

Engine Serial Number: 86111369
Executed Test: HOT TEST SHORT

Test Number: 3

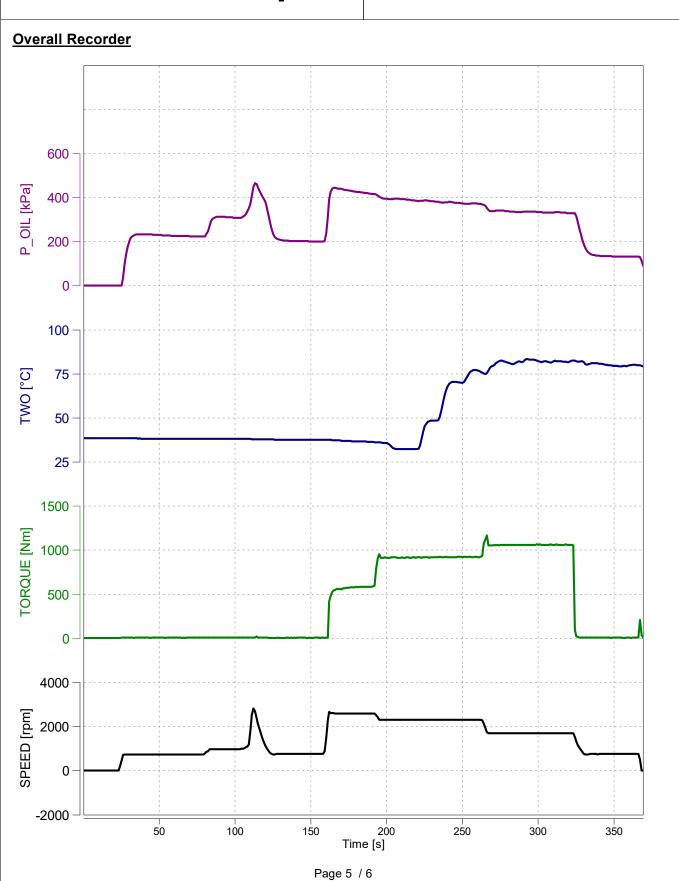



## Final Test Status: PASSED

Engine Serial Number: 86111369
Executed Test: HOT TEST SHORT

Test Number: 3

	Unit	Lower Limit	Value	Upper Limit	Status	
LOW_IDLE						
SPEED	rpm	698.00	749.91	810.00	PASSED	
P_OIL	kPa	75.00	201.38		PASSED	
OPA_ANLG	-		4.86			
HIGH_IDLE						
SPEED	rpm	2550.00	2600.09	2700.00	PASSED	
P_OIL	kPa		420.83			
RATED_HP						
SPEED	rpm	2298.00	2299.96	2302.00	PASSED	
Р	kW	206.00	222.55	238.00	PASSED	
FB_RATE	kg/h	35.00	54.58	66.00	PASSED	
P_INTAKE	kPa		188.68			
P_OIL	kPa	275.00	372.95		PASSED	
BLOW_VAL	kPa	0.10	1.26	3.00	PASSED	
OPA_ANLG	-	0.00	4.86	15.00	PASSED	
T_FUEL	°C	38.00	39.15	45.00	PASSED	
P_FUEL	kPa		*			
T_TUR_IN	-		*			
TORQUE_PEAK						
SPEED	rpm		1700.00			
TORQUE	Nm	995.00	1063.02	1174.00	PASSED	
FB_RATE	kg/h	23.00	39.70	50.00	PASSED	
BLOW_VAL	kPa	0.10	1.17	3.00	PASSED	
OPA_ANLG	-	0.00	4.86	15.00	PASSED	
T_FUEL	°C	38.00	39.15	45.00	PASSED	
P_FUEL	kPa		*			
T_TUR_IN	-		*			
LOW_IDLE_2						
SPEED	rpm	600.00	749.56	800.00	PASSED	
P_OIL	kPa	100.00	132.95		PASSED	
OPA ANLG	_		4.86			