

#### Final Test Status: FAILED

Executed Test: HOT TEST SHORT Engine Serial Number: 86111258

Test Number: 1

#### **Test Configuration**

**Engine Serial Number** 86111258 **Test Specification Number** 95172 MODEL ISB6.7E5250 MOD\_TYPE CM2880 TST PAL 172 **VOLTAGE** 25.00 PROD ID BFR SHUTOFF FX80025.08 E ECMCOD

#### **Test Information**

Testbed: ZCK\_TC01

Operator: Cummins Operator

#### Test Date: 2022-02-25 Test Start: 09:09:18

Test End:

#### Teststatus per Phase

Testpoint	Teststatus	Operator	PLC-Error	Meas.Err.	Mat. Review	ECM Error
SETUP	PASSED	0	0	0	0	0
COLD_CRANK	PASSED	0	0	0	0	0
COLD_CRANK_2	PASSED	0	0	0	0	0
ENGINE_START	PASSED	0	0	0	0	0
LOW_IDLE	PASSED	0	0	0	0	0
HIGH_IDLE	PASSED	0	0	0	0	0
RATED_HP	FAILED	0	0	1	0	0
TORQUE_PEAK	PASSED	0	0	0	0	0
LOW_IDLE_2	PASSED	0	0	0	0	0
ENGINE_SHUTDOWN	PASSED	0	0	0	0	0
FINAL_STATUS	FAILED	0	0	1	0	0



#### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1

#### Reject Codes

Code	Testpoint	Description	Туре	Channel	Unit	Lower Limit	Value	Upper Limit
OVERRID	SETUP	Error on setting the parameter [SEND_OPERATION=r	ECM	-	-	0.00	0.00	0.00
OVERRID	ENGINE_START	Error on setting the parameter [SEND_OPERATION=r	ECM	_	-	0.00	0.00	0.00
OVERRID	ENGINE_START	Error on setting the parameter [T_Dual_Accelerator_E	ECM	-	-	0.00	0.00	0.00
RFRH	RATED_HP	Rated Fuel Rate high	MES	FB_RATE	kg/h	35.00	52.82	45.00



#### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1

#### **ECM Fault Codes**

Testpoint	Number	Description	Masked	Active
LOW_IDLE	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	Α
LOW_IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
LOW_IDLE	584	STARTER RELAY CIRCUIT SHORTED LOW	Α	А
LOW_IDLE	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	А
LOW_IDLE	1678	(Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Temperature Sens	Α	Α
LOW_IDLE	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	Α	Α
LOW_IDLE	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	Α
LOW_IDLE	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
LOW_IDLE	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	Α
LOW IDLE	3558	3558	Α	Α
LOW IDLE	3565	Metering valve circuit voltage above normal (SCR)	A	Α
LOW IDLE	3572	DEF pressure sensor circuit voltage below normal (SCR)	A	Α
LOW IDLE	3577	Purge valve circuit voltage above normal (SCR)	A	Α
LOW IDLE	4173	Air pressure sensor circuit voltage below normal (SCR)	A	Α
LOW IDLE	4174	DEF Temperature sensor circuit voltage above normal (SCR)	A	Α
LOW IDLE	4177	Air pump valve circuit voltage below normal (SCR)	A	A
HIGH IDLE	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	A	A
HIGH IDLE	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	A	A
HIGH IDLE	584	STARTER RELAY CIRCUIT SHORTED LOW	A	A
HIGH IDLE	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	F -	A
HIGH IDLE	1678	,	A	A
HIGH IDLE	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	A	A
HIGH IDLE	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	A	A
	2555	GHC LOW VOLTAGE ERROR #1	A	A
HIGH_IDLE	2555		A	
HIGH_IDLE		Aftertreatment Outlet NOx Sensor - Abnormal Update Rate		A
HIGH_IDLE	3558	3558	A	A
HIGH_IDLE	3565	Metering valve circuit voltage above normal (SCR)	A	A
HIGH_IDLE	3572	DEF pressure sensor circuit voltage below normal (SCR)	A	A
HIGH_IDLE	3577	Purge valve circuit voltage above normal (SCR)	A	A
HIGH_IDLE	4173	Air pressure sensor circuit voltage below normal (SCR)	A	A
HIGH_IDLE	4174	DEF Temperature sensor circuit voltage above normal (SCR)	A	A
HIGH_IDLE	4177	Air pump valve circuit voltage below normal (SCR)	A	A
RATED_HP	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	Α
RATED_HP	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	Α
RATED_HP	584		A	Α
RATED_HP	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit		Α
RATED_HP	1678	,	Α	Α
RATED_HP	1683	,	Α	Α
RATED_HP	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	Α
RATED_HP	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
RATED_HP	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	Α
RATED_HP	3558	3558	Α	A
RATED_HP	3565	Metering valve circuit voltage above normal (SCR)	Α	Α
RATED_HP	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	Α
RATED_HP	3577	Purge valve circuit voltage above normal (SCR)	A	Α
RATED_HP	4173	Air pressure sensor circuit voltage below normal (SCR)	A	Α
RATED_HP	4174	, ,	A	Α
RATED HP	4177	, , ,	A	Α
TORQUE PEAK	249	, ,	A	Α
TORQUE PEAK	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	A	Α
				1



#### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1

#### **ECM Fault Codes**


Testpoint	Number	Description	Masked	Active
TORQUE_PEAK	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	Α
TORQUE_PEAK	1678	(Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Temperature Sens	Α	Α
TORQUE_PEAK	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	Α	Α
TORQUE_PEAK	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	Α
TORQUE_PEAK	2555	GHC LOW VOLTAGE ERROR #1	Α	Α
TORQUE_PEAK	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	Α
TORQUE_PEAK	3558	3558	Α	Α
TORQUE_PEAK	3565	Metering valve circuit voltage above normal (SCR)	Α	Α
TORQUE_PEAK	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	Α
TORQUE_PEAK	3577	Purge valve circuit voltage above normal (SCR)	Α	Α
TORQUE_PEAK	4173	Air pressure sensor circuit voltage below normal (SCR)	Α	Α
TORQUE_PEAK	4174	DEF Temperature sensor circuit voltage above normal (SCR)	Α	А
TORQUE_PEAK	4177	Air pump valve circuit voltage below normal (SCR)	Α	Α
LOW_IDLE_2	249	OEM AMBIENT AIR TEMPERATURE HIGH ERROR	Α	А
LOW_IDLE_2	428	WATER IN FUEL SENSOR CIRCUIT SHORTED HIGH ERROR	Α	А
LOW_IDLE_2	584	STARTER RELAY CIRCUIT SHORTED LOW	Α	Α
LOW_IDLE_2	1669	Air-assisted) - Aftertreatment Diesel Exhaust Fluid Tank Level Sensor Circuit	Α	А
LOW_IDLE_2	1678	,	Α	А
LOW_IDLE_2	1683	1683,Aftertreatment Diesel Exhaust Fluid Tank Heater - Voltage Above Nor	Α	А
LOW_IDLE_2	2182	ENG BRK DRIVE #1 LOW CONTROL ERROR	Α	А
LOW_IDLE_2	2555	GHC LOW VOLTAGE ERROR #1	Α	А
LOW_IDLE_2	2771	Aftertreatment Outlet NOx Sensor - Abnormal Update Rate	Α	А
LOW_IDLE_2	3558	3558	Α	А
LOW_IDLE_2	3565	Metering valve circuit voltage above normal (SCR)	Α	A
LOW_IDLE_2	3572	DEF pressure sensor circuit voltage below normal (SCR)	Α	А
LOW_IDLE_2	3577	Purge valve circuit voltage above normal (SCR)	Α	А
LOW_IDLE_2	4173	Air pressure sensor circuit voltage below normal (SCR)	Α	Α
LOW_IDLE_2	4174	DEF Temperature sensor circuit voltage above normal (SCR)	Α	А
LOW_IDLE_2	4177	Air pump valve circuit voltage below normal (SCR)	Α	Α



#### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1

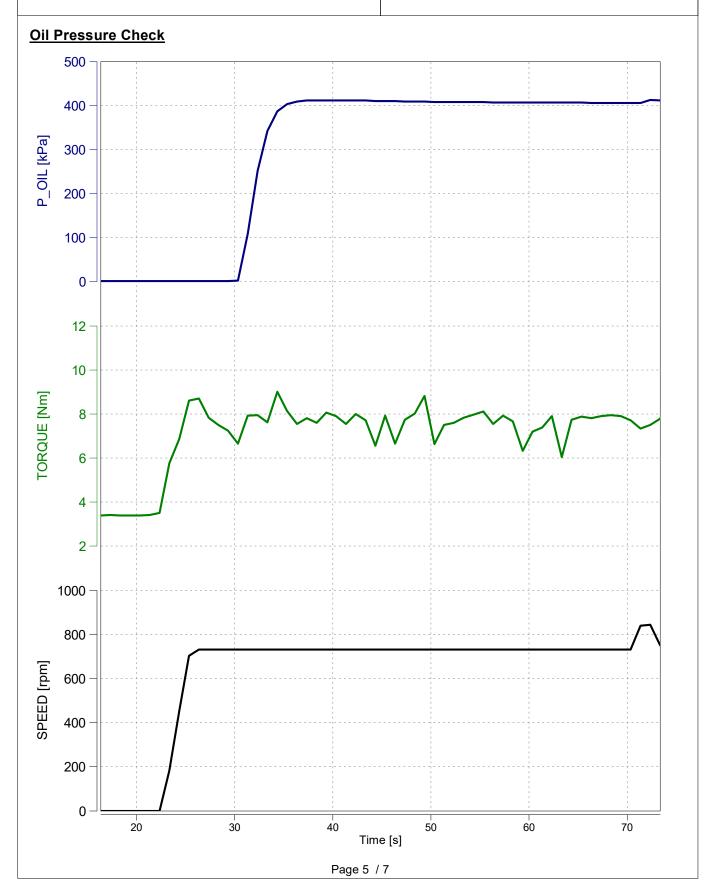




### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1



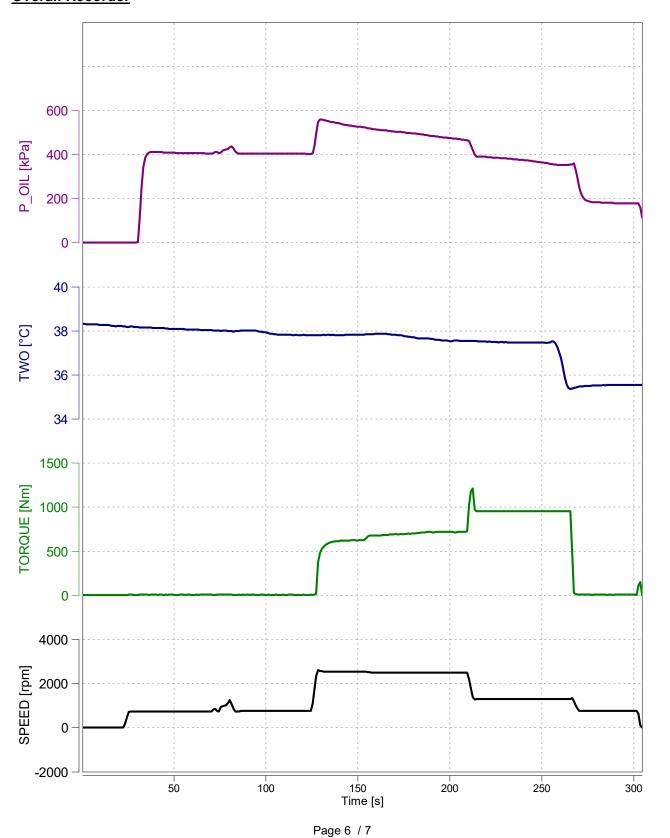



#### Final Test Status: FAILED

Engine Serial Number: 86111258
Executed Test: HOT TEST SHORT

Test Number: 1

	Unit	Lower Limit	Value	Upper Limit	Status
LOW_IDLE					
SPEED	rpm	698.00	749.97	810.00	PASSED
P_OIL	kPa	75.00	404.05		PASSED
OPA_ANLG	-		4.87		
HIGH_IDLE					
SPEED	rpm	2500.00	2550.05	2600.00	PASSED
P_OIL	kPa		530.46		
RATED_HP					
SPEED	rpm	2498.00	2499.94	2502.00	PASSED
Р	kW	167.00	188.56	200.00	PASSED
FB_RATE	kg/h	35.00	52.82	45.00	FAILED
P_INTAKE	kPa		151.72		
P_OIL	kPa	275.00	474.87	_	PASSED
BLOW_VAL	kPa	0.10	1.33	3.00	PASSED
OPA_ANLG	-	0.00	4.87	15.00	PASSED
T_FUEL	°C	38.00	38.79	45.00	PASSED
P_FUEL	kPa		*		
T_TUR_IN	-		*		
TORQUE_PEAK					
SPEED	rpm		1300.01		
TORQUE	Nm	850.00	956.83	998.00	PASSED
FB_RATE	kg/h	22.00	25.27	32.00	PASSED
BLOW_VAL	kPa	0.10	0.92	3.00	PASSED
OPA_ANLG	-	0.00	4.87	15.00	PASSED
T_FUEL	°C	38.00	38.94	45.00	PASSED
P_FUEL	kPa		*		
T_TUR_IN	-		*		
LOW_IDLE_2					
SPEED	rpm	600.00	749.97	800.00	PASSED
P_OIL	kPa	100.00	180.37		PASSED
OPA ANLG	-		4.87		