



Vehicle Inspection Report

ASTON BARCLAY
Chelmsford

LC18VZV - LAND ROVER RANGE **NAMA** 3

VIN:	SALWA2AN5JA808698		**Engine No:**	180522W0089204DTA	
Transmission:	Automatic	**Odometer:**	40182	**Reg Date:**	12/06/2018
Fuel Type:	Diesel	**Engine CC:**	1999	**Colour:**	BLACK
Body:	Estate	**Seats:**	5	**Spare Keys:**	1

Key Specification

Alloys	Parking sensors	Heated windscreen	Heated seats
Leather or substitute	AUX/USB	Radio/CD	Cruise control
Climate control	Air con	Sat nav	

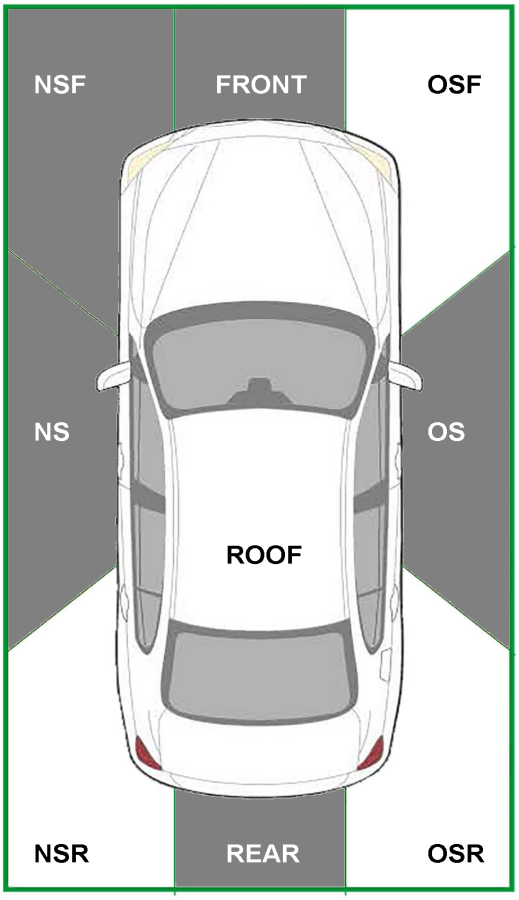
Tyre Tread Depths

OSF	5.0	**OSR**	6.0	**NSF**	4.0	**NSR**	5.0
Spare		**Type**	Space Saver			**Run Flats**	0

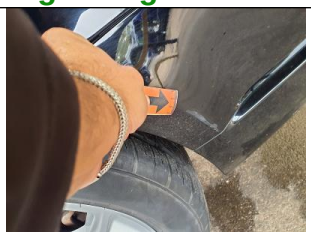
Damage Details

	Bonnet	Scratched Over 25mm Not Thru Paint	Machine Polish
1	**Bumper Rear**	Scratched 25 to 100mm Thru Paint	Smart Repair
2	**Door osr**	Scratched UpTo 25mm Thru Paint	Smart Repair
	Wing nsf	Previous Repair	Report Only
3	**Bumper Rear Moulding**	Scratched (Painted) UpTo 25mm Thru Paint	Smart Repair
4	**Bumper Front Moulding**	Scratched (Painted) Over 25mm Thru Paint	Smart Repair
5	**Door nsf**	Dented Over 30mm	Repair and Refinish
6	**Bumper Front**	Scratched Over 100mm Thru Paint	Refinish
7	**Door nsr**	Scratched Over 25mm Not Thru Paint	Machine Polish

Sectional Damage Summary



Damage Images

1

Bumper Rear

2

Door osr

3

Bumper Rear Moulding

4

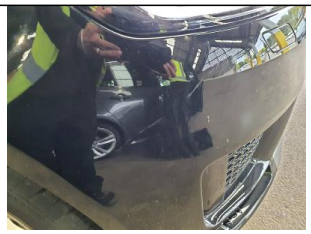
Bumper Front Moulding

5

Door nsf

6

Bumper Front

6

Bumper Front

7

Door nsr

Beauty Images


OSF

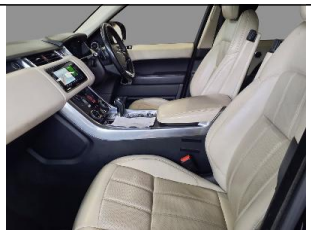

NSF


OSR

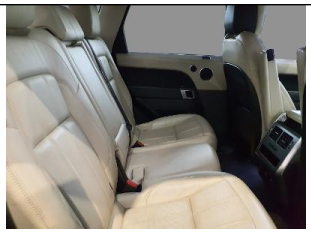

NSR


Dashboard


Additional


Interior


Load Area


OSR Interior

Inspection Notes :			
Conditions:	Indoor	**Location:**	Aston Barclay Chelmsford
Inspector's Name:	CF	**Date:**	15/10/2025