

# Durchlasstest

Hersteller

Produktname

Probenname


Datum

VIP Mask

S015\_2

2020-05-22 14:23:22.220000

|                            |                         |
|----------------------------|-------------------------|
| Anzahl Regenerationszyklen | 1.0                     |
| Differenzdruck Maske       | 0.39 mbar               |
| Volumenstrom               | 95.2 L/min              |
| Nozzle Pressure            | 200.0 mbar              |
| NaCl Konzentration         | 3.0 w%                  |
| Setup                      | Maskenteststand v1.0    |
| Charge                     | -                       |
| Durchlass                  | 76.69                   |
| Aerosolkonzentration       | 22.53 mg/m <sup>3</sup> |
| Messzeit                   | 180 sec                 |

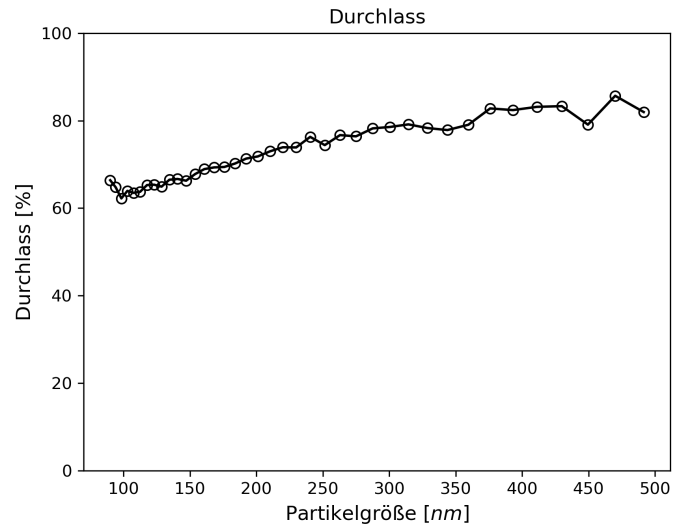

## Optische Mängel:

Holes around the mask edges are not completely closed, but it probably does not affect the measurement

## Anmerkungen: