


AWS checklist and maintenance guide

Station name	Scoil	
People present	MCT, NOLA	instructed by:
Purpose	standard maintenance / installation / take-down / quick visit / emergency	
Date	9.8.2014	
Transport	helicopter / fixed wing / snow mobile / dog sleds / on foot from:	
Weather	warm / cold / very cold / no wind / some wind / rain / cloud cover %: 0	

Notes:

Metadata before maintenance (if establishing a new AWS: skip this page)

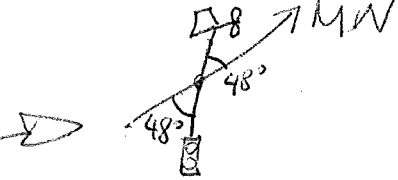

Time difference between logger clock and UTC	STATION LEADS 20 SEC +/-	
Adjust logger time to UTC (be sure PC runs on UTC time)		Y/N
Download data to PC and/or change CF Card (wait for green light)	both	Y/N
Name of logger program	PROMICE 2010 BINARY 7	
Photo or <u>Screen dump</u> of values in fast scan mode		Y/N
Latitude (dd mm.mmm)		
Longitude (dd mm.mmm)		
Photos of tripod, sensors, logger box wiring etc. (more is better)		Y/N
Mast tilt in boom direction (+ if radiometer tilting down)	- 06.7	°
Mast tilt across boom looking from radiometer (- if clockwise)	+ 5.0	°
Boom direction relative to north	SEE SKETCH	° true/magn
Box on wind sensor exactly towards mast? If not, measure direction.		Y/N
Radiometer aligned with mast and inclinometer? If not, measure.		Y/N
Temperature / humidity height (bottom of casing – surface)	265	cm
Sonic ranger on AWS height (membrane – surface)	282	cm
Wind sensor height (center of propeller – surface)	330	cm
Sonic ranger on stakes height (membrane – surface)	fallen	cm
Free length of stake – outer, holding boom with sonic ranger	706	cm
Free length of stake – middle	721	cm
Free length of stake – outer, holding boom without sonic ranger	706	cm
Free length of ablation hose on/above the ice surface	738	cm
Alt: depth of ablation hose using markings on hose	untested out	cm
Height of ablation hose fluid level above the ice surface	/	cm
Vertical difference in surface height (at station – at hose) (approx)	/	cm
Length of thermistor string on surface from surface marking	untested out	cm
Height of surface irregularities	60	cm
Stake assembly still standing?	Y/N/ more or less	
Apparent damage to sensors? If yes, which?		Y/N

Notes:

stake assembly collapsed
pressure hose pinched under tripod wire and sothing box,
bleeder hanging from pipel +

Part	Old part number	New part number, if replaced	Potential maintenance tasks
Radiometer	110723	=	- Aligned with mast: Y/N - Clean: Y/N
Inclinometer	01968	=	- Aligned with radiometer within 0.5°: Y/N
Satellite antenna	GEUS Ø7	=	
Wind sensor		=	- Box on sensor exactly towards mast (south): Y/N
Temperature / humidity assembly	5/2012	=	
T/hum assembly casing	6081398	=	- Fan spins and sounds OK: Y/N
T/hum assembly bracket	WHAT IS THIS? =		find out what this is
Temperature probe in T/hum assembly	60946545	=	
HygroClip in T/hum assembly	60835530	=	- 40 °C offset in HygroClip temperature: Y/N
Sonic ranger on AWS	2080	1547	- Old sensor with new membrane: Y/N - Clicking 5 times as it should: Y/N
Solar panel	C10702026139351	=	- Output OK: Y/N - Clean: Y/N DUSTY, DUSTED
GPS antenna	27970397	=	- Stuck to top of logger enclosure: Y/N
Data logger	E1946	=	- New internal battery in old logger: Y/N - New operating system: Y/N
Card reader	3703	=	- LED green of flashing orange (active): Y/N
Multiplexer	E4070	=	- Clicking as it should: Y/N
Iridium modem IMEI number	300034012934080		- Transmissions tested: Y/N - Problems: Y/N
Barometer	3472055	=	
Sonic ranger on stakes	1546	=	- Old sensor with new membrane: Y/N - Clicking 5 times as it should: Y/N - In danger of being buried next winter: Y/N
Thermistor string	UNREADABLE	B23	- Old string left in ice: Y/N/cut
Ablation hose assembly	UNREADABLE	5032 ABS	- Old hose left in ice: Y/N/cut - Air in hose: Y/N removed - Bladder 50% full: Y/N / after emptying/filling
Logger enclosure	- Replaced (including everything inside): Y/N - New vent filter in logger enclosure: Y/N - Moisture inside: Y/N - New desiccant bags (2): Y/N		
Battery box	- New box with new batteries: Y/N - Old box with new batteries: Y/N - Moisture inside: Y/N - New desiccant bags (2): Y/N) UNOPENED		
Stakes	- New ones drilled in: Y/N - Length: 6 / 8 / 10 m - Caps in bottom end to reduce melt-in: Y/N		
Tripod	- New parts: Y/N - Boom direction: true north-south: Y/N		

Sea - C

Metadata after maintenance / establishment

measured on following morning, 12:00 GMT

Time logger clock set (to UTC)?	Y/N
Name of logger program	PROMICE 2014D
Photo or screen dump of values in fast scan mode	Y/N
Latitude (dd mm.mmm)	
Longitude (dd mm.mmm)	
Photos of tripod, sensors, logger box wiring etc. (more is better)	Y/N
Mast tilt in boom direction (+ if radiometer tilting down)	- 89.2 °
Mast tilt across boom looking from radiometer (- if clockwise)	- 88.2 °
Boom direction relative to north (radiometer should point to true south)	° true/magn
Box on wind sensor exactly towards mast? If not, change.	Y/N
Radiometer aligned with mast and inclinometer? If not, align.	Y/N
Temperature / humidity height (bottom of casing - surface)	274 cm
Sonic ranger on AWS height (membrane - surface)	283 cm
Wind sensor height (center of propeller - surface)	327 cm
Sonic ranger on stakes height (membrane - surface)	79 cm
Free length of stake - outer, holding boom with sonic ranger	143 cm
Free length of stake - middle	138 cm
Free length of stake - outer, holding boom without sonic ranger	123 cm
Free length of ablation hose on/above the ice surface	11.51m
Alt: depth of ablation hose using markings on hose	MARKINGS MISSING cm
Height of ablation hose fluid level above the ice surface	153 cm
Vertical difference in surface height (at station - at hose) (approx)	50 cm
Length of thermistor string on surface from surface marking	72 ABOVE SURF.
Height of surface irregularities	60 cm

Notes:

- Logger box rewired for PROMICE 2014D by moving blue wire from PUG8 from C7 to C3.
- Battery box is old type, with hole in the battery box.

