

Station name	SDL
Date	20. MAY 2025

Metadata maintenance

	Arrival	Departure
Time difference between logger clock and UTC ($\pm$ mm:ss)	-00:21	00:00
Download data to PC and/or change SD card (wait for green light)	☒ Y / ☐ N	☐ Y / ☒ N
Name of logger program	GCNET_v2.6	-11-
Screen dump of values in fast scan mode	☒ Y / ☐ N	☐ Y / ☒ N
Photos of mast, sensors, logger box wiring etc. (more is better)	☒ Y / ☐ N	☒ Y / ☐ N
Upper boom direction with radiometer relative to north	0° true/magn.	0° true/magn.
Lower boom perpendicular to upper boom. If not, measure.	☒ Y / ☐ N	☒ Y / ☐ N
Box on upper wind sensor exactly same direction as radiometer? If not, measure.	☒ Y / ☐ N	☒ Y / ☐ N
Box on lower wind sensor exactly same direction as radiometer? If not, measure.	☒ Y / ☐ N	☒ Y / ☐ N
Upper temperature / humidity height (bottom of casing – surface)	365 cm	475 cm
Lower temperature / humidity height (bottom of casing – surface)	235 cm	400 cm
Upper sonic ranger height (bottom of casing – surface)	325 cm	510 cm
Lower sonic ranger height (bottom of casing – surface)	198 cm	351 cm
Length of thermistor string on surface from surface marking	9 (top of pole) cm	208 cm
Apparent damage to sensors? If yes, which?	☒ Y / ☐ N	☐ Y / ☒ N

Notes:

Snowboard snow depth arrival: 148cm Departure: snowboard-mast length
mast length above snow: 23cm above snow: 169cm


lower SR50: 351cm
upper SR50: 510cm
lower loft

Must-do at next visit:

Bring battery extension
cable.

Distance to GNSS: 9.5cm

mast hgt: 4° away from radiometer
0° perpendicular.

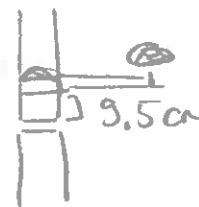

• Battery is at surface, covered with snow

Maintenance sheet version 10 for accumulation area (single mast, two levels)

Station name	SDL
People present	
Purpose	Maintenance / installation / take-down / quick visit / emergency
Date	20 MAY 2-25 ADU, FALC, HETJA

Notes:

AWS to do list		Check after maintenance			
Part	Shipped? (Y/N)	Replaced? (Y/N)	Number shipped/arrival	Number departure	
Radiometer	N	N	21325C	21325C	Clean ☒ Y ☐ N
Iridium modem IMEI number	N	N	3005340638156	3005340638156	← 300534063815680
Inclinometer/compass	N	N	Attached to the radiometer ☒ Y ☐ N		
Satellite antenna	N	N			
Wind sensor upper	N	N	Black box pointing toward the radiometer (i.e., along the boom)? ☒ Y ☐ N		
Wind sensor lower	N	N	Black box pointing same direction as the radiometer ☒ Y ☐ N		
Temperature / humidity assembly upper	Y (Lufft)	Y	Fan spins? ☒ Y ☐ N Sounds, OK? ☒ Y ☐ N		
Temperature / humidity assembly lower	Y (Lufft)	Y	Fan spins? ☒ Y ☐ N Sounds, OK? ☒ Y ☐ N		
Sonic ranger upper	Y	Y	Old sensor with new membrane? ☒ Y ☐ N not sure, brought new sensor		
Sonic ranger lower	Y	Y	Old sensor with new membrane? ☒ Y ☐ N not sure, brought new sensors in pelican		
Thermistor string	PVC tube Ext. cable	Y	Tube length cut of snow arrival: departure:		
Solar panel	N	N	Clean? ☒ Y ☐ N NB: is not effective when partially covered		
GPS antenna	N	N	At top of logger enclosure? ☒ Y ☐ N		
Logger box ID	N	N	CR1000 or CR1000X? ID number: H3-0066		
Logger enclosure	N	N	Replaced (including everything inside)? ☒ Y ☐ N New desiccant bags? ☒ Y ☐ N		
Battery box	N	N	New box? ☒ Y ☐ N New desiccant bags? ☒ Y ☐ N dug up, by pilots		
Mast extension inserted?	☒ Y	Y	How many inserted? How long? 1 x 150 cm Notes:		
Mast	☒ Y	N	New mast? ☒ Y ☐ N New sensor boom? ☒ Y ☐ N		

GUSS distance from bottom of mast
to mast connection: 9.5cm