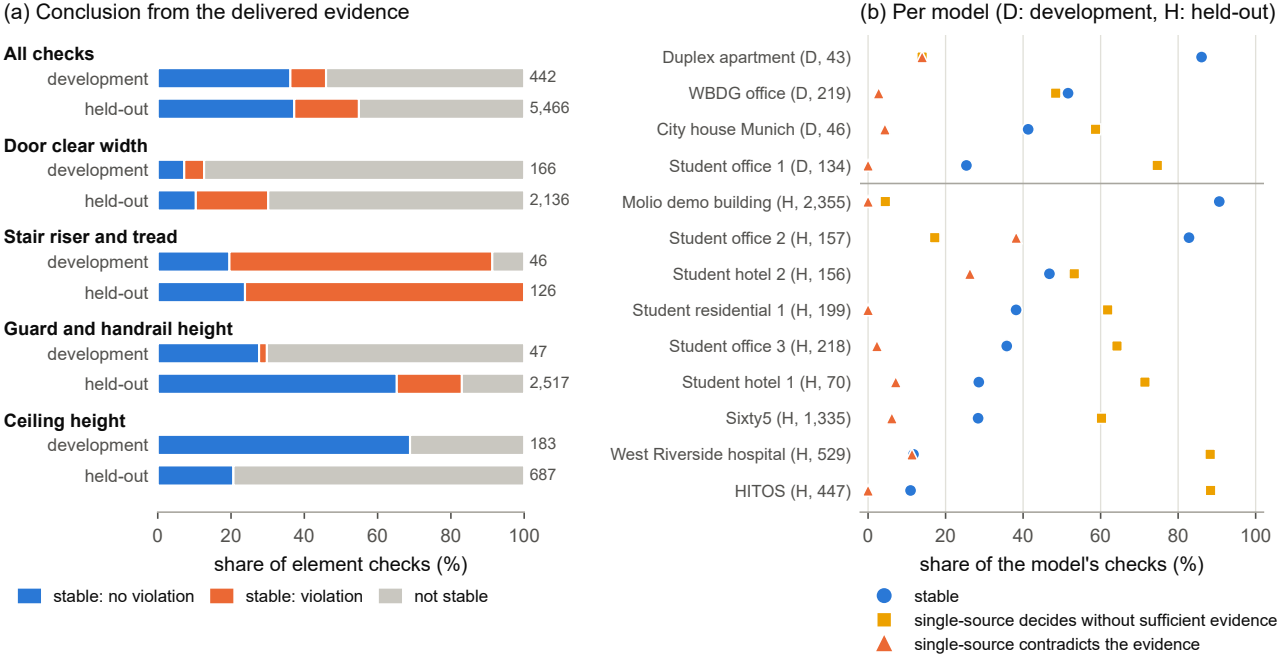

(a) Conclusion from the delivered evidence
All checks
development
held-out
442
5,466
Door clear width
development
held-out
166
2,136
Stair riser and tread
development
held-out
46
126
Guard and handrail height
development
held-out
47
2,517
Ceiling height
development
held-out
183
687
0
20
40
60
80
100
share of element checks (%)
stable: no violation
stable: violation
not stable
(b) Per model (D: development, H: held-out)
Duplex apartment (D, 43)
WBDG office (D, 219)
City house Munich (D, 46)
Student office 1 (D, 134)
Molio demo building (H, 2,355)
Student office 2 (H, 157)
Student hotel 2 (H, 156)
Student residential 1 (H, 199)
Student office 3 (H, 218)
Student hotel 1 (H, 70)
Sixty5 (H, 1,335)
West Riverside hospital (H, 529)
HITOS (H, 447)
0
20
40
60
80
100
share of the model's checks (%)
stable
single-source decides without sufficient evidence
single-source contradicts the evidence