



One recorded sequence | 5/6 times attempted | 7 native outputs | 5 plans

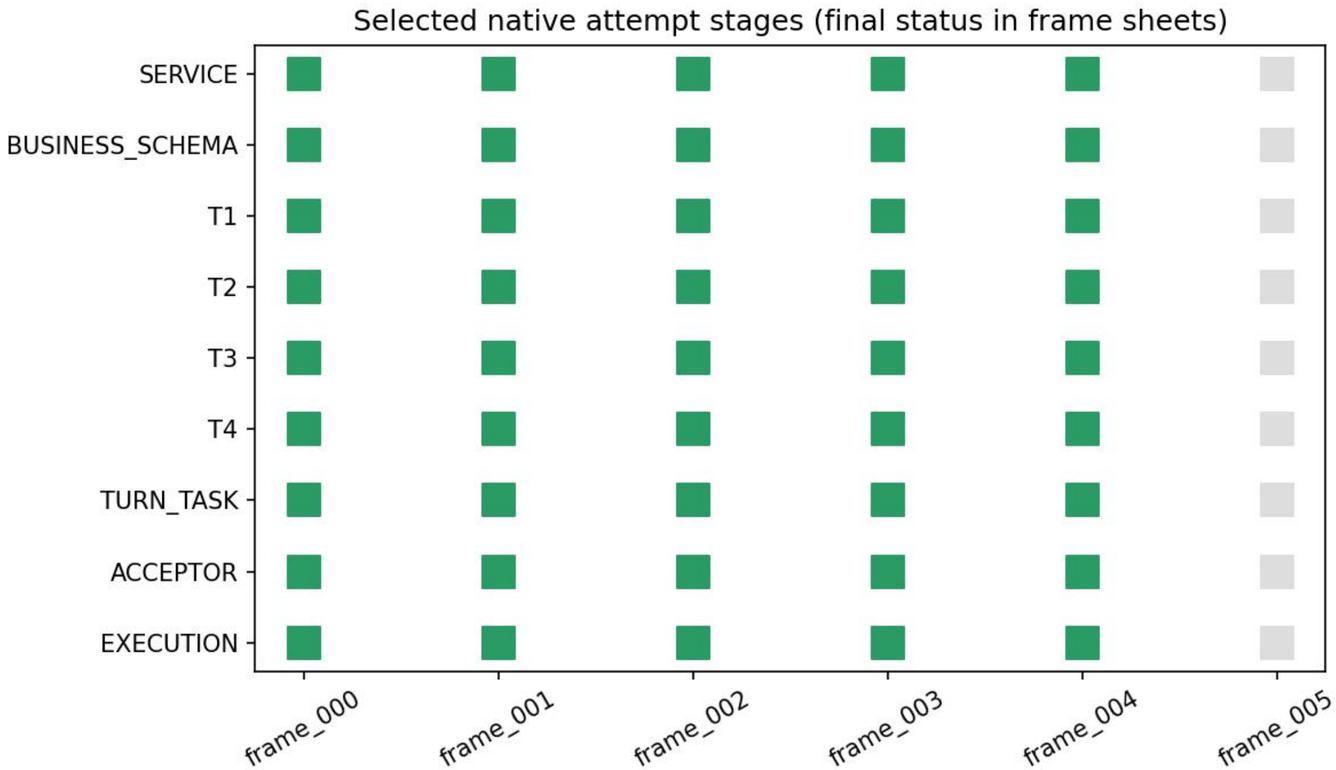

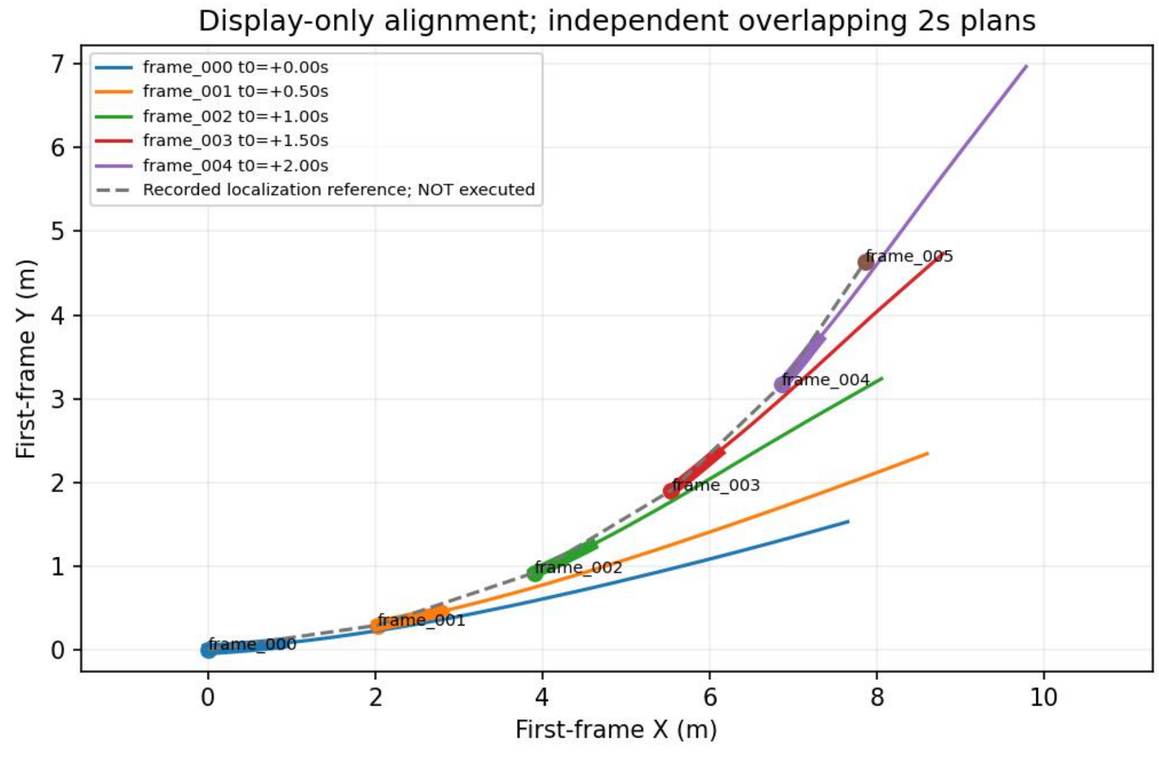

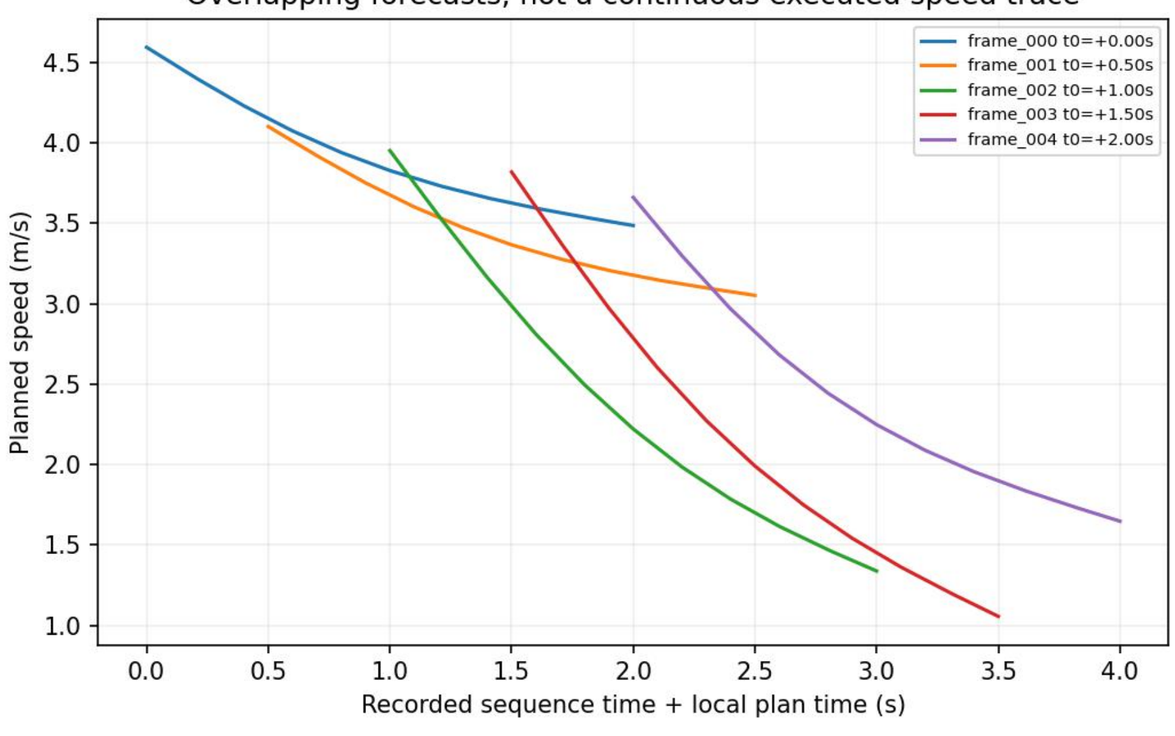

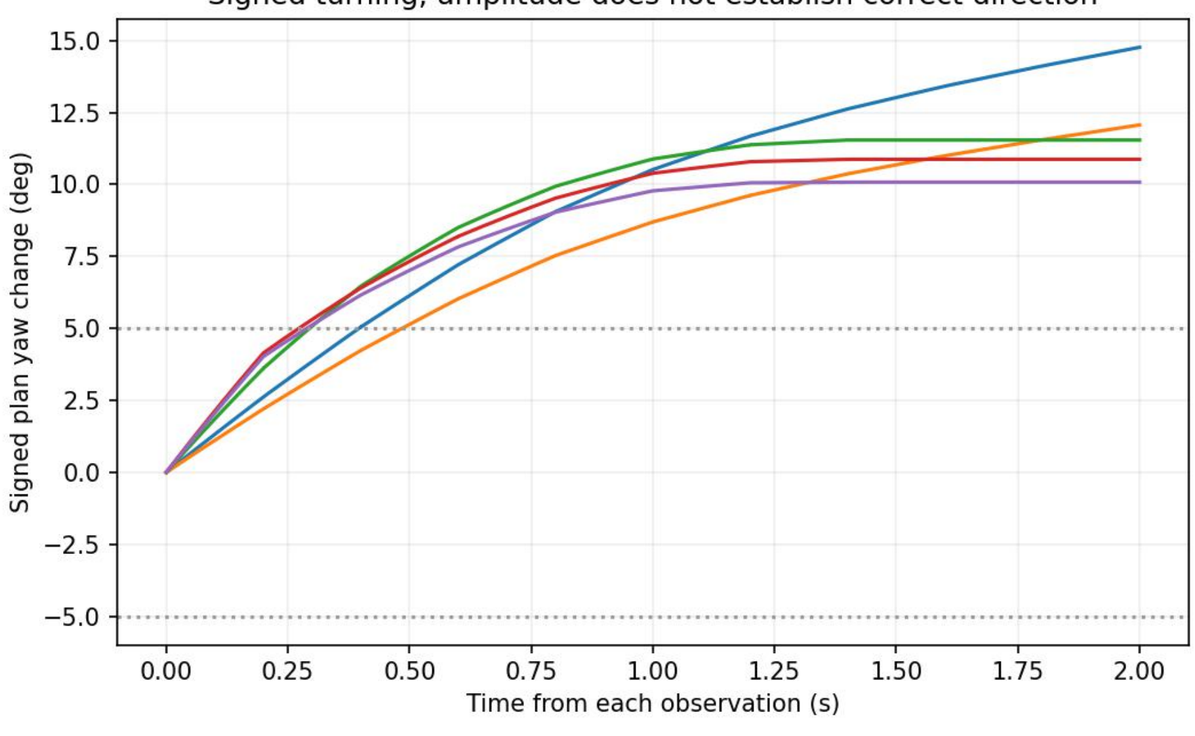


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_000 | +0.00s | REVISION_PASS; post failures=0/preflight failures=0


Original recorded image / display-only model projection



Saved native model geometry / independent local plan

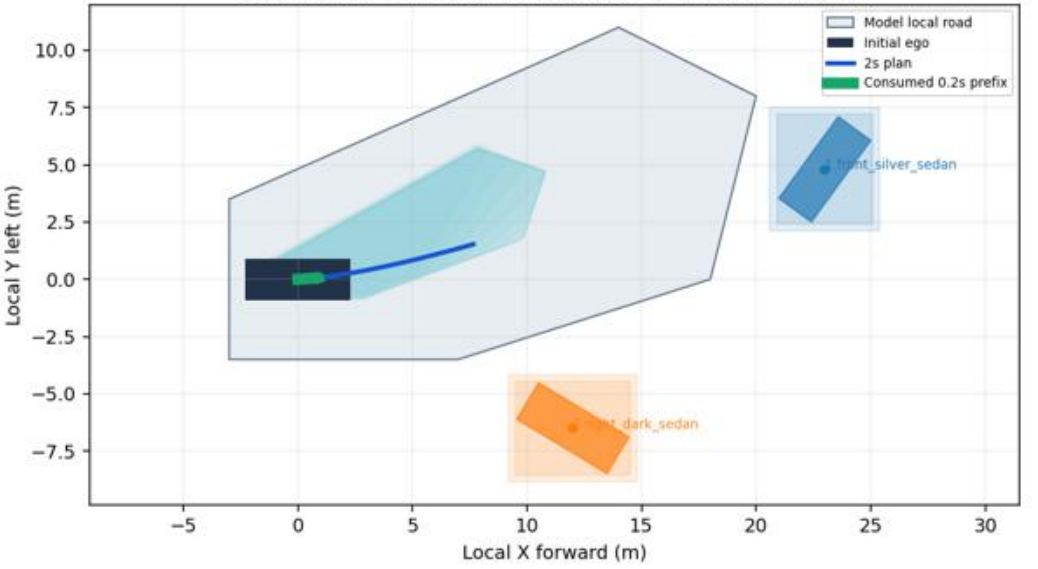

This window only; tails not executed

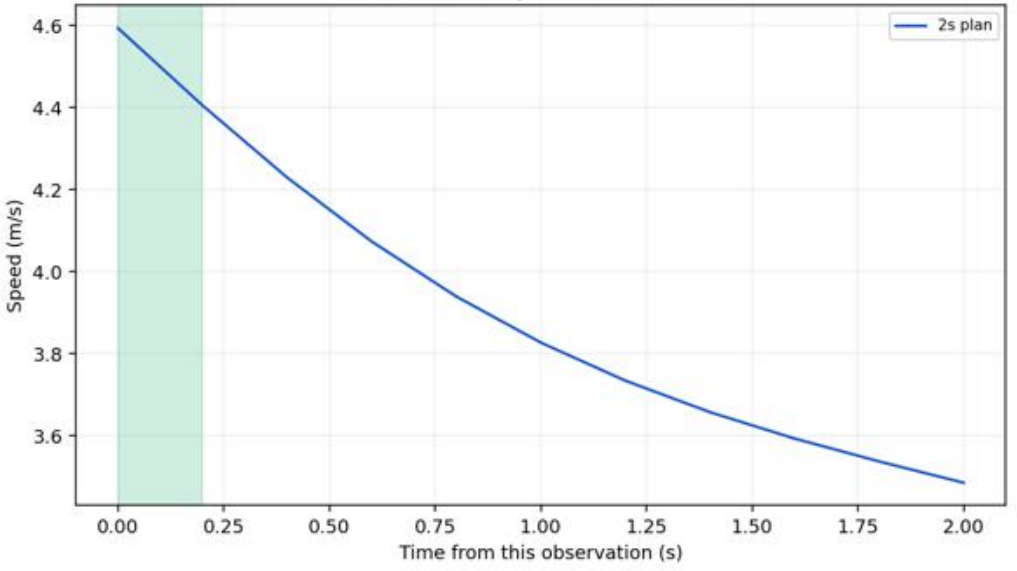

frame_000 t0=+0.000s
Status: REVISION_PASS; post failures=0/preflight failures=0 / block: NONE
Real requests: 2 | source: online_model; group=openai_bend_sequence_20261029_v1
Attempt: 2 | actual server snapshot: UNKNOWN
Decision: hold_lane | desired v: 3.5
Stages: SERVICE=PASS | BUSINESS_SCHEMA=PASS | T1=PASS | T2=PASS | T3=PASS | T4=PASS | TURN_TASK=PASS | ACCEPTOR=PASS | EXECUTION=PASS
Objects declared: 2
T4 stage: PASS | selected-plan T4: PASS
Prefix consumed: True | clearance lower bound: 3.64753082212341 m
Prefix: MOVING_PREFIX | distance=0.9016233739503273 m
Prefix end speed: 4.405873675119605 m/s
Signed plan yaw: 14.762152707347616 deg | lateral=1.5274734990715337 m
Signed prefix yaw: 2.623651545751652 deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_001 | +0.50s | RECOVERY_GROUP_PASS_AFTER_PRIOR_ATTEMPT; post failures=2/preflight failures=0


Original recorded image / display-only model projection



Saved native model geometry / independent local plan

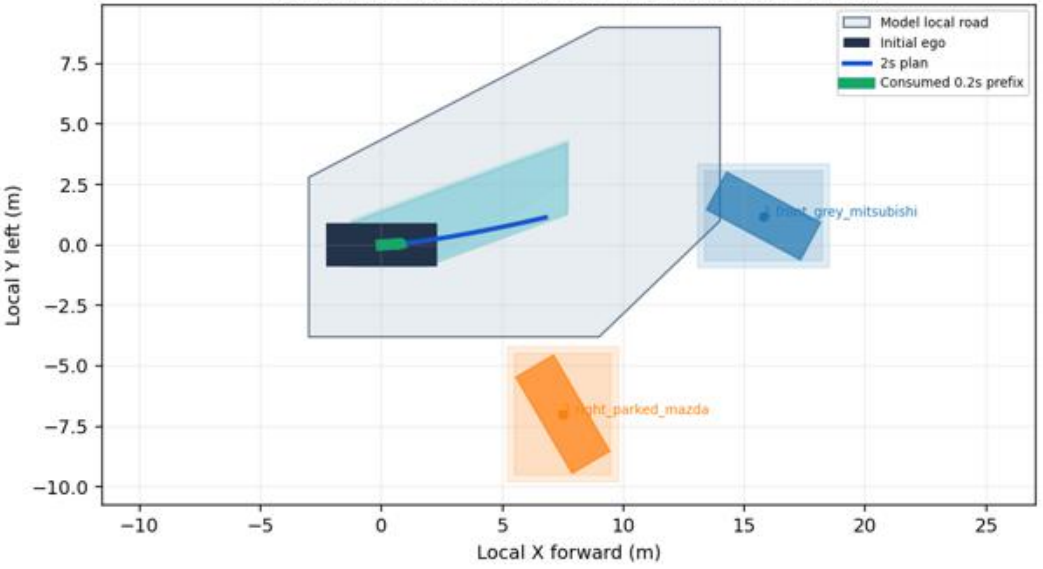

This window only; tails not executed

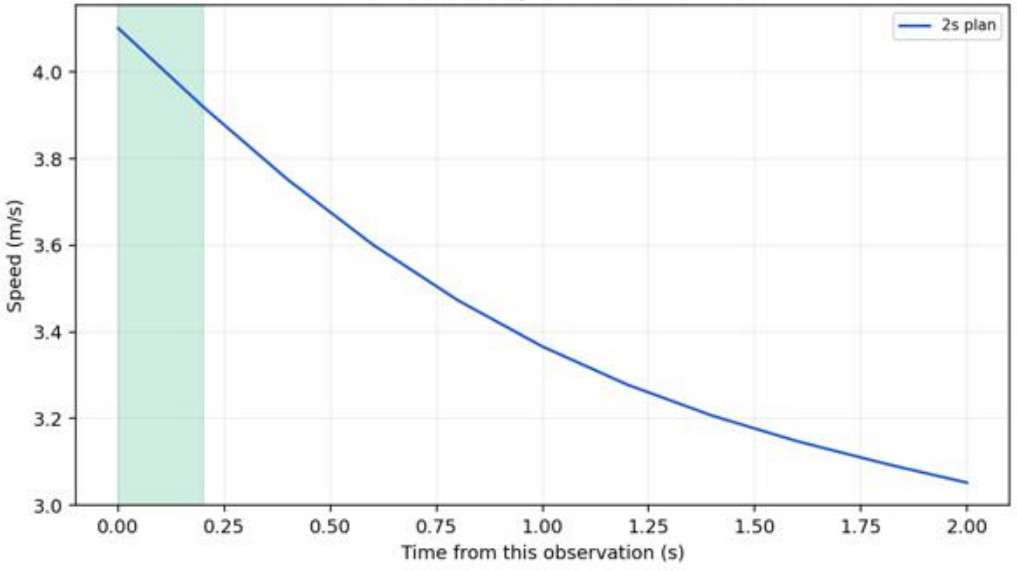

frame_001 t0=+0.500s
Status: RECOVERY_GROUP_PASS_AFTER_PRIOR_ATTEMPT; post failures=2/preflight failures=0 / block: NONE
Real requests: 4 | source: online_model; group=openai_bend_sequence_tls_20261029_v1
Attempt: 2 | actual server snapshot: UNKNOWN
Decision: hold_lane | desired v: 3
Stages: SERVICE=PASS | BUSINESS_SCHEMA=PASS | T1=PASS | T2=PASS | T3=PASS | T4=PASS | TURN_TASK=PASS | ACCEPTOR=PASS | EXECUTION=PASS
Objects declared: 2
T4 stage: PASS | selected-plan T4: PASS
Prefix consumed: True | clearance lower bound: 2.7742468114059315 m
Prefix: MOVING_PREFIX | distance=0.8034265973182114 m
Prefix end speed: 3.920072622540826 m/s
Signed plan yaw: 12.064968203558507 deg | lateral=1.1391645055178194 m
Signed prefix yaw: 2.2077960474318776 deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_002 | +1.00s | FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0


Original recorded image / display-only model projection



Saved native model geometry / independent local plan

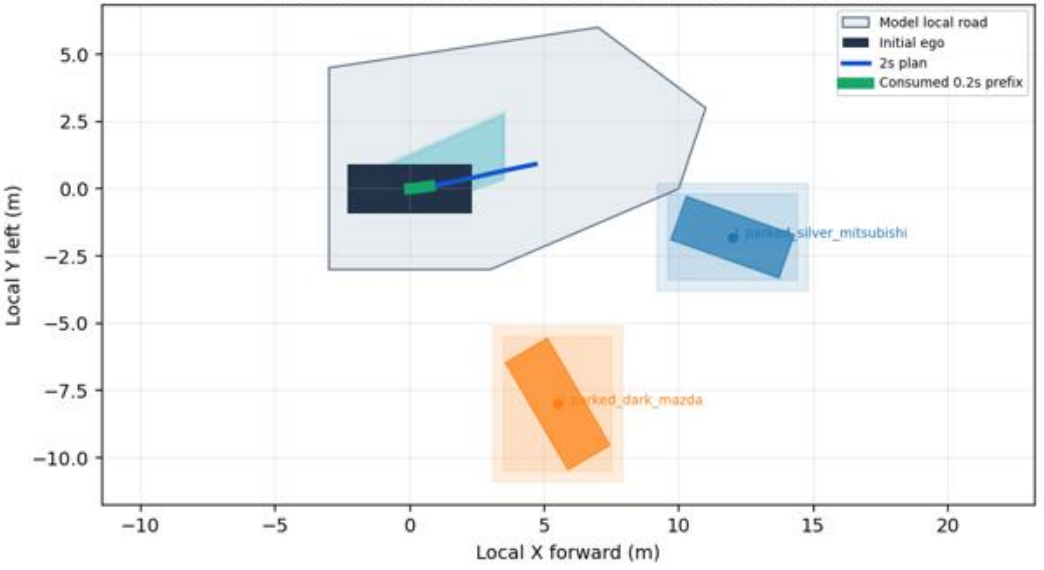

This window only; tails not executed

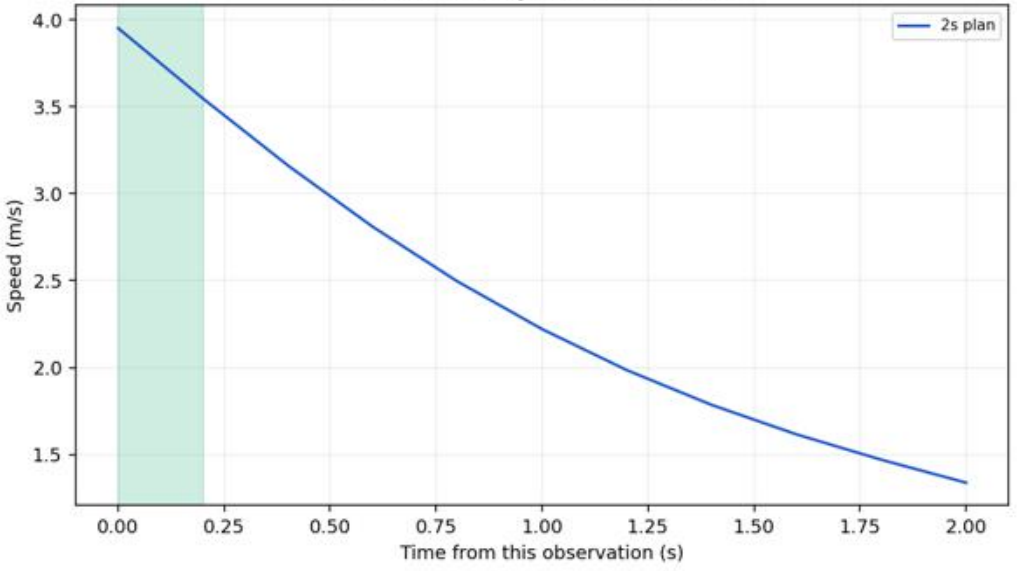

frame_002 t0=+1.000s
Status: FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0 / block: NONE
Real requests: 1 | source: online_model; group=openai_bend_sequence_tls_20261029_v1
Attempt: 1 | actual server snapshot: UNKNOWN
Decision: hold_lane | desired v: 2.5
Stages: SERVICE=PASS | BUSINESS_SCHEMA=PASS | T1=PASS | T2=PASS | T3=PASS | T4=PASS | TURN_TASK=PASS | ACCEPTOR=PASS | EXECUTION=PASS
Objects declared: 2
T4 stage: PASS | selected-plan T4: PASS
Prefix consumed: True | clearance lower bound: 1.0066339568798477 m
Prefix: MOVING_PREFIX | distance=0.753635150966244 m
Prefix end speed: 3.5474487521456837 m/s
Signed plan yaw: 11.540026249004475 deg | lateral=0.912785193524863 m
Signed prefix yaw: 3.6191232343186575 deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_003 | +1.50s | FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0


Original recorded image / display-only model projection



Saved native model geometry / independent local plan

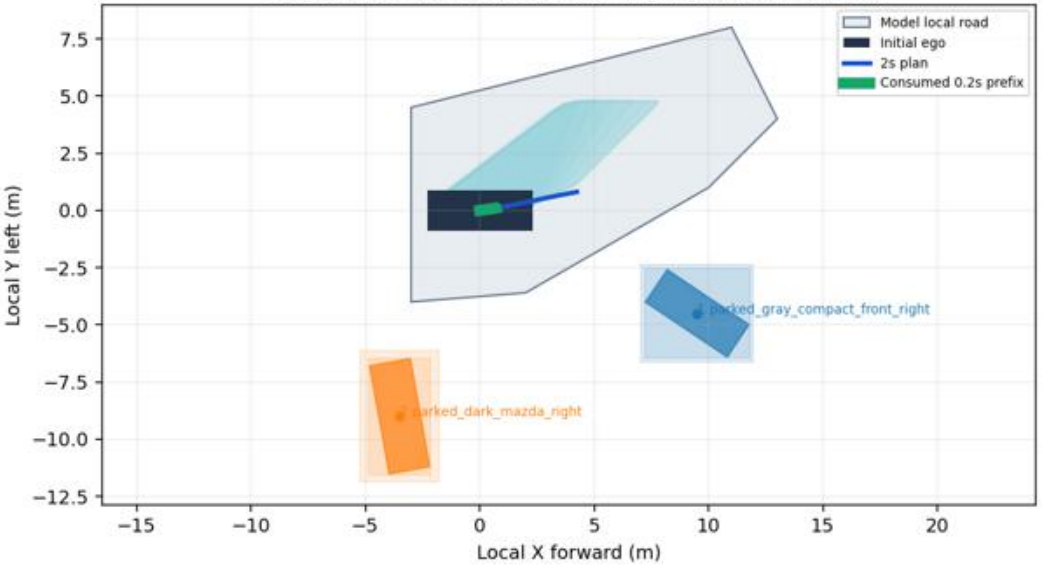

This window only; tails not executed

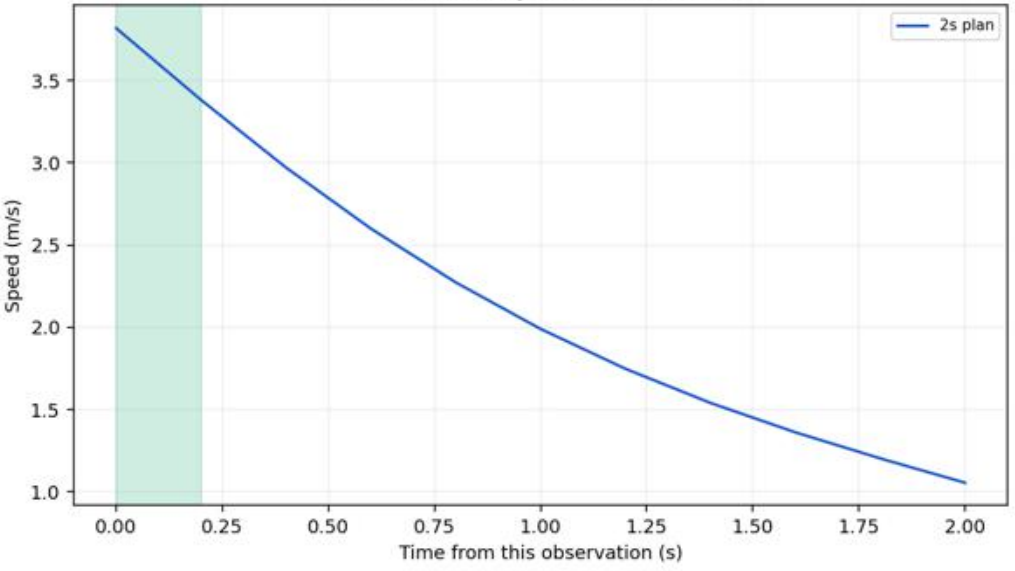

frame_003 t0=+1.500s
Status: FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0 / block: NONE
Real requests: 1 | source: online_model; group=openai_bend_sequence_tls_20261029_v1
Attempt: 1 | actual server snapshot: UNKNOWN
Decision: hold_lane | desired v: 2.5
Stages: SERVICE=PASS | BUSINESS_SCHEMA=PASS | T1=PASS | T2=PASS | T3=PASS | T4=PASS | TURN_TASK=PASS | ACCEPTOR=PASS | EXECUTION=PASS
Objects declared: 2
T4 stage: PASS | selected-plan T4: PASS
Prefix consumed: True | clearance lower bound: 2.06950864031237 m
Prefix: MOVING_PREFIX | distance=0.7252062024745688 m
Prefix end speed: 3.3825019060794936 m/s
Signed plan yaw: 10.872042873976437 deg | lateral=0.8067832256352179 m
Signed prefix yaw: 4.150036779907068 deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_004 | +2.00s | FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0


Original recorded image / display-only model projection



Saved native model geometry / independent local plan

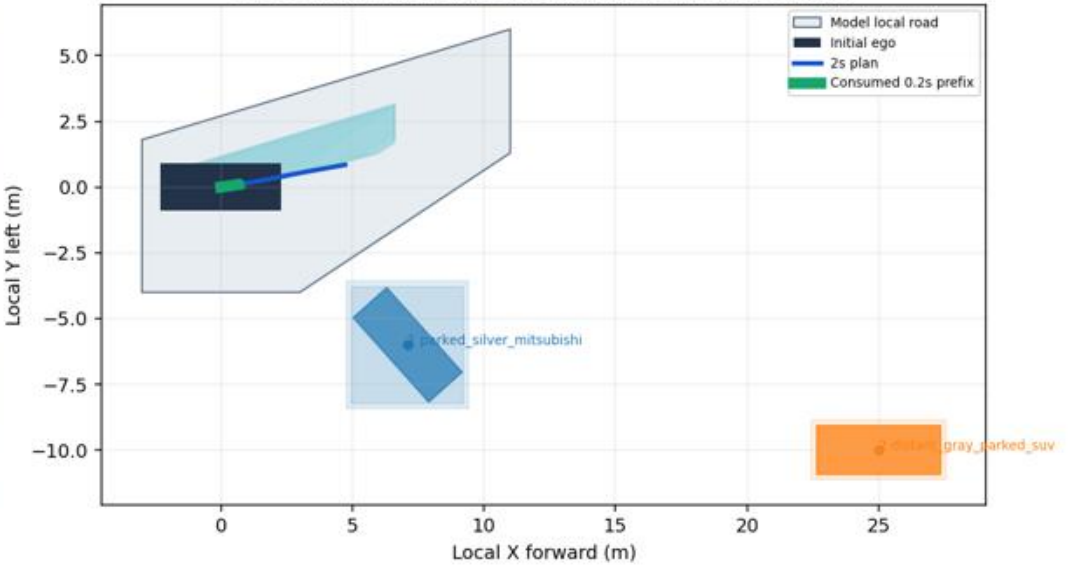

This window only; tails not executed

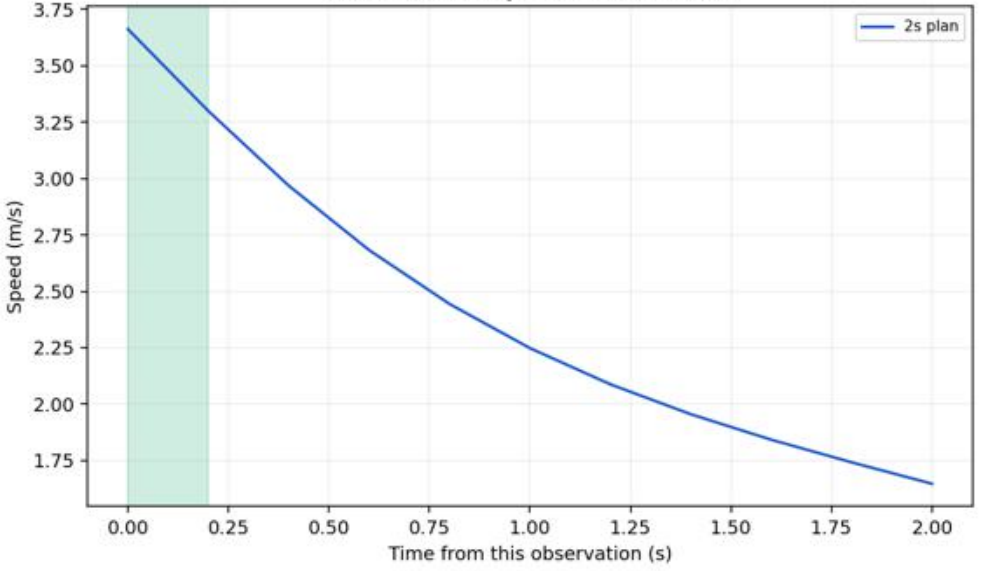

frame_004 t0=+2.000s
Status: FIRST_ATTEMPT_PASS; post failures=0/preflight failures=0 / block: NONE
Real requests: 1 | source: online_model; group=openai_bend_sequence_tls_20261029_v1
Attempt: 1 | actual server snapshot: UNKNOWN
Decision: hold_lane | desired v: 2.7
Stages: SERVICE=PASS | BUSINESS_SCHEMA=PASS | T1=PASS | T2=PASS | T3=PASS | T4=PASS | TURN_TASK=PASS | ACCEPTOR=PASS | EXECUTION=PASS
Objects declared: 2
T4 stage: PASS | selected-plan T4: PASS
Prefix consumed: True | clearance lower bound: 2.2864847378086948 m
Prefix: MOVING_PREFIX | distance=0.7009169701550738 m
Prefix end speed: 3.2985039980034534 m/s
Signed plan yaw: 10.080284758196324 deg | lateral=0.844765550540876 m
Signed prefix yaw: 4.0282278413097865 deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.


Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.

frame_005 | +2.50s | PREFLIGHT_FAILURE_NO_GENERATION; post failures=0/preflight failures=1

Original recorded image / display-only model projection



Saved native model geometry / independent local plan

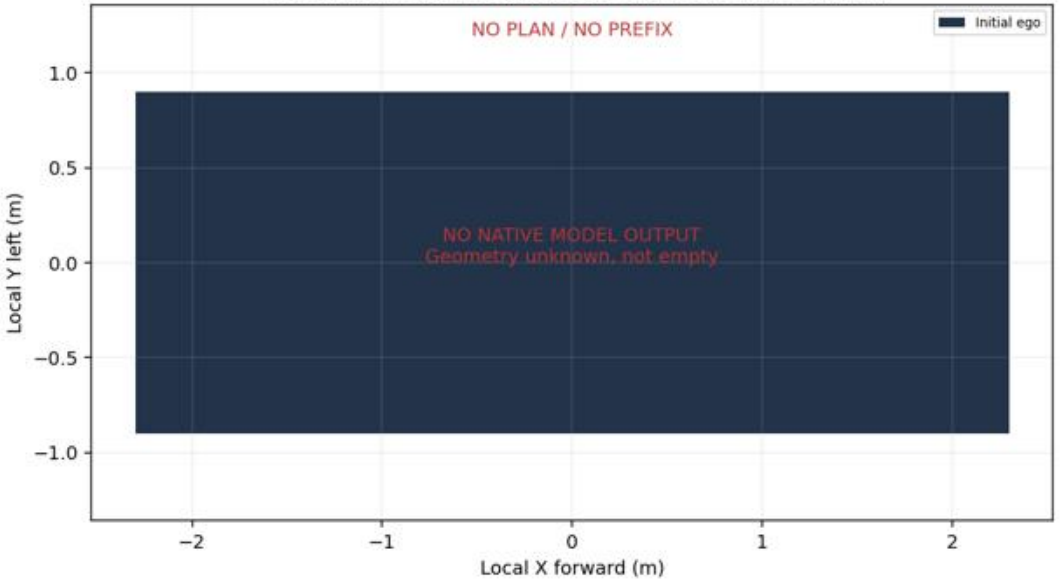

This window only; tails not executed



frame_005 t0=+2.500s
Status: PREFLIGHT_FAILURE_NO_GENERATION; post failures=0/preflight failures=1 / block: MODELS_PREFLIGHT
Real requests: 0 | source: NO_NATIVE_OUTPUT; group=openai_bend_sequence_tls_20261029_v1
Attempt: None | actual server snapshot: UNKNOWN
Decision: NOT_REACHED | desired v: UNKNOWN
Stages: SERVICE=NOT_REACHED | BUSINESS_SCHEMA=NOT_REACHED | T1=NOT_REACHED | T2=NOT_REACHED | T3=NOT_REACHED | T4=NOT_REACHED | TURN_TASK=NOT_REACHED | ACCEPTOR=NOT_REACHED | EXECUTION=NOT_REACHED
Objects declared: UNKNOWN
T4 stage: NOT_REACHED | selected-plan T4: NOT_REACHED
Prefix consumed: False | clearance lower bound: None m
Prefix: NOT_EXECUTED | distance=None m
Prefix end speed: None m/s
Signed plan yaw: None deg | lateral=None m
Signed prefix yaw: None deg
Turn direction / road agreement: independent review pending.
Amplitude gate: plan >=5 deg and >=0.3m; prefix >=0.1 deg and >0.01m.
These are descriptive gates, not safety or correct-turn proof.
Image dots/line: display-only z=0 projection, not detection/GT.

Recorded observations, not observations caused by these plans. Each 2s plan and consumed 0.2s prefix starts independently; no stitched execution, real vehicle control or GT evaluation.