



Format No: 40/2014/2024

Rev. No: 01


Revision Date: 04.12.2021

22615539

Control Card No.	CC-HMSI-59
Revisions:	Projector and Grammes location
Control Card Type:	Brake Hose
Issued:	Supma
Customer:	HMSI
Checked:	GANESH VATS
Drawing Revision:	M-23-F0674(23 May-23)
Approval:	BN/ASH-SAN
Issue Date:	07.04.2026

PART NAME	HOSE COMP D FR BRAKE
PART NO.	45128-KLL-D410-M1-1FC-R02
MASS PRODUCTION	
Product Order No.	22615539/45128-KLL-D410-M1-1FC-R02
Assembly Number	8701
Quantity	800
Production Plan Date	27.06.2024/01-07-2026

LINE NO :

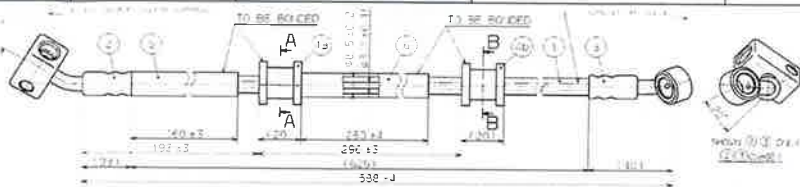

Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Accessories Insertion-1	Rubber Hose Clamp Part No.	BU10024-01000-IND	As per Box Tag	an	an	an	0 800 1/7/26
	Supplier Name	TIRUPATI RUBBER MILLS	As per Box Tag	an	an	an	
	Rubber Hose Clamp Lot No.	As per box tag	As per Box Tag	an	an	an	
	Protector Part No.	PR0157-0160-IND	As per Bin Tag	an	an	an	
	Hose Part No.	05-0030-015-00-000559	As per Bin Tag	an	an	an	
	Hose Manufacturer	NVC	Visually	NVC	NVC	NVC	
	Hose Type	SLIM XP	Visually	SLIM XP	XP	XP	
	Sequence of accessories	1. Rubber Hose Clamp 2. Protector L-160	AS per WI	an	an	an	
	Operator	Operator Name	Actual	Pooja Pooja Pooja			

FIRST OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

First Crimping	Machine Number	Actual	Visually	CRM-11			0 800 1/7/26
	Crimping Jig	CJ-23-SLIM-01-01/02122-Slim	Visually	CJ-23-Slim			
	Fitting Part No.	FA0588-30000	As per Box	FA0588-30000			
	Plating Color for MFZn2-C	Plating Color Should be Silver Color	Visually	an	an	an	
	Fitting Lot Number	As per Supplier Lot No.	As per Box	64049			
	Crimping Location	3.510.5	CRIMPING CALIPER	3.51 9.00 9.01 9.00 9.01	3.50 9.00 9.01 9.00 9.02	3.51 9.01 9.02 9.01 9.00	
	Crimp Diameter (mm)	9.00±0.05	CRIMPING CALIPER				
	Hydraulic Pressure	6-7 Mpa	Pressure Gauge	6.5	6.5	6.5	
	Appearance	No damage And Dent	Visually	an	an	an	
	Kakotora Check point	Crimping Must be Done and No liquid Pool mark on sealing surface allowed.	Visually	an	an	an	
	Crimping Presence	Must be Available	Visually	an	an	an	
	Mark line Insertion	Not Visible after Crimping	Visually	an	an	an	
	Operator	Operator Name	Actual	Ayush Ayush Ayush			

FIRST OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

Accessories Insertion-2	Protector Part No.	PR0157-0260-IND	As per Box Tag	an	an	an	0 800 1/7/26
	Rubber Hose Clamp Part No.	BU10024-01000-IND	As per Box Tag	an	an	an	
	Supplier Name	TIRUPATI RUBBER MILLS	As per Box Tag	an	an	an	
	Rubber Hose Clamp Lot No.	As per box tag	As per Box Tag	an	an	an	
	Sequence of accessories	1. Protector L-260 2. Rubber Hose Clamp	AS per WI	an	an	an	
	Operator	Operator Name	Actual	Sima Sima Sima			

FIRST OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

Second Crimping	Machine Number	Actual	Visually	CRM-10			0 800 1/7/26
	Fitting Part No.	K40543-50135-C3	As per Box	K40543-50135			
	Plating Color for MFZn2-C	Plating Color Should be Silver Color	Visually	an	an	an	
	Lot No.	As per Printing (NII YMDD)	Visually	M1 6701			
	Angle Set	Jig No. WR-HMSI-59	Visually	WR-HMSI-59			
	Hydraulic Pressure	6-7 Mpa	Pressure Gauge	6.5	6.5	6.5	
	Crimping Location	3.520.5	CRIMPING CALIPER	3.54 9.00 9.01 9.00 9.01	3.55 9.01 9.00 9.01 9.00	3.54 9.00 9.01 9.00 9.01	
	Crimping Diameter(mm)	9.00±0.05	CRIMPING CALIPER				
	Mark line Insertion	Not visible after crimping	Visually	an	an	an	
	Relative Angle	20°±20°	As per Final Gauge	an	an	an	
	Length	688±4	As per Final Gauge	an	an	an	
	Kakotora Check point	Crimping Must be Done , Wrong Part ID not allowed , And No stamping miss allowed and No liquid Pool mark on sealing surface allowed.	Visually	an	an	an	
	Crimping Presence	Must be Available	Visually	an	an	an	
	Appearance	No damage And Dent	Visually	an	an	an	
	Operator	Operator Name	Actual	ripin ripin ripin			

FIRST OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING



Form No. NH/CA/PA/25A

Rev. No. 01

Revision Date: 14.12.2021

22615539


PART NAME
HOSE COMP D FR BRAKEPART NO.
45128-K1L-D410-M1-1FC-R02

MASS PRODUCTION

Product Order No.
22615539/45128 K1L D410 M1 1FC R02Assy Lot Number
6701Quantity
800Production Plan Date
27.06.2026/01.07.2026

LINE NO :

Control Card No.	CC-HMSI-59	Control Card Type	Brake Hose
Revisions :	Protector and Grommet localization	Customer :	HMSI
Issued :	Garna	Drawing Revision :	M-23-F0674(23 May-23)
Checked :	SANISH-KAT	Issue Date :	07.04.2026
Approval :	AN/AN/ SAN		

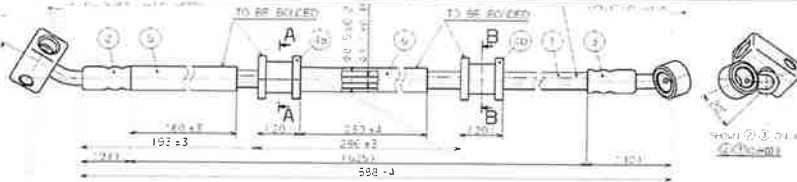

Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Accessories Bonding	Bonding Jig No.	BJ-HMSI-59-A1	Visually	BJ-HMSI-59-A1			
		BJ-HMSI-59-A2	Visually	" "			
		BJ-HMSI-59-B1	Visually	" "			
		BJ-HMSI-59-B2	Visually	" "			
	Bonding Position & Angle	As per Drawing	As per Bonding Jig	cm	cm	cm	
	Kakotora Check point	No extra adhesive allowed on Protector, No adhesive allowed on fitting Sealing surface and part must not be stuck together while kept on table, and Protector not to be bond in wrong side And No loosens of grommets.	Visually	cm	cm	cm	
	Adhesive Amount	No extra adhesive Allowed	2-3 Drop	cm	cm	cm	
	Bonding Jig 1 Operator	Operator Name	Actual	Nazma	Nazma		
Pressure Test	Bonding Jig 2 Operator	Operator Name	Actual	Sulhama	Sulhama		
	Bonding Jig 3 Operator	Operator Name	Actual	Nobida	Nobida		
	Bonding Jig 4 Operator	Operator Name	Actual	Upam	Upam		
	Machine No.	Actual	Visually	27M-07			
	Pressure Set	15.3+1.0/0 MPa	Visually	15.9	15.9	15.9	
	Time	10-40 Sec	Visually	40 sec			
	Leakage	No any type of leakage allowed	As per WI	cm	cm	cm	
	Bolt hole Appearance	Must be no scratch and burr	Visually	cm	cm	cm	
Final Inspection	Verification Mark	Blue mark on any one fitting	Visually	cm	cm	cm	
	Operator	Operator Name	Actual	Aniket	Aniket		
	Final Inspection Jig	Jig No. (FI-HMSI-59)	Visually	FI-HMSI-59			
	Assy Part No.	45128-K1L-D410-M1-1FC-R02	As per Control Card	45128-K1L-D410-M1-1FC-R02			
	Leak Test Marking	Blue color marking on any Fitting	Visually	cm	cm	cm	
	Lot No.	Must be Present (NII YMDD)	Visually	NII 6701			
	Dimension & Angle	As per above Given drawing (page 1)	As per Final Gauge	cm	cm	cm	
	Plating Color for MFZn2-C in both fittings	Plating Color Should be Silver Color	Visually	cm	cm	cm	
Packing	ICAT No. and Part ID	Must be present CN2222 & 8-K1L-D41	Visually	CN 2222			
	Mark Line Insertion	Not visible after Crimping	Visually	cm	cm	cm	
	Kakotora check point related to Fitting	Must be no Scratch on Sealing Surface, No Liquid pool allowed on sealing surface	Visually	cm	cm	cm	
	Kakotora check point related to Bonding	No extra adhesive allowed on Protector, No adhesive allowed on Fitting Sealing surface and part must not be stuck together while kept on table, and Protector not to be bond in wrong side and Grommet Must be no loose.	Visually	cm	cm	cm	
	Kakotora check point related to Crimping	Both End fittings must be Properly crimped	Visually	cm	cm	cm	
	Kakotora check point related to Lot no. Stamping	Wrong Part ID not Allowed, And No stamping miss allowed	Visually	cm	cm	cm	
	Hose Appearance	No dent, scratch damage. Printing must be available	Visually	cm	cm	cm	
	Fitting Appearance	Must be no deformation, Scratch, Liquid pool, scratch inside bolt hole and Rust	Visually	cm	cm	cm	
PASS STAMP	Fitment	Can easily insert into Gauge And Accessories to be bonded as per drawing	Visually	cm	cm	cm	
	Operator	Operator Name	Actual	Rubi	Rubi	Rubi	
	Assy Part No.	45128-K1L-D410-M1-1FC-R02	As per Control Card	45128-K1L-D410-M1-1FC-R02			
	Contamination Control	Use plastic bag cover both side	Visually	cm	cm	cm	
	Bin Size	600 X 400X 280	As per Packing matrix	cm	cm	cm	
	Bin Color	Yellow with white strip	As per Packing matrix	cm	cm	cm	
	Quantity	60 No's (20 nos's x 3 Bundle)	As per Packing matrix	cm	cm	cm	
	Storage Condition	Must be not bend below R50	Visually	cm	cm	cm	
QA Inspection Result	Packing Operator	Operator Name	Actual	Anjali	Anjali	Anjali	
	NII Internal Tag	NII Internal Tag Lot No /Part No Should as per Control card & Must be present on Each Bundle	Manually	cm	cm	cm	
	RF-gen Tag Printing	Should Be as per Control Card/ Work order	Actual	cm	cm	cm	
	RF-Gen Tag Pasting	Should be paste on Each Bin	Actual	cm	cm	cm	
	Tag Printing / Pasting Line By Line Leader	Tag Lot no. & Part No. should be as per Control Card	Actual	Shy	Shy	Shy	
	Tag Verification & OK Stamp By Prod. Engineer	Internal Tag / RF-Gen Tag Should be as per Control Card	Actual	cm	cm	cm	
	Production Engineer	Production Engineer Name	Actual	Gurdeep	Gurdeep		
	QA Inspector	QA Inspector	Actual	Gurdeep	Gurdeep		
TOTAL OK					800		
TOTAL NG					0		
TOTAL TAKEN					800		

Parts May NOT Be Transferred to the Warehouse until Passed / Rejected / Initiated



Format No.: NI/QA/FR/05A

Rev. No.: 01

Revision Date: 14.12.2021

22615539

Control Card No :	CC-HMSI -59	Control Card Type :	Brake Hose
Revisions :	 Protector and Grammet localization	Customer :	HMSI
Issued :	Garima	Drawing Revision :	M-23-F0674(23 May-23)
Checked :	GANESH VATS	Issue Date :	07.04.2026
Approval :	AVINASH KUMAR		

PART NO. 45128-K1L-D410-M1-1FC-R02

MASS PRODUCTION

Product Order No :	22615539/45128-K1L-D410-M1
Assy Lot Number :	6701
Quantity :	800
Production Plan Date :	27-06-2026/01-07-2026



Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Protector Cutting PR0157-0260-IND	Machine Number	Actual	Visually	PCM-04			
	Part No.	PR0157-0000-IND 	As per Box Tag	OK OK OK			
	Supplier Name	ACME PLASTICS 	As per Box Tag	OK OK OK			
	Protector Lot No.	As per Box Tag	Visually	260613 260613			
	Cut Length	260±4 (256 ~ 264)	Scale	263 261 263 261 263 261			
	Machine Setting Length	As per PLC input	Manual Setting	258 258 258			
	Appearance	No Tapper Cut	Visually	OK OK OK			
	Operator	Operator Name <i>Samir</i>	Actual	Pooja Pooja			
FIRST-OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING							
PASS STAMP		QA Inspection Result OK/N.G	QA Inspector	TOTAL OK	800		
				TOTAL NG	0		
				TOTAL TAKEN	800		
Parts May NOT be Transferred to the Warehouse until Passed / Dated / Initialled							

27/08/26

800

Samir




Revision Date: 14.12.2021

Control Card No :	CC-HMSI -59		
Revisions :	 Protector and Grommet localization	Control Card Type :	Brake Hose
Issued :	Garima	Customer :	HMSI
Checked :	GANESH VATS	Drawing Revision :	M-23-F0674(23 May-23)
Approval :	AVINASH KUMAR	Issue Date :	07.04.2026

MASS PRODUCTION

Production Plan Date :	27-06-2026/01-07-2026
------------------------	-----------------------

[illegible]



Format No.:
NII/QA/FR/OSA Rev. No.:01 Revision Date: 14.12.2021


22615539

Control Card No.:	CC-HMSI -59	Control Card Type:	Brake Hose
Revisions:	Protector and Grammet localization	Customer:	HMSI
Issued:	Garima	Drawing Revision:	M-23-F0874(23 May-23)
Checked:	GANESH VATS	Issue Date:	07.04.2026
Approval:	AVINASH KUMAR		


PART NO. 45128-K1L-D410-M1-1FC-R02

MASS PRODUCTION


Product Order No.:	22615539/45128-K1L-D410-M1-1
Assy Lot Number:	6701
Quantity:	800
Production Plan Date:	27-06-2026/01-07-2026



CHILD PART

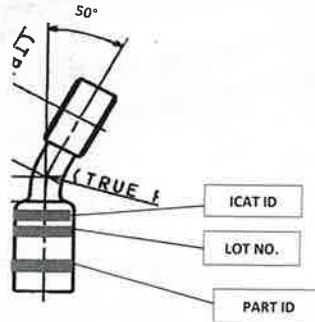

Up Side Bend

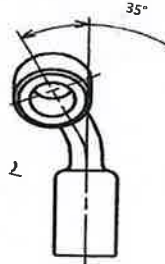

Left Side Bend

Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Fitting Bending K40543-50135-C3	Machine Number	Actual	Visually	TJND-01	0	800	27/06/26
	Fitting Part No.	K40543-00000-C3	As per Bin/Box	OK OK OK			
K	Fitting Lot No.	As per supplier Lot no.	As per Bin/Box	63 D 80			
	Plating Color for MFZn2-C	Plating Color Should be Silver Color	Visually	OK OK OK			
	Angle	50°±2° (Up side)	Inspection Gauge	49°			
	Angle Inspection jig No.	AIG-03	Visually	OK OK OK			
	Angle	35°±2° (Left side)	Inspection Gauge	35°			
	Angle Inspection jig No.	AIG-04	Visually	OK OK OK			
	Bending Jig Setting	Height - 206 L-R setting - R-27	Visually	H-206 R-27			
	Appearance	Must be no deformation	Visually	OK OK OK			
	Kakotora Check point	There Should be no scratch on Fitting sealing surface, No liquid Pool mark on sealing surface allowed.	Visually	OK OK OK			
	Operator	Operator Name	Visually	Shiv Shambhu			

FIRST-OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

Manufacturing lot no. stamping	Machine Number	Actual	Visually	LPM-06	0	800	29/06/26
	Fitting Part No.	K40543-50135-C3	As per Bin/Box	OK OK OK			
	Lot No. Stamp / Print	As per Production Date (NII YMDD)	Visually	NII 6701			
	Stamp Ident Mark	8-K1L-D41	Visually	8-K1L-D41			
K	TAC No. for XP Hose	CN2222 For NVC-XP hose TAC No.	Visually	CN2222			
	Stamping character and Position	Should be clear and in level	Visually	OK OK OK			
	Kakotora Check point	Wrong Part ID not Allowed, And No stamping ruse allowed and No liquid Pool mark on sealing surface allowed.	Visually	OK OK OK			
	Operator	Operator Name	Visually	Kishan Kishan			

FIRST-OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

PASS STAMP	QA Inspection Result OK/N.G	QA Inspector	TOTAL OK	800
			TOTAL NG	0
			TOTAL TAKEN	800

Parts May NOT be Transferred to the Warehouse until Passed / Dated / Initialed

Lot no. 63 D 80 X 2 Box



Format No.:
NIU/GA/FR/55A


Rev. No: 01

Revision Date: 14.12.2021


22615539

Control Card No :	CC-HMSI -59	Control Card Type :	Brake Hose
Revisions :	 Protector and Grommet localization	Customer :	HMSI
Issued :	Garima	Drawing Revision :	M-23-F0674(23 May-23)
Checked :	GANESH VATS	Issue Date :	07.04.2026
Approval :	AVINASH KUMAR		

PART NO.	45128-K1L-D410-M1-1FC-R02
MASS PRODUCTION	
Product Order No :	22615539/45128-K1L-D410-M1-1FC-R02
Assy Lot Number :	6701
Quantity :	800
Production Plan Date :	27-06-2026/01-07-2026

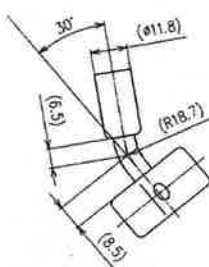

Up Side Bend

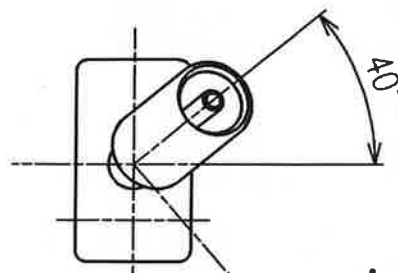

Right Side Bend

Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Fitting Bending K35395-30000 (FA0588-30000)	Machine Number	Actual	Visually	Bend-10	0	800	27/6/26
	Fitting Part No.	K35395-30000-C3NII	As per Bin/Box	04 OK OK			
	Fitting Lot No.	As per supplier Lot no.	As per Bin/Box	64049			
	Plating Color for MFZn2-C	Plating Color Should be Silver Color	Visually	04 OK OK			
	Angle	30°±2° (Up side)	Inspection Gauge	OK As per gauge			
	Angle Inspection jig No.	AIJ-36	Visually	04 OK OK			
	Angle	40°±2° (Right side)	Inspection Gauge	OK As per gauge			
	Bending Jig Setting	Height: 148	Visually	M-148			
		Left/Right:-R39.5	Visually	R-39			
		PIN Direction:- Right	Visually	04			
	Appearance	Must be no deformation	Visually	04 OK OK			
	Kakotora Check point	There Should be no scratch on Fitting sealing Surface , No liquid Pool mark on sealing surface allowed.	Visually	04 OK OK			
	Operator	Operator Name	Visually	not Deepu			

FIRST-OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

PASS STAMP	QA Inspection Result OK/N.G	QA Inspector 	TOTAL OK	800
			TOTAL NG	0
			TOTAL TAKEN	800

Parts May NOT be Transferred to the Warehouse until Passed / Dated / Initialed

LOT-NO → 64049-1
63B76-1
64033-2



Format No.: NIL/QA/FR/05A


Rev. No.:01

Revision Date: 14.12.2021



22615539

Control Card No.:	CC-HMSI -59	Control Card Type:	Brake Hose
Revisions:	2 Protector and Grommet localization	Customer:	HMSI
Issued:	Garima	Drawing Revision:	M-23-F0674(23 May-23)
Checked:	GANESH VATS	Issue Date:	07.04.2026
Approval:	AVINASH KUMAR		

PART NO.	45128-K1L-D410-M1-1FC-R02
MASS PRODUCTION	
Product Order No.:	22615539/45128-K1L-D410-M1-
Asay Lot Number:	6701
Quantity:	800
Production Plan Date:	27-06-2026/01-07-2026

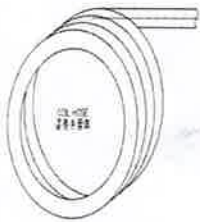


CHILD PART



SUB ASSY

2 EXAMPLE OF LABELING

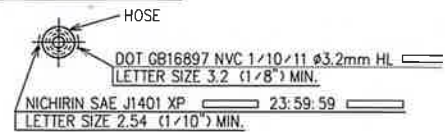

Process	Control Points	Standards	Method	Check / record	Total NG	Total OK	Date/Initial
Hose Cutting 05-0030-015-00-000659	Machine Number	Actual	Visually	HCM-08			
	Part No.	05-0030-015-00-000NII	As per Box Tag	OK OK OK			
	Hose Lot No.	As per Box Tag	Visually	6225 6225			
	Hose Manufacturer	NVC	Visually	NVC NVC NVC			
	Hose Type	SLIM XP	Visually	SLIM-XP SLIM-XP			
	Stamp On Hose	As per above Drawing	Visually	DOT GB16897 NVC 02/24/26 3.2mm HL NICHIRIN SAE J1401 XP			
	Cut Length	659±3 (656 ~ 662)	SCALE	659 660 659 660 659 660			
	Insertion Mark (Both)	16.0±0/-1.5 (14.5 ~ 16)	INSERTION GAUGE	OK OK OK OK OK OK	0	800	27/6/26
	Cutting Appearance	No thread out, no uneven Cut	Visually	OK OK OK			
	Operator	Operator Name Sample	Actual	ANISH ANISH			

FIRST-OFF ASSY. TO BE CHECKED BY TEAM LEADER OR QC & SIGNED OFF BEFORE PROCEEDING

In Case Against Any Work order roll used more than one roll need to fill below table.

Roll No.	Hose Part No. (As per Control Card)	Hose Part No. (On Roll / Box Tag)	Hose Type	Stamp On Hose	Checked By	Verified By
				Example:-DOT GB16897 NVC MM/DD/YY Ø3.2 mm HL NICHIRIN SAE J1401 XP		
Roll No.-1	05-030-015-00-0000	XP NVC		DOT GB16897 NVC 02/24/26	ANISH-Sample	
Roll No.-2	05-0030-015-00-0000	XP NVC		DOT GB16897 NVC 02/24/26	ANISH-Sample	
Roll No.-3						
Roll No.-4						
Roll No.-5						
Roll No.-6						
Roll No.-7						
Roll No.-8						
Roll No.-9						
Roll No.-10						
PASS STAMP		QA Inspection Result OK/NG	QA Inspector	TOTAL OK	800	ANISH
				TOTAL NG	0	
				TOTAL TAKEN	800	

Parts May NOT be Transferred to the Warehouse until Passed / Dated / Initialed