


SME01403 — Lee Health Imaging and Radiology - Outpatient MRI MRI


Lee Health · Philips MRI · Fort Myers, FL · Jul 7 – Aug 6 monitor data (1,465 captures) · analyzed 2026-08-06

COMPRESSOR ON recovered Aug 1 14:18Z · 7 cycles from Jul 9 23:48Z	PRESSURE NOW 33 mbar 41% of the 80 mbar line · easing	EVENT PEAK 275 mbar Jul 14 07:48Z · 195 mbar over threshold	TEMP ALARM TRIGGERED 45 readings · Jul 11 06:18Z → Jul 25 21:48Z	HELIUM 57.4% below the 60% warning level
---	---	---	--	--

HE PRESSURE — JUL 7 → AUG 6 (daily range, mbar · orange shade = the event window)

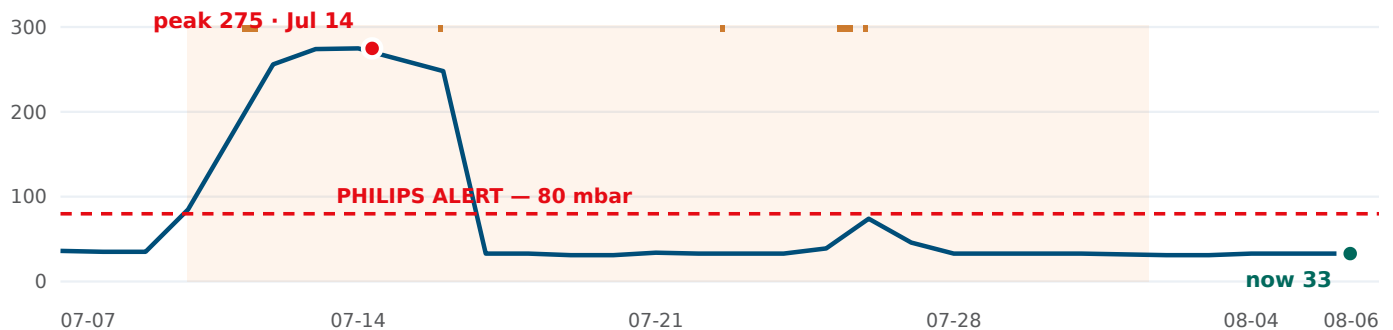

HELIUM LEVEL — JUL 7 → AUG 6 (daily reading, %)

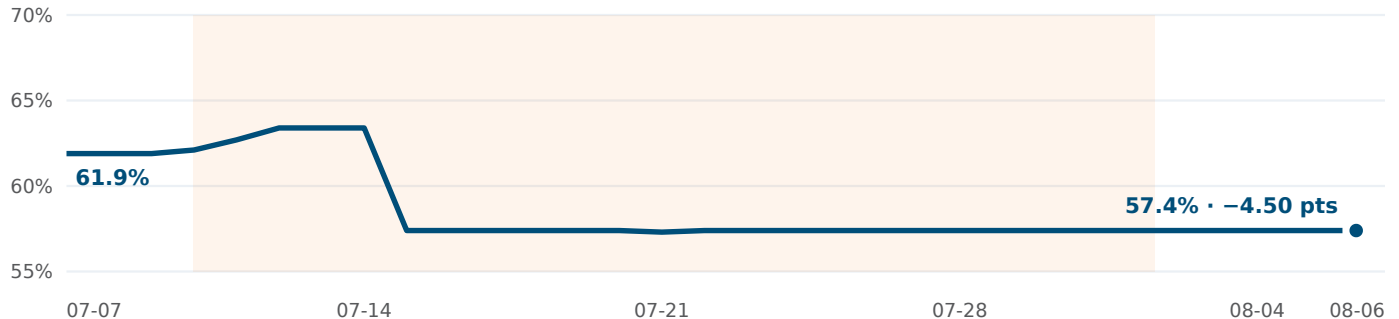

Timeline (UTC): Baseline Jul 7 – Jul 9: pressure held 35–36 mbar, helium 61.9–61.9%. **Jul 9 23:48Z: the compressor stopped** and then cycled on/off 7 times through Aug 1 14:18Z (73 readings off). A compressor temperature alarm was triggered Jul 11 06:18Z → Jul 25 21:48Z (45 readings — not continuous, it re-triggered 4 times; amber strip on the pressure chart). He pressure rose from 35 to a **peak of 275 mbar at Jul 14 07:48Z** — 195 mbar over the 80 mbar line (+2 mbar/h avg on the ramp). **The compressor recovered Aug 1 14:18Z** and has held since. Helium fell to **57.4%** (–4.50 vs baseline). No quench. Pressure now reads 33 mbar (Aug 6 07:48Z) — 41% of the line.

CURRENT — AUG 6 (last readings)

Compressor ON. He pressure 33 mbar (07:48Z). Helium 57.4%.

RATES

Pressure –2 mbar vs baseline (35 → 33); peak 275. Ramp averaged +2 mbar/h. Helium –4.50 points.

DATA NOTES

1,465 captures · 27 valid pressure · 39 valid helium readings. Charts show the daily min-max range with the daily last value. Tech Room Temp 18.0–23.2 °C in window. Host clock ~36 min off vs capture time — times shown use capture time.