

SME21824 — Northside/Village Center Imaging MRI

Intelas · GE MRI · Canton, GA · Jul 20 – Jul 28 monitor data (414 captures) · analyzed 2026-08-06

COMPRESSOR

RESTARTED

recovered Jul 28 14:45Z
· off ~17.0 h

COLDHEAD

4.205 K

from 77.3 K

PRESSURE NOW

2.597 PSI

within the 0.5–5.2
PSI band · easing

EVENT PEAK

3.696 PSI

Jul 28 14:15Z ·
1.504 PSI under
threshold

HELIUM


81.40%

+1.45 pts · no loss ·
no quench

HE PRESSURE — JUL 20 → JUL 28 (every capture, PSI · orange shade = the event window)



HELIUM LEVEL — JUL 20 → JUL 28 (every capture, %)

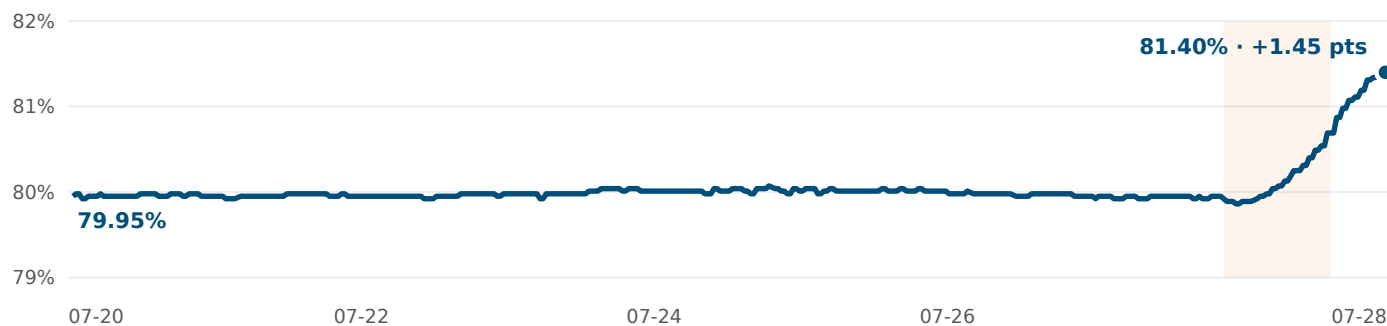

Timeline (UTC): Baseline Jul 20 - Jul 27: pressure held 0.989–1.011 PSI, helium 79.92–80.07%, coldhead at base temperature. **Jul 27 21:15Z: the compressor stopped** and stayed off ~17.0 h (34 readings off). He pressure rose from 0.998 to a **peak of 3.696 PSI at Jul 28 14:15Z** — never reached the 5.2 PSI threshold, 1.504 PSI below the line (+0.159 PSI/h avg on the ramp). **The compressor recovered Jul 28 14:45Z** and has held since. Helium rose to **81.40%** (+1.45 vs baseline). No quench. Pressure now reads 2.597 PSI (Jul 28 23:45Z) — within the 0.5–5.2 PSI band.

CURRENT — JUL 28 (last readings)

Compressor ON. He pressure 2.597 PSI (23:45Z). Helium 81.40%.

RATES

Pressure +1.599 PSI vs baseline (0.998 → 2.597); peak 3.696. Ramp averaged +0.159 PSI/h. Helium +1.45 points.

DATA NOTES

414 captures · 414 valid pressure · 414 valid helium readings. Charts plot every archived capture. EDU (432 captures): room 59.2–75.2 °F · probes 53.7–65.5 / 55.1–83.8 °F · humidity 36–78%. Host clock ~74 min off vs capture time — times shown use capture time.