| A2 PROSOIL | BOREHOLE NO: BH-1 | |
|---|---|---|
| | LOCATION : Rupganj, Naraynganj. | |
| PROJECT : Telecommunication Tower. | DEPTH OF BORING : 21.0m | R. L.: Road Level. |
| CLIENT : Sheba Telecom (PVT.) Ltd. | DATE OF BORING : 29-09-2007. | G. W. T : 3.65m below from E. G. L. |

| THICKNESS | SOIL STRATA | BORELOG | UNDISTURBED SAMPLE | DISTURBED SAMPLE | DEPTH (m) SPT VALUES ( BLOWS / 300mm ) | Grain Size Distribution, % Clay %, Silt %, Sand % | Max$^{m}$ Penetration |
|---|---|---|---|---|---|---|---|
| 4.0m | Red 2.5YR (4/6), medium plastic, very stiff to medium stiff, silty Clay, CL. | | UD-1, UD-2, UD-3 | D-1, D-2, D-3 | 18, 17, 16 | | |
| 1.0m | Light red 2.5YR (6/8), medium plastic, medium stiff, silty Clay, CL. | | UD-4 | D-4 | 6 | | |
| 4.0m | Reddishyellow 7.5YR (6/8), medium plastic, medium stiff to stiff, silty Clay, CL. | | | D-5, D-6, D-7 | 9, 12, 18 | | |
| 1.5m | Reddish yellow 7.5YR (7/6), medium dense to dense, silty Sand, SM. | | | D-8 | 12 | | |
| 3.0m | Pinkish white 7.5YR (8/2), medium plastic, very stiff, silty Clay, CL. | | | D-9, D-10 | 17, 23 | | |
| 4.5m | Light red 2.5YR (6/8), medium plastic, very stiff, silty Clay, CL. | | | D-11, D-12, D-13 | 26, 28, 25 | | |
| 3.45m | Boring was not possible due to stiff clay. | | | D-14, D-15, D-16 | 27 | | |

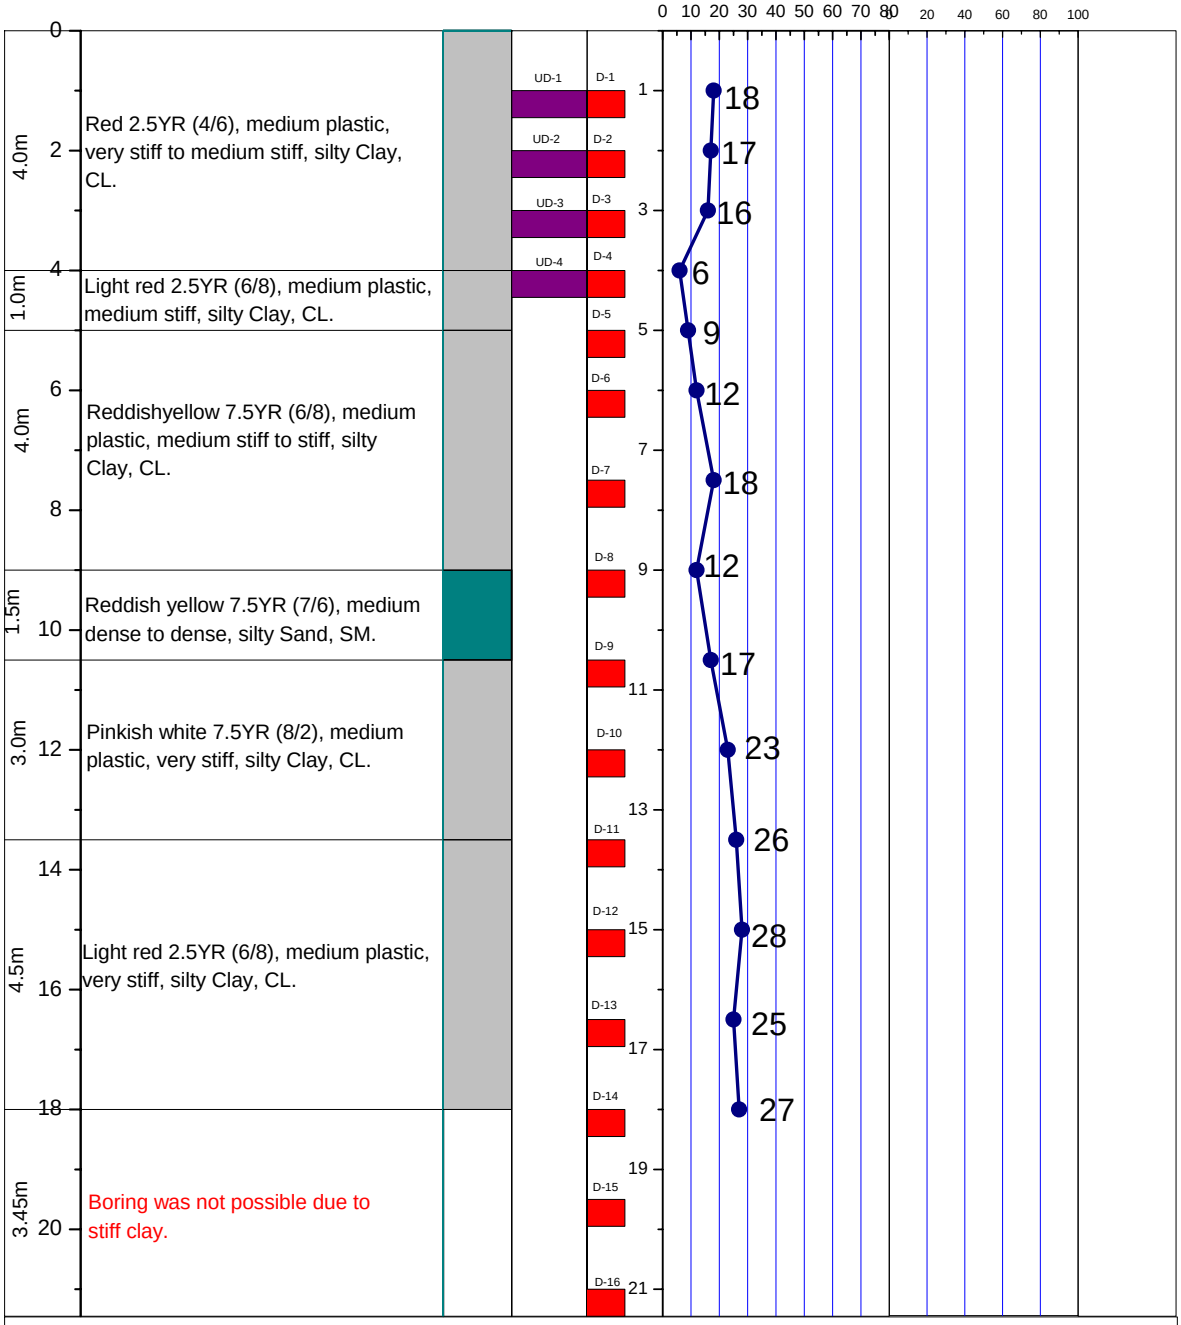


LEGEND FOR BORELOG AND GRAIN SIZE DISTRIBUTION

PLASTIC SILTY CLAY

LOW PLASTIC CLAYEY SILT

NON PLASTIC SILT

SAND

ORGANIC

UNDISTURBED SAMPLE

DISTURBED SAMPLE

SHALE

N- BLOWS DELIVERED PER FOOT BY A 140 LB HAMMER FALLING 30 INCHES

MAX$^{m}$ PENETRATION= 50 BLOWS

AFTER 50 BLOWS PENETRATION DEPTH WERE MEASURED