



الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD.

CR No.2055011643

س.ت ٢٠٥٥٠١١٦٤٣

INSTRUMENT & EQUIPMENT CALIBRATION DIVISION

CERTIFICATE OF CALIBRATION

CERTIFICATE NO: UIC/DAM/92496

This certifies that the instrument below has been tested/calibrated using equipment traceable to National/International Standards or verified by ratio type measurements using self calibrating techniques.

Information on the calibration process and the results are produced below and given in the accompanying sheets of this document.

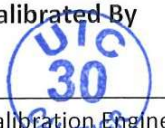
All related traceable documents are on file at **UNIVERSAL INSPECTION CO. LTD.** and may be examined on request

Customer	Sudhir Equipment Rental Company		
Location	Dammam, Kingdom of Saudi Arabia.		
Description	Pressure Relief Valve		
Manufacturer	Atlas Copco		
Part No.	0832100066		
Serial No.	23202678	Receipt Date	21-May-26
ID. No.	SAC-500-094	Calibration Date	21-May-26
Location	Calibration Lab (Dammam)	Calibration Due Date	20-Nov-26

The instrument was calibrated using the following reference, maintained at UIC Instrument & Equipment Calibration division conforming to ISO/IEC 17025:2017 requirements

Reference Standard Equipment Used

Description	Model / Cert. No.	Serial No	Due Date
High Pressure Pneumatic Pressure Source	SA178189-224312	214E2408011	02-Dec-26
Digital Pressure Calibrator	SA178189-224313	2232411017	02-Dec-26

Calibrated By

Calibration Engineer



Approved By

QA/QC Engineer

The measurement results pertain only to the instrument calibrated.

UIC-OP-7.8-24.F02 REV.0

This certificate and the attached measurement results shall not be reproduced except in full without the prior permission

P.O. Box No. 2072, Jubail - 31951, K.S.A.
Tel.: +966 13 344 8882 / Fax: +966 13 344 8881
Tel.: +966 13 367 0515

www.ui.com.sa

ص.ب ٢٠٧٢، الجبيل ٣١٩٥١ - المملكة العربية السعودية
هاتف ٩٦٦ ١٣ ٣٤٤ ٨٨٨٢ / فاكس ٩٦٦ ١٣ ٣٤٤ ٨٨٨١
هاتف ٩٦٦ ١٣ ٣٦٧ ٠٥١٥

CERTIFICATE NO: UIC/DAM/92496

Page

2 of 2

Customer **Sudhir Equipment Rental Company**
Location Dammam, Kingdom of Saudi Arabia.

Description **Pressure Relief Valve**
Manufacturer Atlas Copco
Model 0832100066
Serial No. 23202678
ID. No. SAC-500-094

Calibration Date 21-May-26
Calibration Due Date 20-Nov-26
Temperature Range 23.5°C
Relative Humidity RH 48%

Test Results

Set Pressure : 12.00 BAR Spring Range : N/A
 Back Pressure : 0.00 BAR Size Inlet/ Outlet : 1" x 1½"
 CDP : 12.00 BAR Type of Valve : Metal Seated
 Setting Accuracy : ± 3 % of Setting
 Pop Test : PASSED Test Medium : Air

BASIS OF TEST:

Ref Standard ASME Sec VIII, Div I

Summary of Test Procedure:

The Calibration of above Pressure relief valve is performed through the verification of set pressure and seat tightness using a reference standard pressure gauge or test gauge and a hydrostatic / pneumatic test system.

Traceability:

The reported tests were undertaken using equipment detailed mentioned in Reference Standard Equipment's for which the company maintains Traceability to the third party.

Condition of Instrument

With in the tolerance on receipt(as found) No
 The instrument was adjusted Yes
 The instrument was repaired No

++++ End of the Certificate +++++



Calibrated By: _____
 Calibration Engineer



UIC-QP-7.8-24 F02, REV 0

Approved by: _____
 QA/QC Engineer