

CALIBRATION CERTIFICATE

DETAILS OF CALIBRATION CERTIFICATE

Certificate No	GTEC/AJ/25/NS11830-02	Date of Issue	18.06.2025
Date of Receipt	18.06.2025		
Calibration Date	18.06.2025		
Recommended Calibration Due	17.12.2025		

DETAILS OF CUSTOMER

Customer Name	M/s. Sudhir Equipment Rental Company.
Customer Address	Dammam, Kingdom of Saudi Arabia.

Glory Technology Calibration & Inspection Company (GTEC) certifies that the below described instrument has been calibrated, complying with the National/International Standards. This calibration certificate documents the traceability of the reference standards used and are available upon the request of customer. The calibration results are documented on the succeeding page/pages of this certificate. The customer is obliged to have the instruments calibrated at regular intervals.

DETAILS OF UNIT UNDER CALIBRATION (UUC)

Description	Pressure Relief Valve
Spring Range / Set Pressure	9.5 bar / 9.5 bar
Make / Model	HARSHAD / 9095799400
Serial No / Identification No	2500268 / SAC-250-364
Physical Condition	Satisfactory

DETAILS OF REFERENCE EQUIPMENTS/STANDARDS

Description	Digital Pressure Gauge
Model / Serial No	CPG 1500 / 1A02N5D8M2C
Certificate No / Validity	MTE-CC-J80031077-3 / 29.10.2025
Traceability	MTE / IAS CL-248

DETAILS OF ENVIRONMENTAL CONDITIONS

Temperature	23.4°C	Relative Humidity	42.7%RH
-------------	--------	-------------------	---------

DETAILS OF CALIBRATION PROCEDURE


Reference Procedure / Standard	GTEC/WI/013 / API 527
--------------------------------	-----------------------

Calibrated By



Abhijith V N

Calibration Engineer

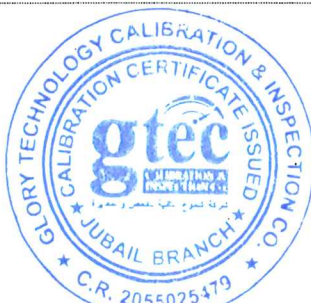

www.gteccalibration.com



Authorized By

C. Balasubramanian

Technical Manager

Page 1 of 2

Certificate No :

GTEC/AJ/25/NS11830-02

CALIBRATION RESULTS

Test Result

Set Pressure	9.5 bar	Test Medium	Water
CDTP	9.5 bar	Valve Inlet Size	3/4"
Start to Leak Pressure	9.5 bar	Valve Outlet Size	--
Seat Leak Test Pressure	8.6 bar	Pressure Setting Tolerance	± 3 %

Physical Inspection Result

Sl. No	Description	Condition	Remarks
1	Valve Body	Good	-
2	Bonnet	Good	-
3	Cap	Good	-
4	Stem	Good	-
5	Adjusting Screw	Good	-
6	Nozzle	Good	-

Note:

1. The UUC was calibrated at Lab.
2. Calibration Certificate shall not be reproduced, except in full, without written approval of GTEC.
3. Results reported are valid at the time and under stated environmental conditions of calibration.
4. This Certificate is relates only to the particular item calibrated.

*****End of Certificate*****

Calibrated By



Abhijith V N

Calibration Engineer



www.gtec Calibration.com



Authorized By

C. Balasubramanian

Technical Manager

Page 2 of 2