



REPORT OF A THOROUGH EXAMINATION

Issue Date: 26-Apr-2026

Certificate Number: ECI/SA/C-00899/26 Rev. No: 00	Report Number: 131011	Sticker Number: 108372
Date of Thorough Examination: 25-Apr-2026	Date of Expiration: 24-Oct-2026	S.O.#: DMM/04-26/001 Ref.#: N/A

Client: SUDHIR EQUIPMENT RENTAL COMPANY	Address of Premises at Which the Examination Was Made: DAMMAM
---	---

Description and Identification of the Equipment:	Load Test Detail	Safe Working Load(s)	Applied Load(s)
Equipment / Type : MOBILE ELEVATING WORK PLATFORM / BOOM SUPPORTED - MANLIFT Location of the Equipment : DAMMAM YARD Equipment ID No : S16AJ-1706 Equipment Serial No : B300027414 Model : 450AJ Manufacturer / Date of Manufacture : JLG / 2024 Applied Standard : SASO-ISO-18893 : 2014 & ANSI/SAIA A92.5 : 2006(2014)	N/A	250 kg	N/A

Examination after installation / In-Services		Was the Examination carried out Within an interval of					
☐ Initial ☒ Periodic Inspection ☐ Re-Inspection after Major Repair / Modification Or Overhaul		☐ 3 Months ☒ 6 Months ☐ 12 Months ☐ After the exceptional circumstances					
Additional Information about the equipment and Information / Description of the Parts / attachments with the equipment. N/A							
Description of the Load Test : N/A							
Pre Load Test NDT done by : N/A		% of Load Applied : N/A		Post Load Test NDT done by : N/A			
Result				PASS	☒	FAIL	
Is the above a defect which is of immediate danger to persons?				YES		NO	☒
Is the above a defect which is not yet but could become a danger to persons?				YES by :		NO	☒
Particulars of any repair, renewal or alteration required to remedy the defect identified above: N/A							
Is this equipment safe to operate?				YES	☒	NO	

Note: We thus attest that the aforementioned equipment has undergone a thorough Visual Inspection and /or Functional Test conducted by a qualified inspector in accordance with Engineering Corner for Inspection (E.C.I.) procedure / local / international standards.

Liability: The client or this assignee or supervisor in interest agrees to identify and hold harmless **Engineering corner for inspection Co.Ltd.** from and against any all claims, demands, lawsuits or actions for damages including legal fees to persons and/or property tangible, intangible or otherwise which may be against, **Engineering corner for inspection Co.Ltd.** incidental to, arising out of or in connection with the work to be done, services to be performed or material to be furnished hereunder except for those claims caused solely and completely by the negligence of **Engineering corner for inspection Co.Ltd.** its directors, others, employees or sub-contractors.

Inspected by: MOHAMED ABDUL BARICK Signature:	Approved & Reviewed By: UMER ALI KHAN 	QR Code:
--	---	----------

	Engineering Corner for Inspection Company Limited INSPECTION CHECKLIST Mobile Elevating Work Platform	Doc. No.	ECIR - LFT - 109
		Rev. No.	02
		Rev. Date	17-FEB-2026
		Page No.	2 of 4

Issue Number : 02 & Issue Date : 03-FEB-2020

Equipment Owner	SUDHIR EQUIPMENT RENTAL COMPANY /	Report No. & Date	131011 25-Apr-2026
Manufacturer / Year	JLG / 2024	Location	DAMMAM YARD
Type / Model	MOBILE ELEVATING WORK PLATFORM / BOOM SUPPORTED - MANLIFT / 450AJ	Equipment ID. No.	S16AJ-1706
Inspection Date	25-Apr-2026	Equipment Sr. No.	B300027414
Inspector Name	MOHAMED ABDUL BARICK	Capacity / SWL	250 kg
Standard	SASO-ISO-18893:2014	Expiration Date	24-Oct-2026


Item No	ITEM NAME	PASS	FAIL	N/A	Item No	ITEM NAME	PASS	FAIL	N/A
DOCUMENTATION & RECORDS					5.1	Wiring harness: No frayed wires, loose connections, or chafing.	☒		
1.1	Previous Inspection report	☒			5.2	Battery: Terminals clean and tight; fluid level correct; no corrosion.	☒		
1.2	Operator's manual (handbook) is present and legible.	☒			5.3	Limit switches and sensors: Present, securely mounted, and appear functional.	☒		
1.3	Maintenance and inspection records are available and up-to-date.	☒			POWER UNIT & DRIVE				
1.4	All decals, warnings, and control markings are in place and legible.	☒			6.1	Engine/Motor: Fluids correct (oil, coolant, fuel).	☒		
1.5	Manufacturer's safety bulletins have been checked and complied with (if applicable).	☒			6.2	Fuel system: No leaks.	☒		
STRUCTURAL INTEGRITY					6.3	Brakes: Function properly (including parking brake).	☒		
2.1	Chassis and frame: No visible cracks, deformation, or damage.	☒			6.4	Steering: Operates smoothly with no excessive play.	☒		
2.2	Extending structure (boom, mast, scissors): No cracks, distortion, or weld damage.	☒			6.5	Wheels and tires: Proper inflation (if pneumatic), no damage.	☒		
2.3	Work platform floor: Clean, no holes, anti-skid surface intact.	☒			6.6	Wheel nuts/fasteners: Torqued properly and present.	☒		
2.4	Guardrail system: Top rail, mid-rail, and toe boards are secure and undamaged.	☒			FUNCTIONAL TEST				
2.5	Entrance gate / chain: Self-closing and self-latching (if so equipped).	☒			7.1	Ground Controls: All functions operate smoothly (lift, lower, extend, rotate).	☒		
2.6	Anchor points (for fall arrest): Present, undamaged, and clearly marked.	☒			7.2	Platform Controls: All functions operate smoothly from platform.	☒		
2.7	Fasteners, pins, and shafts: Secured, no visible wear or distortion.	☒			7.3	Emergency Stop: Functions from both ground and platform.	☒		
STABILIZATION & SUPPORT					7.4	Auxiliary/Manual Descent: Operates correctly and lowers platform.	☒		
3.1	Stabilizers/Outriggers: Deploy smoothly, no visible damage or leaks.	☒			7.5	Drive and steer functions: Operate correctly (test at low and high speed, if applicable).	☒		
3.2	Pad/Foot plates: Present, not worn out, and swivel freely.	☒			7.6	Tilt alarm/indicator: Functions correctly (simulate slope if safe).	☒		
3.3	Locking devices: All pins, latches, or locks function and secure properly.	☒			7.7	Load sensing system (if equipped): No fault codes visible.	☒		
3.4	Oscillating axle: Locking mechanism functions (if applicable).	☒			7.8	Horn and Alarms: Audible and functioning.	☒		
MECHANICAL & HYDRAULIC SYSTEMS					7.9	Pothole protection system (Scissor lifts): Deploys automatically when elevated.	☒		
4.1	Hydraulic hoses and fittings: No leaks, abrasion, kinks, or bubble/swelling.	☒			7.10	Platform overload indicator (if equipped): Functions correctly.	☒		
4.2	Hydraulic oil level: Correct (check sight glass/dipstick).	☒			SPECIFIC SAFETY DEVICES				
4.3	Cylinders: No visible damage, leaks, or rod scoring.	☒			8.1	Lanyard attachment points: Secure and undamaged.	☒		
4.4	Lubrication: All pivot points and moving parts are greased/lubricated.	☒			8.2	Motion alarms / beacon lights: Working (if applicable).	☒		
4.5	Cables and wire ropes: No fraying, broken strands, or corrosion; properly tensioned.	☒			8.3	Insulating boom (if applicable): Inspected per IEC/TS 61813.	☒		
4.6	Chains: Properly tensioned, lubricated, and no visible wear/stretch.	☒			8.4	Communication system (platform to ground): Working (if required).	☒		
ELECTRICAL SYSTEM									

Overall Comments

Inspected By : MOHAMED ABDUL BARICK	Customer Representative : ARIF
-------------------------------------	--------------------------------



Certificate Number: ECI/SA/C-00899/26

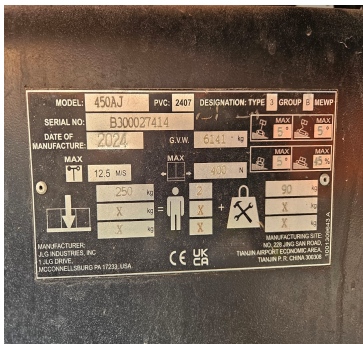



شركة ركن الهندسة للفحص والمعاينة المحدودة

ENGINEERING CORNER FOR INSPECTION CO. LTD.



ENGINEERING CORNER FOR
INSPECTION CO. LTD. (ECI)



ECI. 108372

Capacity : 250 kg

Equipment No. : S16AJ-1706

Serial No. : B300027414

Inspected Date : 25-Apr-2026

Next Inspection : 24-Oct-2026

Inspector : MOHAMED ABDUL BARICK

P.O.Box 235 Rastanura 31941 Kingdom of Saudi Arabia

Tel.: (013) 667-6999 / 667-6895 Fax #:(013) 667-6894

E-mail Address:eci@eccgroupksa.com