

OWNERSHIP CERTIFICATE

To Whom It May Concern

This is to certify that the following equipment listed below is the sole property of Sudhir Equipment Rental Company:

Equipment	Crane
Brand / Make	SANY
Asset ID	SRC-STC-050-031
Model Number	STC500T5
Serial Number	TC2050CE1420
Capacity	50 TON
Type	Sany Truck Crane
Manufacturing Year	2024

This certification is issued to confirm the ownership status of the aforementioned equipment. Sudhir Equipment Rental Company holds full legal ownership rights over the listed equipment and retains all associated benefits and responsibilities. Should there be any queries or requests for verification regarding the ownership of the mentioned equipment, please do not hesitate to contact us at : Info@sudhirrentals.com

Sincerely,

Ajay Koul
General Manager
Sudhir Equipment Rental Company



KINGDOM OF SAUDI ARABIA
MINISTRY OF INTERIOR

رخصة سير
VEHICLES REGISTRATION

المملكة العربية السعودية
وزارة الداخلية

المالك شركة سودهير لتأجير المعدات شركة الشخص الواحد
المستخدم

هوية المالك ٧٠١٦١٥٨٣٣٤ هوية المستخدم

رقم الهيكل LFCNMF5P6P2200320

رقم اللوحة ٢٢٦٩ أ أ ط ٢٢٦٩

نوع التسجيل اشغال عامة

2369 T A A

طراز المركبة كرين

ماركة المركبة سماني

حمولة المركبة ٢

وزن المركبة ٣٩٠٠٠

سنة الصنع ٢٠٢٤

اللون ابيض / أزرق

٥٨٣٤١١٢٠

الرقم التسلسلي





بروج للتأمين التعاوني
Buruj Cooperative Insurance

شهادة التأمين - CERTIFICATE OF INSURANCE

Policy Holder Name	:	Sudhir Equipment Rental Company	:	اسم حامل الوثيقة
Policy Number	:	01/CPM/ 2025/000002	:	رقم الوثيقة
Policy Period	:	05/04/2025 to 04/04/2026	:	فترة الوثيقة
Description of Machinery / Equipment	:	SANY-CRANES-STC500T5	:	وصف المعدة/ال لة
Chassis / Serial No.	:	TC2050CE1420	:	رقم الهيكل/ التسلسلي
Year of Manufacturing	:	2024	:	سنة الصنع
Asset ID No.	:	SRC-STC-050-031	:	رقم ال صل
Location	:	Kingdom of Saudi Arabia.	:	الموقع

BURUJ Cooperative Insurance Company certifies that above client is holding a Machinery/Equipment Insurance Policy for the above-mentioned Equipment in accordance with the above-mentioned Insurance Policy.

With effect from: 05/04/2025 to 04/04/2026

This Certificate has been issued upon Insured's request as per all terms and conditions, exclusions, warranties mentioned in the policy.

تشهد شركة بروج للتأمين التعاوني بأن السادة أعل ه مؤمنين لديها تأمين المكاين/المعدات المذكورة أعل ه وذلك حسب وثيقة التأمين المذكورة أعل ه

والتي يبدأ تاريخ سريانها من ٢٠٢٥/٠٤/٠٥ إلى ٢٠٢٦/٠٤/٠٤

تم إصدار هذه الشهادة بناءً على طلب المؤمن له وذلك حسب الشروط وال استثناءات وال شتراطات المذكورة في الوثيقة.

Important Notices:

1. This Certificate does not pay any fines, penalties, bonds or cautions that may be imposed.
2. Original certificates are only accepted.
3. Due to the importance of correct information being stated in this certificate, kindly examine the document carefully and advise the Company of any difference.
4. In the event of changes in the above information, kindly contact +966-11-2938383

مل حظات هامة:

- ١) ل تطبق هذه الشهادة التأمين على الغرامات والعقوبات المالية بما في ذلك المخالفات أو الضمانات أو الكفالات التي قد تقرر.
- ٢) تقبل الشهادة ال صلية فقط.
- ٣) نظراً ل همية صحة البيانات الخاصة بكم في هذه الشهادة، الرجاء التأكد منها وإشعار الشركة في حالة وجود أي اختل فات.
- ٤) عند الحاجة إلى تعديل البيانات أعل ه يرجى ال اتصال على شركة بروج للتأمين التعاوني ٢٩٣٨٣٨٣-١١-٩٦٦



BURUJ Cooperative Insurance Company

P.O. Box 51855, Riyadh 11553,

National Address 3385, Al Thomamah Road, An-Nada District.

800 124 0201 | burujinsurance.com

Issue Date: 3 April 2025



CERTIFICATE OF TEST AND THOROUGH EXAMINATION OF MOBILE CRANE

Cert. No.: 1809542	Date of Examination: 04/01/2025	Sticker No.: 24-4258 Load test
---------------------------	--	---------------------------------------

Name & address of owner of the equipment		SUDHIR EQUIPMENT RENTAL CO.			
Inspection requested by		SUDHIR EQUIPMENT RENTAL CO.			
Place of inspection		DMM YARD			
Type of inspection		TEST & THOROUGH EXAMINATION			
Relevant regulation / Standard		ASME B30.5			
Date of previous inspection / load test		04/01/2025			
Identification & Description of the Equipment	Manufacturer name	SANY			
	Equipment Type	MOBILE CRANE			
	Nature of power	DEISEL POWERED			
	Model / Year	StC500T5			
	Serial number	TC2050CE1420			
	Owner ID / Registration number	SRC-STC-050-031			
	Rated Capacity (maximum)	50 t			
	Present Configuration	Main hoist current capacity: 50 T with 4 falls Auxiliary hoist current capacity: 5 T with 1			
	Radius (Mini / Max)	Minimum: 3 m; Maximum: 32 m			
	Length of Boom	Minimum: 11.5 m; Maximum: 40.4 m			
	Counterweight (mass)	Standard from Manufacturer			
	Wire rope specification	20 mm			
	Complementary devices	FLY JIB WAS STOWED			

Description of test: -Visual inspection was carried out, followed by full functional testing. -100 % OF SWL LOAD TEST WAS APPLIED Note: "This certificate does not cover the use of the equipment for Personnel/Man riding purposes".	Length of boom (m)	Radius (m)	Reeving (No. of falls)	Test Load	Safe Working Load
	17.7 m	14 m	4 falls	8200 kg	8200 kg
	-	-	-	-	-
	-	-	-	-	-

Result of Examination:

The above mentioned equipment has been found satisfactory at the time of inspection and is considered to be safe for further use, subject to continuous maintenance being applied and qualified operator being employed.

This is to certify that the Competent Person did attend at the said premises on said date to witness proof load test and/or to carry out thorough examination of the equipment described herein and that all particulars described above were correct at the time of examination. This Certificate becomes void in case of any major repair, modification and /or alteration being un-authorized by issuer of hereof.

Next Proof Load Test Due: 03/01/2030 or After Major Repair/Modifications	Next Inspection Due is on or before: 03/04/2025
---	--

Issued at Al Khobar on 06/01/2025

Inspector to Bureau Veritas
Signature:



Name: Mohamed OMARA
Position: Senior Inspector



Reviewed by
Signature:



Name: Abdullah SHEHRI
Position: Operations Manager

The technical conclusions thus expressed may have to be reconsidered in light of any modifications or alterations that would invalidate the data shown in the present certificate. These conclusions would become null & void should Bureau Veritas not be kept informed of such modifications or alterations with specific reference to the present certificate.
Any person not a party to the contract pursuant to which this document is delivered may not assert a claim against Bureau Veritas for any liability arising out of errors or omissions which may be contained in said document, or for errors of judgement, fault or negligence committed by the personnel of the Society or of its Agents in the establishment or issuance of this document, and in connection with any activities for which it may provide.
This not is NOT an indication that the item(s) is (are) fit for any specific purpose and does not release the manufacture, supplier and any party from their respective duty, guarantee, obligation and/or indemnity relating to, without limitation patents, workmanship, materials, safety, performance in operation and/or reliability.



CHECKLIST OF TEST & THOROUGH EXAMINATION OF MOBILE CRANE

Cert. No.: 1809542	Date of Examination: 04/01/2025
---------------------------	--

SECTION	CONDITION	REMARKS
1. ACCESS		
1.1 Access to the cabin/control station	Satisfactory	
1.2 Access for maintenance operation	Satisfactory	
2. CHASSIS		
2.1 Chassis	Satisfactory	
2.2 Traveling device (tire, crawler)	Satisfactory	
2.3 Outriggers	Satisfactory	
2.4 Outrigger sole (shoe or pad)	Satisfactory	
2.5 None return valve on outrigger	Satisfactory	
2.6 Locking of suspensions	Satisfactory	
2.7 Locking of outriggers rest position	Satisfactory	
3. STRUCTURE OF EQUIPMENT		
3.1 Structure, A frame	Satisfactory	
3.2 Jib, fly jib	Satisfactory	STOWED
3.3 Pendants	Not applicable	
3.4 Counter weight	Satisfactory	
4. MECHANISM		
4.1 Main Hoisting mechanism	Satisfactory	
4.2 Aux. Hoisting mechanism	Satisfactory	
4.3 Hydraulic system	Satisfactory	
4.4 Cylinders	Satisfactory	
4.5 Hoisting brake system	Satisfactory	
4.6 Limitation of the lowering speed	Satisfactory	
4.7 Telescoping mechanism	Satisfactory	
4.8 Luffing mechanism	Not applicable	
4.9 Pivoting joints	Satisfactory	
4.10 Brake of slewing motion	Satisfactory	



4.11 Traveling Brake	Satisfactory	
4.12 Guards for moving parts	Satisfactory	
4.13 Motor	Satisfactory	
4.14 Gear box	Satisfactory	
5. LIFTING SYSTEM		
5.1 Wire rope / chain	Satisfactory	
5.2 Wire/chain rope end termination	Satisfactory	
5.3 Drum, pulley, return pulley	Satisfactory	
5.4 Hooks & hook blocks	Satisfactory	
5.5 Other load handling devices	Satisfactory	
6. ENERGY		
6.1 Main switch locking	Satisfactory	
6.2 Equipment and cabling	Satisfactory	
6.3 Protection of live parts/enclosure	Satisfactory	
6.4 Lighting of the crane/site	Satisfactory	
7. CABIN / CONTROL STATION		
7.1 Structure	Satisfactory	
7.2 Visibility / windows	Satisfactory	
7.3 Heating / AC system	Satisfactory	
7.4 Seat	Satisfactory	
7.5 Fire extinguisher	Satisfactory	
7.6 Identification of the controls	Satisfactory	
7.7 Control dead man type	Satisfactory	
7.8 General stopping device by key	Satisfactory	
7.9 Emergency stop button	Satisfactory	
7.10 Level indicator	Satisfactory	
7.11 Angle Indicator	Satisfactory	
7.12 Horn	Satisfactory	
7.13 Traffic lights	Satisfactory	
7.14 Direction Indicators	Satisfactory	
8. SAFETY DEVICES		



BUREAU
VERITAS



8.1 Hoisting limiter/Anti Two Blocks	Satisfactory	
8.2 Luffing limiter	Not applicable	
8.3 Telescopic limiter	Satisfactory	
8.4 Slewing limiter	Satisfactory	
8.5 Load limiter	Satisfactory	
8.6 Level limiter	Satisfactory	
8.7 Rated capacity indicator (RCI) / ASLI	Satisfactory	
8.8 None return valve on piston	Satisfactory	
8.9 Other limiter or indicator	Satisfactory	
9. MISCELLANEOUS REQUIREMENTS		
9.1 Maker plate	Satisfactory	
9.2 Load chart	Satisfactory	
9.3 Wire rope certificate	Satisfactory	
9.4 General Safety Requirements	Satisfactory	
Notes : - Maintain proper housekeeping & preventive maintenance.		
Next Proof Load Test Due: 03/01/2030 or After Major Repair/Modifications		Next Inspection Due is on or before: 03/04/2025

Inspector to Bureau Veritas
Signature:



Name: Mohamed OMARA
Position: Senior Inspector



الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD.

CR No. 2055011643

س. ت ٢٠٥٥٠١١٦٤٣

THOROUGH EXAMINATION CERTIFICATE OF OUT RIGGER PAD

Report No:	DAM-INS-2025-11-10493	Report Issue Date:	27-Nov-2025
Customer Name:	Sudhir Equipment Rental Co.	Inspection Type:	Visual Inspection
Address:	DAMMAM	Serial Number	SDH-ORPD-08
Site Location:	Dammam	Equipment Id Number:	SRC-RT-050-031
Standard Reference:	N/A	Manufacturer:	N/A
Inspection Date:	27-Nov-2025	Equipment Model/Type:	N/A
Next Inspection Date:	26-Nov-2026		

Description	Capacity/SWL	Reason For Examination	Result	Safe To Use
Pad Size Internal Visual Test General Condition	700X700X60 Satisfactory Satisfactory	50 Ton C	Satisfactory	YES

Reason For Exam.	A 3 Months	B 6 Months	C 12 Months	D Written Scheme	E Exceptional Circumstance	F Installation
------------------	---------------	---------------	----------------	---------------------	-------------------------------	-------------------

Result	ACCEPTED	REJECTED (See Attached Defect Report)
--------	----------	--

Declaration:

I hereby declare that the above information is correct and that the equipment has been thoroughly examined as far as possible in accordance with the appropriate provisions/Standards that at the time of the Inspection/examination and found to be free from any defect likely to affect safety other than theses detailed above.

Inspected By:		Approved By:	
Stamp By:		Designation: Inspection Supervisor	

No liability will be considered against UNIVERSAL INSPECTION COMPANY for failure, damage or other occurrence to Client owned or operated equipment due to misuse, improper installations, poor maintenance, weather/environmental conditions & equipment operator/user mistakes or uncontrolled operation & maintenance. This Inspection Certificate/Report shall not be reproduced except in full without the approval UIC and the Client.

 VENDOR ID: 10044577	 APPROVED VENDOR	 VENDOR ID: 11052442	 VENDOR ID: 5014041	 VENDOR ID: 10857
-------------------------	---------------------	-------------------------	------------------------	----------------------

P.O Box no. 2072, Jubail-31951, KSA
Tel.: +966 13 344 8882/Fax.: +966 13 344 8881
Tel.: +966 13 367 0515
Website: www.ui.com.sa



For Verification of This Report Scan Above QR Code:

The PDF document is electronically generated and digitally signed

ص.ب 2072 ، الجبيل 31951 - المملكة العربية السعودية
+ هاتف: 966 13 344 8882 / فاكس: 966 13 344 8881
+ هاتف: 966 13 367 0515
الموقع الإلكتروني: www.ui.com.sa

Doc No. UIC FMT 091-E/Rev No.-00



الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD.

CR No. 2055011643

س.ت ٢٠٥٥٠١١٦٤٣

THOROUGH EXAMINATION CERTIFICATE OF OUT RIGGER PAD

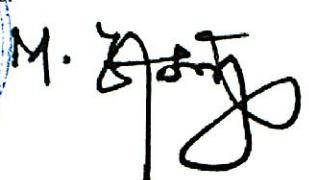
Report No:	DAM-INS-2025-11-10494	Report Issue Date:	27-Nov-2025
Customer Name:	Sudhir Equipment Rental Co.	Inspection Type:	Visual Inspection
Address:	DAMMAM	Serial Number	SDH-ORPD-07
Site Location:	Dammam	Equipment Id Number:	SRC-RT-050-031
Standard Reference:	N/A	Manufacturer:	N/A
Inspection Date:	27-Nov-2025	Equipment Model/Type:	N/A
Next Inspection Date:	26-Nov-2026		

Description		Capacity/SWL	Reason For Examination	Result	Safe To Use
Pad Size	700X700X60	50 Ton	C	Satisfactory	YES
Internal Visual Test	Satisfactory				
General Condition	Satisfactory				

Reason For Exam.	A 3 Months	B 6 Months	C 12 Months	D Written Scheme	E Exceptional Circumstance	F Installation
Result	ACCEPTED				REJECTED (See Attached Defect Report)	

Declaration:

I hereby declare that the above information is correct and that the equipment has been thoroughly examined as far as possible in accordance with the appropriate provisions/Standards that at the time of the Inspection/examination and found to be free from any defect likely to affect safety other than theses detailed above.

Inspected By:		Approved By:	 Signature: M. Khan
Stamp By:		Designation:	

Inspection Supervisor

No liability will be considered against UNIVERSAL INSPECTION COMPANY for failure, damage or other occurrence to Client owned or operated equipment due to misuse, improper installations, poor maintenance, weather/environmental conditions & equipment operator/user mistakes or uncontrolled operation & maintenance. This Inspection Certificate/Report shall not be reproduced except in full without the approval UIC and the Client.

أرامكو السعودية
saudi aramco



The Red Sea
Development
Company

سابك
SABIC



الشركة السعودية للكهرباء
Saudi Electricity Company

MA'ADEN
Saudi Arabian Mining Company

VENDOR ID: 10044577

APPROVED VENDOR

VENDOR ID: 11052442

VENDOR ID: 5014041

VENDOR ID: 10857

P.O Box no. 2072, Jubail-31951, KSA
Tel.: +966 13 344 8882/Fax.: +966 13 344 8881
Tel.: +966 13 367 0515
Website: www.ui.com.sa



For Verification of This Report Scan Above QR Code:

The PDF document is electronically generated and digitally signed

ص.ب 2072 ، الجبيل 31951 - المملكة العربية السعودية
+966 13 344 8882 / فاكس: +966 13 344 8882
+966 13 367 0515 هواتف:
الموقع الإلكتروني: www.ui.com.sa

Doc No. UIC FMT 091-E/Rev No.-00



الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD.

CR No. 2055011643

س.ت. ٢٠٥٥٠١١٦٤٣

THOROUGH EXAMINATION CERTIFICATE OF OUT RIGGER PAD

Report No:	DAM-INS-2025-11-10495	Report Issue Date:	27-Nov-2025
Customer Name:	Sudhir Equipment Rental Co.	Inspection Type:	Visual Inspection
Address:	DAMMAM	Serial Number	SDH-ORPD-09
Site Location:	Dammam	Equipment Id Number:	SRC-RT-050-031
Standard Reference:	N/A	Manufacturer:	N/A
Inspection Date:	27-Nov-2025	Equipment Model/Type:	N/A
Next Inspection Date:	26-Nov-2026		

Description		Capacity/SWL	Reason For Examination	Result	Safe To Use
Pad Size	700X700X60	50 Ton	C	Satisfactory	YES
Internal Visual Test	Satisfactory				
General Condition	Satisfactory				

Reason For Exam.	A 3 Months	B 6 Months	C 12 Months	D Written Scheme	E Exceptional Circumstance	F Installation
Result	ACCEPTED			REJECTED (See Attached Defect Report)		

Declaration:

I hereby declare that the above information is correct and that the equipment has been thoroughly examined as far as possible in accordance with the appropriate provisions/Standards that at the time of the Inspection/examination and found to be free from any defect likely to affect safety other than those detailed above.

Inspected By:		Approved By:	
Stamp By:		JASIM KHAN	
		Designation:	Inspection Supervisor

No liability will be considered against UNIVERSAL INSPECTION COMPANY for failure, damage or other occurrence to Client owned or operated equipment due to misuse, improper installations, poor maintenance, weather/environmental conditions & equipment operator/user mistakes or uncontrolled operation & maintenance. This Inspection Certificate/Report shall not be reproduced except in full without the approval UIC and the Client.



VENDOR ID: 10044577

APPROVED VENDOR

VENDOR ID: 11052442

VENDOR ID: 5014041

VENDOR ID: 10857

P.O Box no. 2072, Jubail-31951, KSA
Tel.: +966 13 344 8882/Fax: +966 13 344 8881
Tel.: +966 13 367 0515
Website: www.ui.com.sa



For Verification of This Report Scan Above QR Code:

The PDF document is electronically generated and digitally signed

ص.ب 2072 ، الجبيل - 31951 - المملكة العربية السعودية
+966 13 344 8882 : هاتف / فاكس : +966 13 344 8881
+966 13 367 0515 : هاتف
الموقع الإلكتروني: www.ui.com.sa

Doc No. UIC FMT 091-E/Rev No.-00



الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD.

CR No. 2055011643

س.ت ٢٠٥٥٠١١٦٤٣

THOROUGH EXAMINATION CERTIFICATE OF OUT RIGGER PAD

Report No:	DAM-INS-2025-11-10496	Report Issue Date:	27-Nov-2025
Customer Name:	Sudhir Equipment Rental Co.	Inspection Type:	Visual Inspection
Address:	DAMMAM	Serial Number	SDH-ORPD-06
Site Location:	Dammam	Equipment Id Number:	SRC-RT-050-031
Standard Reference:	N/A	Manufacturer:	N/A
Inspection Date:	27-Nov-2025	Equipment Model/Type:	N/A
Next Inspection Date:	26-Nov-2026		

Description		Capacity/SWL	Reason For Examination	Result	Safe To Use
Pad Size	700X700X60	50 Ton	C	Satisfactory	YES
Internal Visual Test	Satisfactory				
General Condition	Satisfactory				

Reason For Exam.	A 3 Months	B 6 Months	C 12 Months	D Written Scheme	E Exceptional Circumstance	F Installation
Result	ACCEPTED				REJECTED (See Attached Defect Report)	

Declaration:
I hereby declare that the above information is correct and that the equipment has been thoroughly examined as far as possible in accordance with the appropriate provisions/Standards that at the time of the Inspection/examination and found to be free from any defect likely to affect safety other than theses detailed above.

Inspected By:		Approved By:	
Stamp By:		JASIM KHAN	
		Designation:	Inspection Supervisor

No liability will be considered against UNIVERSAL INSPECTION COMPANY for failure, damage or other occurrence to Client-owned or operated equipment due to misuse, improper installations, poor maintenance, weather/environmental conditions & equipment operator/user mistakes or uncontrolled operation & maintenance. This Inspection Certificate/Report shall not be reproduced except in full without the approval UIC and the Client.



P.O Box no. 2072, Jubail-31951, KSA
Tel.: +966 13 344 8882/Fax.: +966 13 344 8881
Tel.: +966 13 367 0515
Website: www.ui.com.sa



For Verification of This Report Scan Above QR Code:

The PDF document is electronically generated and digitally signed

ص.ب 2072 ، الجبيل 31951 - المملكة العربية السعودية
+966 13 344 8882 / فاكس: +966 13 344 8882
+966 13 367 0515 هواتف
الموقع الإلكتروني: www.ui.com.sa

Doc No. UIC FMT 091-E/Rev No.-00

1764231622611

2025-11-27

7016158334

شركة سودهير لتأجير

الرقم المرجعي :
تاريخ إصدار القائمة :
رقم العميل:
اسم العميل:

عدد المركبات في التقرير 1													
تقرير المركبات													
رقم اللوحة	نوع التسجيل	نوع الهيكل	وضع المركبة	الماركة	الطراز	سنة الصنع	الرقم التسلسلي	رقم الهيكل	اللون الأساسي	تاريخ الملكية	تاريخ انتهاء رخصة السير	حالة التأمين	هوية المستخدم الفعلي
أ أ ط 2369	معدات ثقيلة		صالحة	ساني	كرين	2024	58341120	LFCNMF5P6P2200320	ابيض	1446-02-25	1449-02-25	لا يوجد	اسم المستخدم الفعلي

**ENGINEERING CORNER for INSPECTION**

P.O.Box 235, Rastanura 31941 Kingdom of Saudi Arabia

Tel. No's : (013)667 6999/6676895 Fax#:(013)667 6894

Email: Address: eci@eccgroupksa.com / info@eccgroupksa.com / Website : www.eccgroupksa.com



LIFTING EQUIPMENT INSPECTION REPORT	Area: PKG # 4, FIG, FADHILI		CRM No. N/A	RPO No: N/A	No: 031158	
			Inspection Date: 19-Jan-2026	Inspection Time:10.30 AM	No. 24-5248	Issued by: B.v
Department/Contractor SUDHIR EQUIPMENT RENTAL COMPANY	Equipment No. SRC-STC-050-031		Equipment Location: PKG # 4, FIG, FADHILI	Inspection Result : Pass	New sticker No. 32529	
Manufacturer: SANY	Model: STC500T5	Capacity: 50 t	Type: MOBILE CRANE/TRUCK MOUNTED	Equipment S.No. TC2050CE1420	Sticker Expiration 18-Apr-2026	

Above Equipment was inspected by Engineering Corner for Inspection in accordance with applicable Saudi Aramco Gi's, ASME and ANSI Standards. Deficiencies that require corrective action are listed below. Specific repairs to correct each deficiency Should be Noted in the corrective action taken column.

NO.	DEFICIENCIES	CORRECTIVE ACTION TAKEN
	TRUCK MOUNTED CRANE PERIODIC VISUAL INSPECTION AND FUNCTIONAL TEST PERFORMED PASSED AS PER ARAMCO G.I.7.030 AND ASME B30.5 STANDARD.	
	Note: USED 50 t MAIN HOOK BLOCK WITH 4 PART LINES & 5 t AUX HOOK FITTED AT THE TIME OF INSPECTION.	
	PLATE # 2369 TAA	

USER NAME: Sharyar ahemd

TECHNICAL REVIEWER NAME: ALVARO

Received Date: 19-Jan-2026

SIGNATURE

Reviewed Date: 19-Jan-2026

INSPECTOR NAME: ABDUL KHADER, 80019238

SIGNATURE

BADGE#: 2528217355 TELEPHONE No. 0533677682

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
1.0	GENERAL REQUIREMENTS					
1.1	Equipment documentation is available	ASME B30.5 Sec:5-2.1.5	☒	☐	☐	
1.2	Preventive Maintenance is established and updated records are maintained	ASME B30.5 Sec:5-2.3.1	☒	☐	☐	
1.3	Daily pre-operational inspection checklists are checked	GI 7.030 Para: 5.1.2	☒	☐	☐	
1.4	Vehicle government registration card (ISTIMARA) and Government periodic inspection are maintained and valid at all times for equipment that has a vehicle plate.	GI 7.030 Para: 7.1.2 Note:5	☒	☐	☐	
1.5	Durable load chart is provided in an accessible location	ASME B30.5 Sec: 5-1.1.3 (b)	☒	☐	☐	
1.6	Work areas chart is available	G.1.7.025ASME B30.5 Sec 5-1.1.3(2)	☒	☐	☐	
1.7	Operator is certified (for the inspected crane type/model) and licensed	G.I. 7.025 ASME B30.5 Sec: 5-3.1.1	☒	☐	☐	
1.8	A sign is posted warning the operator not to rely solely on any automatic device as a substitute for safe operating practice	SAES-B067 Sec:4.4	☒	☐	☐	
1.9	Crane is painted safety yellow	SAES-B067 Sec:4.4	☐	☐	☒	
1.10	Crane is painted safety yellow-and-black stripes on offshore facilities	SAES-B067 Sec:4.4	☐	☐	☒	
1.11	Rated capacity of crane is marked (Arabic & English)	SAES-B067 Sec:4.4	☒	☐	☐	
1.12	Fire extinguisher is in place with minimum rating 10 BC	ASME B30.5 Sec: 5-3.4.10	☒	☐	☐	
1.13	Markings and direction of all control levers are clearly displayed	ASME B30.5 Sec:5-1.6.1-1 Sec:5-1.6.1-2	☒	☐	☐	
1.14	Crane backward stability is in accordance with manufacturers standard (minimum radius and no load condition)	ASME B30.5 Sec:5-1.2.1	☒	☐	☐	
2.0	INSPECTION POINTS (MOBILE & CRAWLER CRANES)					
2.1	Load- holding check valve for boom is operational	ASME B30.5 Sec:5-1.3.1 (d)	☒	☐	☐	
2.2	Two (2) full wraps of rope remain on the drum when hook is in the extreme low position	ASME B30.5 Sec:5-1.3.1	☒	☐	☐	
2.3	Swing control is smoothly operating on acceleration and deceleration	ASME B30.5 Sec:5-1.4.1	☒	☐	☐	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
2.4	Swing braking operates, as well as positive locking devices (manual and auto)	ASME B30.5 Sec: 5-1.4.2	☒	☐	☐	
2.5	Travel controls are properly operating/functioning	ASME B30.5 Sec: 5-1.1.3	☒	☐	☐	
2.6	Auxiliary travel controls function correctly for multiple control- station cranes	ASME B30.5 Sec: 5-1.5.1	☐	☐	☒	
2.7	Travel brakes and locks for crawler cranes are correctly operating	ASME B30.5 Sec: 5-1.5.3	☐	☐	☒	
2.8	Travel brakes and locks for wheel-mounted cranes are correctly operating	ASME B30.5 Sec: 5-1.5.3	☒	☐	☐	
2.9	Power plant controls of superstructure -mounted power plant working properly	ASME B30.5 Sec: 5-1.6.3	☐	☐	☒	
2.10	Rotation-resistant and fiber-core ropes are not used for boom hoist reeving	ASME B30.5 Sec: 5-1.7.2	☐	☐	☒	
2.11	Sheave grooves have surface smoothness without any defects	ASME B30.5 Sec: 5-1.7.4	☒	☐	☐	
2.12	Sheave guards are in place on the lower block	ASME B30.5 Sec: 5-1.7.4	☒	☐	☐	
2.13	All sheaves can be lubricated (except permanently lubricated types)	ASME B30.5 Sec: 5-1.7.4 (d)	☒	☐	☐	
2.14	All cab glazings are safety glazing material	ASME B30.5 Sec: 5-1.8.1	☒	☐	☐	
2.15	Verify cab doors functionality and condition	ASME B30.5 Sec: 5-1.8.1	☒	☐	☐	
2.16	Seat belt is fitted and in good condition	ASME B30.5 Sec: 5-1.8.1 (f)	☒	☐	☐	
2.17	Walking platforms and areas of structure are skid-resistance	ASME B30.5 Sec: 5-1.8.2	☒	☐	☐	
2.18	Guard rails are fitted	ASME B30.5 Sec: 5-1.9.7	☐	☐	☒	
2.19	Fixed or telescoping bumper for boom stop is functional (if fitted)	ASME B30.5 Sec: 5-1.9.1	☐	☐	☒	
2.20	Shock absorbing bumper for boom stop is functional (if fitted)	ASME B30.5 Sec: 5-1.9.1	☐	☐	☒	
2.21	Hydraulic boom elevating cylinder, used as boom stop, is functional (if fitted)	ASME B30.5 Sec: 5-1.9.1	☒	☐	☐	
2.22	Boom angle indicator is fitted, operable, and can be read from the operator station	ASME B30.5 Sec: 5-1.9.1	☒	☐	☐	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
2.23	Boom shut-off or hyraulic relief is provided for high angle boom condition	ASME B30.5 Sec: 5-1.9.1 (d)	☒	☐	☐	
2.24	Boom length indicator is fitted for telescoping booms ,and is working	ASME B30.5 Sec: 5-1.9.1	☒	☐	☐	
2.25	Anti-two-blocking devices are fitted and working (main and auxiliary)	ASME B30.5 Sec: 5-3.2.3	☒	☐	☐	
2.26	Operation and accuracy of the fitted Load Indicator, RCI or RCL (compare with load chart)	ASME B30.5 Sec: 5-1.9.10.2	☒	☐	☐	
2.27	LMI is fitted, Operational and accurate for boom length, rated load, angle, radius, etc. (for 3 ton cranes or more)	ASME B30.5 Sec: 5-1.9.10.2	☒	☐	☐	
2.28	Outriggers and jacks are not leaking oil	ASME B30.5 Sec:5-2.1.3	☒	☐	☐	
2.29	Jack is in good operating condition at each outrigger	ASME B30.5 Sec:5-2.1.3 (d)	☒	☐	☐	
2.30	Each outrigger jack locking device is functional (if fitted)	ASME B30.5 Sec: 5-1.9.3 (c)	☒	☐	☐	
2.31	No leakage from each jack seal when the crane is jacked up	ASME B30.5 Sec: 5-1.9.3 (c)	☒	☐	☐	
2.32	Outrigger jack bolts are fully secure	ASME B30.5 Sec: 5-1.9.3 (b)	☒	☐	☐	
2.33	All road wheel nuts are fully secure	ASME B30.5 Sec: 5-2.1.3(b)	☒	☐	☐	
2.34	All tyres are serviceable and without damage or excess wear	ASME B30.5 Sec: 5-2.1.3(k)	☒	☐	☐	
2.35	Fuel tank supports and straps are secure	ASME B30.5 Sec: 5-2.1.3(g)	☒	☐	☐	
2.36	Hydraulic oil tank supports and straps are secure	ASME B30.5 Sec: 5-2.1.3(g)	☒	☐	☐	
2.37	Underside of chassis shows no obvious faults	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.38	Outrigger boxes are not cracked	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.39	Front and rear steering cylinder anchor points and pins are secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.40	Track rod end joints are not worn and are secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.41	Axle bolts and nuts are fully secure	ASME B30.5 Sec: 5-2.1.	☒	☐	☐	
2.42	Wheel hub oil seals are not leaking	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
2.43	Brake linings are not oil contaminated	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.44	Brake hoses have not deteriorated, e.g. cracks, splits, leaks, etc.	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.45	All chassis cross members are not cracked or corroded	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.46	Transmission mounting bolts and bushings are secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.47	All drive shaft bolts and universal joints are not worn	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.48	Ring gear bolts are fully secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.49	All hydraulic hoses under chassis have not deteriorated (cracks , splits , leaks)	ASME B30.5 Sec: 5-2.1.2	☒	☐	☐	
2.50	Engine shows no major oil leakage	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.51	Radiator does not leak water	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.52	Rope is free of kinking,crushing,birdcaging,or any other damage resulting in distortion of the rope structure .No more 1 broken wire protruding from the core .There are no reductions from nominal rope diameter of more than 5% for running ropes: .No more than 6 randomly broken wires in 1 lay or 3 broken wires in 1 for strand of 1 lay rotation resistance ropes .No more then 2randomly distributed broken wires in six rope diameters or 4 randomly distributed broken wires in 30 rope diameters .Evidence of any heat damage from any cause.	ASME B30.5 Sec: 5-2.4.3	☒	☐	☐	
2.53	Main hoist drum mounting bolts are secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.54	Rear telescope side and top wear pads are serviceable	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.55	Bottom and side wear pads of telescope sections are serviceable	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.56	Boom heel pin bushes are not worn (rock boom up and down to check this)	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.57	Center swivel coupling pipes and hoses do not leak	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.58	Center swivel coupling bolts are all secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
2.59	Boom lift cylinder anchor bolts and bushings are secure	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.60	Swing gearbox bottom oil seal and drive gear are in a serviceable condition (Should be well lubricated)	ASME B30.5 Sec: 5-2.1.3	☒	☐	☐	
2.61	Wire rope clips shall be drop-forged steel of the single saddle U bolt or doubled saddle type clip for end termination.	ASME B30.5 Sec: 5-1.7.3(b)	☒	☐	☐	
2.62	Emergency switch / Power take off switch need to be verified	ASME B30.5 Sec: 5-1.6.1(e)	☒	☐	☐	
3	CRANE CAB					
3.1	Horn and wind speed anemometer are working	ASME B30.5 Sec: 5-3.2.1.6	☒	☐	☐	
3.2	Crane level indicator is fitted and working	ASME B30.5 Sec: 5-1.9.10.6	☒	☐	☐	
3.3	Engine gauges and associated indicators are working	ASME B30.5 Sec: 5-2.1.3 (g)	☒	☐	☐	
3.4	The warning sign stating power line required clearances is visible to the operator	ASME B30.5 Sec: 5-1.9.12(g)	☒	☐	☐	
3.5	Load block sheaves turn freely and are undamaged	ASME B30.5 Sec: 5-2.1.3 (c)	☒	☐	☐	
3.6	Dead end rope anchor is correctly made with a suitable wedge socket and loop- back termination	ASME B30.5 Sec: 5-1.7.3 (d)	☒	☐	☐	
3.7	Hook assemblies are equipped with safety latches	ASME B30.5 Sec: 5-1.7.6	☒	☐	☐	
3.8	Hook assembly labeling and manufacturer data is clearly marked	ASME B30.10 Sec : 10-1.8	☒	☐	☐	
3.9	Hooks weight is clearly marked/printed on the hook	ASME B30.10 Sec: 10-1.10.5 (b)	☒	☐	☐	
3.10	Safe working load of hook is clearly marked on the item	ASME B30.10 Sec : 10-1.8	☒	☐	☐	
3.11	Hook does not show defects such as nicks, cracks and gouges	ASME B30.10 Sec : 10-1.10.5 (d)	☒	☐	☐	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
3.12	Hook is not bent or twisted. Max. bending or twisting not to exceed 10 degrees from plane of unbent hook or as per manufacturer recommendations.	ASME B30.10 Sec : 10-1.10.5 (f)	☒	☐	☐	
3.13	Hook is not distorted in the throat opening. .Max allowable throat opening is 5% not to exceed 1/4 in.(6mm) compared to new hook,or as per manufacturer recommendations	ASME B30.10 Sec : 10-1.10.5 (g)	☒	☐	☐	
3.14	Maximum wear in the hook bowl is not exceeding 10% (compared to new hook) or as per manufacturer recommendations	ASME B30.10 Sec : 10-1.10.5 (e)	☒	☐	☐	
3.15	Hook is not cracked, gouged or shows nicks	ASME B30.10 Sec : 10-1.10.5 (d)	☒	☐	☐	
3.16	Hook can lock (if it is a self-locking hook)	ASME B30.10 Sec : 10-1.10.5 (h)	☐	☐	☒	
3.17	Inoperative latch (if provided) $\frac{1}{2}$ any damaged latch or malfunctioning latch that does not close the hooks throat	ASME B30.10 Sec : 10-1.10.5 (i)	☒	☐	☐	
3.18	Rope guards and locked in position with pins (hook block)	ASME B30.5 Sec:5-1.7.4	☒	☐	☐	
3.19	Dead end rope anchor is fitted with a lock pin (hook block)	ASME B30.5 Figure 5-1.7.3-1	☒	☐	☐	
3.20	Dead end rope anchor is correctly made with a suitable wedge socket and loopback termination	ASME B30.5 Figure 5-1.7.3-1	☒	☐	☐	
3.21	Reverse travel alarm is operational.	General	☒	☐	☐	
3.22	Turning signals and indicators are working correctly	General	☒	☐	☐	
3.23	Road lighting, including spotlights, are in good condition and operable	General	☒	☐	☐	
3.24	Dry friction brakes and clutches shall be protected against rain and other liquids such as oil and lubricants	ASME B30.5 Sec 5-1.9.8	☒	☐	☐	
4.0	CRAWLER CRANE					
4.1	Track pads are undamaged	ASME B30.5 Sec: 5-2.1.3 (h)	☐	☐	☒	
4.2	Drive sockets and tumblers are serviceable	ASME B30.5 Sec: 5-2.1.3 (h)	☐	☐	☒	
4.3	Top and bottom swing rollers and tracks are in good overall condition (Should be well lubricated)	ASME B30.5 Sec: 5-2.1.3 (a)	☐	☐	☒	
4.4	Track idlers are serviceable	ASME B30.5 Sec: 5-2.1.3 (a)	☐	☐	☒	

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES				
PROJECT TITLE		WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED		SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY		FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY	

ITEM. NO	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	Remarks
4.4	Track idlers are serviceable	ASME B30.5 Sec: 5-2.1.3 (a)	☐	☐	☒	
4.5	Back boom stops are functioning	ASME B30.5 Sec: 5-1.9.1 (a)	☐	☐	☒	
4.6	Back A-Frame is in good condition	ASME B30.5 Sec: 5-2.1.3 (a)	☐	☐	☒	
4.7	Boom cut-out (at maximum angle) is operable	ASME B30.5 Sec: 5-1.9.1 (a-2)	☐	☐	☒	
4.8	Power low lowering is operational	ASME B30.5 Sec: 5-1.9.1 (a-2)	☐	☐	☒	
4.9	Boom hoist safety auxiliary ratchet / pawl lock is engaging	ASME B30.5 Sec: 5-1.3.1(c)	☐	☐	☒	
4.10	Boom chords and lacings are undamaged (bent)	ASME B30.5 Sec: 5-2.1.3	☐	☐	☒	
4.11	Sheave grooves are free from surface defects that could cause rope damage.	ASME B30.5 Sec: 5-1.7.4 (a)	☐	☐	☒	
4.12	Pendant ropes are showing no broken wires (see no. 48)	ASME B30.5 Sec: 5-2.4.2	☐	☐	☒	
4.13	Operation of steering brakes is satisfactory	ASME B30.5 Sec: 5-1.5.3	☐	☐	☒	
4.14	Main machinery guarding is in place	ASME B30.5 Sec: 5-1.6.4	☐	☐	☒	
4.15	Main clutch is fully operational	ASME B30.5 Sec: 5-1.6.4	☐	☐	☒	
4.16	Main boom and hoist drum brakes are fully functional	ASME B30.5 Sec: 5-1.3.2(a-1)	☐	☐	☒	

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER SAIC-U-7007	ISSUE DATE 1-Jan-23	DISCIPLINE ELEVATING/LIFTING EQUIPMENT
MOBILE / CRAWLER CRANES			
PROJECT TITLE	WBS/BI/JO NUMBER 52	INSPECTION COMPANY ECI	

EQUIPMENT ID NUMBER SRC-STC-050-031	EQUIPMENT DESCRIPTION/TYPE TRUCK MOUNTED	SERIAL NO TC2050CE1420	REPORT No 031158
CAPACITY (SWL) 50 t	MANUFACTURER SANY	FACILITY / LOCATION PKG # 4, FIG, FADHILI	
REQUESTED INSPECTION DATE 19-Jan-2026	RFI No	TASK COMPLETED DATE 19-Jan-2026	EQUIPMENT OWNER SUDHIR EQUIPMENT RENTAL COMPANY

Remarks:	
Reference Documents 1- ASME B30.5 - 2021 Issue: Mobile & Locomotive Cranes 2- ASME B30.10 - 2019 Issue: Hooks 3- SAES-B067 - 2020 Issue: Safety Identification and Safety Colors 4- SA GI 7.025-2018 Issue: Heavy Equipment Operator and Rigger Testing and Certification	
Load Tested By (if Applicable): Name, Signature, & Date:	
Inspected Witnessed by 3rd Party Certified Inspector: Name, Signature, Certificate No. & Company: ABDUL KHADER, 80019238	
User Representative: Name, Signature, & Date: Sharyar ahemd & 19-Jan-2026	



Engineering Corner for Inspection Co. Ltd. (ECI)

P.O.Box 235 Rastanura 31941 Kingdom of Saudi Arabia

Tel.:(013)667-6999 / 667-6895 - Fax:(013)667-6894

E-mail: eci@eccgroupksa.com

No. **ECI - 32529**

EQUIP.S.N.: TC2050CE1420

EQUIP. NO.: SRC-STC-050-031

EQUIP SWL: 50 t

INSPECTION DATE : 19-Jan-2026

NEXT INSPECTION DATE : 18-Apr-2026

INSPECTOR NAME : ABDUL KHADER

SAP# : 80019238

"S.A. INSPECTION DEPARTMENT APPROVED CONTRACTOR AGENCY"

	ENGINEERING CORNER for INSPECTION		Doc. No.	ECIR- LFT - 105
			Rev. No	01
	CUSTOMER FEEDBACK FORM - LFT & ELEV		Rev. Date	1 NOV 2025
			Page No.	1 of 1

Issue Number : 02 & Issue Date : 03 FEB 2020

Feedback Form Number: 031158

Customer Details:

Client Name	SUDHIR EQUIPMENT RENTAL COMPANY	Contact Person Name	Sharyar ahemd
Client Address	PKG # 4, FIG, FADHILI	Department	2528217355
Email ID	logistics@sudhirrentals.com	Contact Number	0533677682
Inspection Date	19/01/2026	Inspector Name	ABDUL KHADER

Dear Sir/Madam,

We request you to kindly put a 'TICK' mark in the respective boxes against each aspect described below and to assess your feedback with respect to the service we have provided so far. Any other suggestion or remarks please indicate the same to improve further. Thank you for taking your time for giving your valuable feedback to us.

Description	Yes	No	Remarks
Did the Service provider Co. provide the right inspector with a valid qualification card?	☒		
Did the Service provider Co. respond for inspection within the expected time frame?	☒		
Was the inspector wearing the required personal protective equipment (PPE) during the inspection?	☒		
Did the inspection conducted safely and in accordance with Aramco's standards?	☒		
How satisfied are you with the overall service provided? * * * * *			
Would you consider using this Service Provider again for future inspections? * * * * *			
For any enquiry or concern, please contact: Inspection Dept. - ISSD Crane Inspection Unit (CIU)			

Any suggestions for improvement or additional services required?	Feedback given by (Customer Representative)
	