

OWNERSHIP CERTIFICATE

To Whom It May Concern

This is to certify that the following equipment listed below is the sole property of Sudhir Equipment Rental Company:

Equipment	Crane
Brand / Make	SANY
Asset ID	SRC-STC-080-027
Model Number	STC800T5
Serial Number	TC2080CD0508
Capacity	80 TON
Type	Sany Truck Crane
Manufacturing Year	2022

This certification is issued to confirm the ownership status of the aforementioned equipment. Sudhir Equipment Rental Company holds full legal ownership rights over the listed equipment and retains all associated benefits and responsibilities. Should there be any queries or requests for verification regarding the ownership of the mentioned equipment, please do not hesitate to contact us at : Info@sudhirrentals.com

Sincerely,

Ajay Koul
General Manager
Sudhir Equipment Rental Company



بهذا نشهد بأننا أصدرنا وثيقة تأمين للمركبة الموصوف ببياناتها أدناه بموجب أحكام وشروط
تأمين المسؤولية المدنية تجاه الغير في المملكة العربية السعودية

This is to certify we issued a motor policy of below referred vehicle in
accordance with terms and conditions of Third Party Liability in Kingdom of
Saudi Arabia

Product ID A-GIGR-1-C-13-002

CERTIFICATE OF MOTOR VEHICLE

INSURANCE NO : 5/VX/31062/0/0

INSURED NAME : SUDHIR EQUIPMENT RENTAL COMPANY

MOTOR VEHICLE DETAILS :

- Registration No : AAT 2042
- Chassis No : LFCNPG6P2P3200063
- Make : Sany CRANE
- Year : 2023
- Custom Card ID :

PERIOD OF INSURANCE :

- Commencement date : 12/06/1447 (H)
- Expiry date : 16/05/1448 (H)
- Corresponding to : From 03/12/2025 To 28/10/2026

Subject always to the Limits of Liability of 10,000,000 S.R. as
provided in the Policy arising out of the use of the insured Motor
Vehicle within Saudi Arabia .

This Certificate is deemed to be a guarantee for payment for all
amounts which the Insured Owner and/or the Authorized Driver at
the time of the accident shall become legally liable to pay as
compensation for

- (a) Death or bodily injury sustained by any person including
passengers of the vehicle
- (b) Damage to third party property outside the Insured Vehicle

شهادة تأمين السيارة رقم :

5/VX/31062/0/0

إسم المؤمن له : شركة سودهير لتأجير المعدات

تفاصيل السيارة :

رقم اللوحة : ط ١١ 2042

رقم الهيكل : LFCNPG6P2P3200063

نوع السيارة : CRANE <SANY>

الموديل : 2023

رقم البطاقة الجمركية :

مدة التأمين :

تاريخ الإبتداء : 12/06/1447 هجرية

وينتهي في : 16/05/1448 هجرية

12/06/1447 (H) 16/05/1448 (H)

وذلك ضمن حدود المسؤولية 10,000,000 رس المبينة في الوثيقة والناجمة
لإستخدام السيارة المؤمنة داخل المملكة العربية السعودية

وتعتبر هذه الشهادة كضمان لدفع كافة المبالغ التي يكون الملك المؤمن له أو
السائق المخول في وقت الحادث مسؤولين قانونا عن دفعها كتعويض عن

1. الوفاة أو الإصابة البدنية التي تحدث لأي شخص بما في ذلك ركاب
السيارة
2. تلف ممتلكات أي طرف ثالث خارج المركبة المؤمنة

التوقيع :



IMPORTANT

1. This certificate of Insurance and Policy is valid only for the
Insured Owner and the authorized Driver at the time of
Accident and is NOT transferable without prior consent
of the Insurance Company.
2. Any Accident must be notified to the Insurance
Company as soon as possible by visiting our website
<https://www.gig.sa/ar/claim-form>
or by contacting us on 920008477 or visiting our outlets

ملاحظات هامة

1. إن شهادة التأمين هذه صالحة فقط للمالك المؤمن له والسائق المخول له
بالقيادة في حالة وقوع حادث وهي غير قابلة للتحويل بدون موافقة
مسبقة من قبل شركة التأمين
2. عند وقوع أي حادث يجب إخطار الشركة في أسرع وقت ممكن
من خلال زيارة موقعنا الإلكتروني:
<https://www.gig.sa/ar/claim-form>
أو بالإتصال على الرقم 920008477 أو بزيارة أحد منافذنا

KINGDOM OF SAUDI ARABIA
MINISTRY OF INTERIOR

رخصة سيار
VEHICLES REGISTRATION

المملكة العربية السعودية
وزارة الداخلية

المالك شركة مودهير لتأجير المعدات شركة الشخص الواحد
المستخدم

هوية المالك ٧٠١٦١٥٨٢٣٤ هوية المستخدم

رقم الهيكل LFCNPG6P2P3200063

رقم اللوحة ٢٠٤٢ ط أ أ

نوع التسجيل اشغال عامة 2042 T A A

طراز المركبة كرين ماركة المركبة ساني

حمولة المركبة ١ وزن المركبة ٤٥٨٧٠

سنة الصنع ٢٠٢٢ اللون اصفر

الرقم التسلسلي ٩١٣٣٩٩٠٧٢١١



BUREAU
VERITAS



CERTIFICATE OF TEST AND THOROUGH EXAMINATION OF MOBILE CRANE

Cert. No.: 1788737		Date of Examination: 30/11/2024		Sticker No.: 01-66891		
Name & address of owner of the equipment		SUDHIR EQUIPMENT RENTAL CO.				
Inspection requested by		SUDHIR EQUIPMENT RENTAL CO.				
Place of inspection		DMM YARD				
Type of inspection		TEST & THOROUGH EXAMINATION				
Relevant regulation / Standard		ASME B30.5				
Date of previous inspection / load test		16/11/2024				
Identification & Description of the Equipment	Manufacturer name	SANY				
	Equipment Type	MOBILE CRANE				
	Nature of power	DEISEL POWERED				
	Model / Year	SYM5453JQZ (STC800T5)				
	Serial number	TC2080CD0508				
	Owner ID / Registration number	SRC-STC-080-027				
	Rated Capacity (maximum)	80 t				
	Present Configuration	Main hoist current capacity: 80 t with 4 FALLS Auxiliary hoist current capacity: 6.5 T with 1				
	Radius (Mini / Max)	Minimum: 2.7 m; Maximum: 44 m				
	Length of Boom	Minimum: 12.7 m; Maximum: 49.5 m				
	Counterweight (mass)	Standard from Manufacturer				
Wire rope specification	20 mm					
Complementary devices	FLY JIB WAS STOWED					
Description of test: -Visual inspection was carried out, followed by full functional testing. -100 % OF SWL LOAD TEST WAS APPLIED Note: "This certificate does not cover the use of the equipment for Personnel/Man riding purposes".		Length of boom (m)	Radius (m)	Reeving (No. of falls)	Test Load	Safe Working Load
		33.4 M	18m	6 falls	6100 KG	6100 KG
		-	-	-	-	-
		-	-	-	-	-
Result of Examination: The above mentioned equipment has been found satisfactory at the time of inspection and is considered to be safe for further use, subject to continuous maintenance being applied and qualified operator being employed. This is to certify that the Competent Person did attend at the said premises on said date to witness proof load test and/or to carry out thorough examination of the equipment described herein and that all particulars described above were correct at the time of examination. This Certificate becomes void in case of any major repair, modification and / or alteration being un-authorized by issuer of hereof.						
Next Proof Load Test Due: 29/11/2029 or After Major Repair/Modifications				Next Inspection Due is on or before: 29/11/2025		

Issued at Al Khobar on 01/12/2024

Inspector to Bureau Veritas
Signature:

Name: Mohamed OMARA
Position: Senior Inspector



Reviewed by
Signature:

Name: Abdullah SHEHRI
Position: Operations Manager

The technical conclusions thus expressed may have to be reconsidered in light of any modifications or alterations that would invalidate the data shown in the present certificate. These conclusions would become null & void should Bureau Veritas not be kept informed of such modifications or alterations with specific reference to the present certificate.
Any person not a party to the contract pursuant to which this document is delivered may not assert a claim against Bureau Veritas for any liability arising out of errors or omissions which may be contained in said document, or for errors of judgement, fault or negligence committed by the personnel of the Society or of its Agents in the establishment or issuance of this document, and in connection with any activities for which it may provide.
This is NOT an indication that the item(s) is (are) fit for any specific purpose and does not release the manufacturer, supplier and any party from their respective duty, guarantee, obligation and/or indemnity relating to, without limitation patents, workmanship, materials, safety, performance in operation and/or reliability.



CHECKLIST OF TEST & THOROUGH EXAMINATION OF MOBILE CRANE

Cert. No.: 1788737	Date of Examination: 30/11/2024
--------------------	---------------------------------

SECTION	CONDITION	REMARKS
1. ACCESS		
1.1 Access to the cabin/control station	Satisfactory	
1.2 Access for maintenance operation	Satisfactory	
2. CHASSIS		
2.1 Chassis	Satisfactory	
2.2 Traveling device (tire, crawler)	Satisfactory	
2.3 Outriggers	Satisfactory	
2.4 Outrigger sole (shoe or pad)	Satisfactory	
2.5 None return valve on outrigger	Satisfactory	
2.6 Locking of suspensions	Satisfactory	
2.7 Locking of outriggers rest position	Satisfactory	
3. STRUCTURE OF EQUIPMENT		
3.1 Structure, A frame	Satisfactory	
3.2 Jib, fly jib	Satisfactory	STOWED
3.3 Pendants	Not applicable	
3.4 Counter weight	Satisfactory	
4. MECHANISM		
4.1 Main Hoisting mechanism	Satisfactory	
4.2 Aux. Hoisting mechanism	Satisfactory	
4.3 Hydraulic system	Satisfactory	
4.4 Cylinders	Satisfactory	
4.5 Hoisting brake system	Satisfactory	
4.6 Limitation of the lowering speed	Satisfactory	
4.7 Telescoping mechanism	Satisfactory	
4.8 Luffing mechanism	Not applicable	
4.9 Pivoting joints	Satisfactory	
4.10 Brake of slewing motion	Satisfactory	



**BUREAU
VERITAS**



4.11 Traveling Brake	Satisfactory	
4.12 Guards for moving parts	Satisfactory	
4.13 Motor	Satisfactory	
4.14 Gear box	Satisfactory	
5. LIFTING SYSTEM		
5.1 Wire rope / chain	Satisfactory	
5.2 Wire/chain rope end termination	Satisfactory	
5.3 Drum, pulley, return pulley	Satisfactory	
5.4 Hooks & hook blocks	Satisfactory	
5.5 Other load handling devices	Satisfactory	
6. ENERGY		
6.1 Main switch locking	Satisfactory	
6.2 Equipment and cabling	Satisfactory	
6.3 Protection of live parts/enclosure	Satisfactory	
6.4 Lighting of the crane/site	Satisfactory	
7. CABIN / CONTROL STATION		
7.1 Structure	Satisfactory	
7.2 Visibility / windows	Satisfactory	
7.3 Heating / AC system	Satisfactory	
7.4 Seat	Satisfactory	
7.5 Fire extinguisher	Satisfactory	
7.6 Identification of the controls	Satisfactory	
7.7 Control dead man type	Satisfactory	
7.8 General stopping device by key	Satisfactory	
7.9 Emergency stop button	Satisfactory	
7.10 Level indicator	Satisfactory	
7.11 Angle Indicator	Satisfactory	
7.12 Horn	Satisfactory	
7.13 Traffic lights	Satisfactory	
7.14 Direction Indicators	Satisfactory	
8. SAFETY DEVICES		

Bureau Veritas, PO Box 20189, Al-Khobar 31952, Saudi Arabia Tel: +966 (13) 882 1071 – Fax: +966 (13) 882 1072 - The liabilities are as per Bureau Veritas General Conditions of Service.

Form No.: KSA-IVS-CK-015
148-2024-051807-EN



BUREAU
VERITAS



8.1 Hoisting limiter/Anti Two Blocks	Satisfactory	
8.2 Luffing limiter	Not applicable	
8.3 Telescopic limiter	Satisfactory	
8.4 Slewing limiter	Satisfactory	
8.5 Load limiter	Satisfactory	
8.6 Level limiter	Satisfactory	
8.7 Rated capacity indicator (RCI) / ASLI	Satisfactory	
8.8 None return valve on piston	Satisfactory	
8.9 Other limiter or indicator	Satisfactory	

9. MISCELLANEOUS REQUIREMENTS

9.1 Maker plate	Satisfactory	
9.2 Load chart	Satisfactory	
9.3 Wire rope certificate	Satisfactory	
9.4 General Safety Requirements	Satisfactory	

Notes : - Maintain proper housekeeping & preventive maintenance.

Next Proof Load Test Due: 29/11/2029 or After Major Repair/Modifications

Next Inspection Due is on or before: 29/11/2025

Inspector to Bureau Veritas

Signature:

OMARA



Name: Mohamed OMARA
Position: Senior Inspector

① إرسال طلب تحديث مركبة

رقم هوية المالك	7016158334	تاريخ بداية الملكية					
تاريخ اصدار رخصة السير	1446-01-08	تاريخ إنتهاء رخصة السير	1449-01-08				
رقم الفرع		اسم الفرع					
رقم هوية المستخدم الفعلي		اسم المستخدم الفعلي					
نوع تسجيل اللوحة	معدات ثقيلة	معلومات اللوحة	<table><tr><td>الط</td><td>٢٠٤٢</td></tr><tr><td>TAA</td><td>2042</td></tr></table>	الط	٢٠٤٢	TAA	2042
الط	٢٠٤٢						
TAA	2042						
الرقم التسلسلي	633999020	صانع المركبة	سائي				
طراز المركبة	كرين	لون المركبة	اصفر				
الحمولة	1	الوزن	45870				
سنة الصنع	2023	حالة التحقق	غير متحفظ				
رقم الهيكل	LFCNPG6P2P3200063	وضع المركبة	صالحة				
حالة الفحص الدوري	لا يوجد	تاريخ انتهاء الفحص الدوري بالهجري					
حالة التأمين	ساري المفعول	تاريخ إنتهاء التأمين	2025-11-14				
تاريخ بدء المستخدم الفعلي							

		الشركة العالمية لخدمات التفتيش المحدودة UNIVERSAL INSPECTION CO. LTD. NDT DIVISION Business Executive Centre, P.O.Box # 2072, Jubail -31951, Kingdom of Saudi Arabia. Tel. : 00966 3 344 8882 / Fax :00966 3 344 8881 / Email : info@ui.com.sa / Website : www.ui.com.sa				
MAGNETIC PARTICLE EXAMINATION REPORT						
Report NO.:	INSPECTION DATE:	NEXT INSPECTION DATE	Page 1 of 2			
MT- JUB-0815	12/07/2025	11/07/2026				
Client: SUDHIR RENTAL		Location: RASTANURA				
Reference Code: AWS D1.1		Procedure No. with Rev.: ASTM E -709				
Surface Temperature: 39°C	Surface Condition: SMOOTH	UV Light Intensity: N/A	White Light Intensity:>100FC			
INSPECTION MEDIUM MAKE						
Particle Mfg.	Particle P/N.	Batch No.	Color.			
MR CHEMIE	MR76S	2410006	BLACK			
White Paint Mfg.:	White Paint P/N:	Batch No.				
MR CHEMIE	MR72	2502037				
METHOD DESCRIPTION						
Visible Method ☒	Dry ☐	Magnetic Current Used				
Fluorescent Method ☐	Wet ☒	Magnetic Field Direction				
	AC ☐ DC ☐ PER. ☒	Circular ☐ Longitudinal ☒				
		Demagnetization				
		Yes ☒ No ☐ Amp.:				
MPI EQUIPMENT DETAILS						
Yoke Mfg.:	PARKER	Due Date of Yoke:	2-Oct-25			
Model:	PM-50	Due Date of Lux meter	24-Mar-26			
Sr.No:	5872	Due Date of UV light	N/A			
		Portable ☒	Prod ☐			
		Mobile ☐	Coil ☐			
		Stationary ☐	Yoke ☒			
		Clamps ☐	Leeches ☐			
		C.C ☐				
FIELD OF APPLICATION						
Piping ☐	Raw Material ☐	Bevel ☐	1st Pass ☐			
Tank/Silos ☐	Equipment ☒	Before PWHT ☐	After PWHT ☐			
Final Pass ☐						
After Hydro ☐						
Piece Description:						
CRANE ID: SRC-STC-080-027						
INSPECTION PART: MAIN HOOK & AUXILLARY HOOK						
CRANE ID	QTY.	DESCRIPTION	Exam Result		Remarks	
			Accept	Reject		
SRC-STC-080-027	1	MAIN HOOK	Accept	--	--	
		ID NO :				SRC-STC-080-027
		Sr No :				TQ22108005005
	1	AUXILLARY HOOK	Accept	--	--	
		ID NO :				SRC-STC-080-027
		Sr No :				YM20221011
		SWL:	80 TON			
		SWL:	6.5 TON			
Sketch/Description:						
The above mentioned Hooks are tested by Magnetic Particle Test (MPT) method and No relevant indication observed. Hooks are Acceptable as per code, Refer Page 2 for Images of Testing.						
Tested By: NDT Level II Technician/Inspector:		Reviewed By:		Approved By:		
Name		UIC Rep. / Client		Owner/Consultant/T.P.I		
MOHAMMED BISHAM						
Date		Date		Date		
12/07/2025						



الشركة العالمية لخدمات التفتيش المحدودة
UNIVERSAL INSPECTION CO. LTD.

NDT DIVISION

Business Executive Centre, P.O.Box # 2072, Jubail -31951, Kingdom of Saudi Arabia.
Tel. : 00966 3 344 8882 / Fax :00966 3 344 8881 / Email : info@ui.com.sa / Website : www.ui.com.sa


MAGNETIC PARTICLE EXAMINATION REPORT

Report NO.:	INSPECTION DATE:	NEXT INSPECTION DATE	Page 2 of 2
MT- JUB-0815	12/07/2025	11/07/2026	

IMAGE-1 OF JOB ↓



IMAGE-2 OF JOB ↓

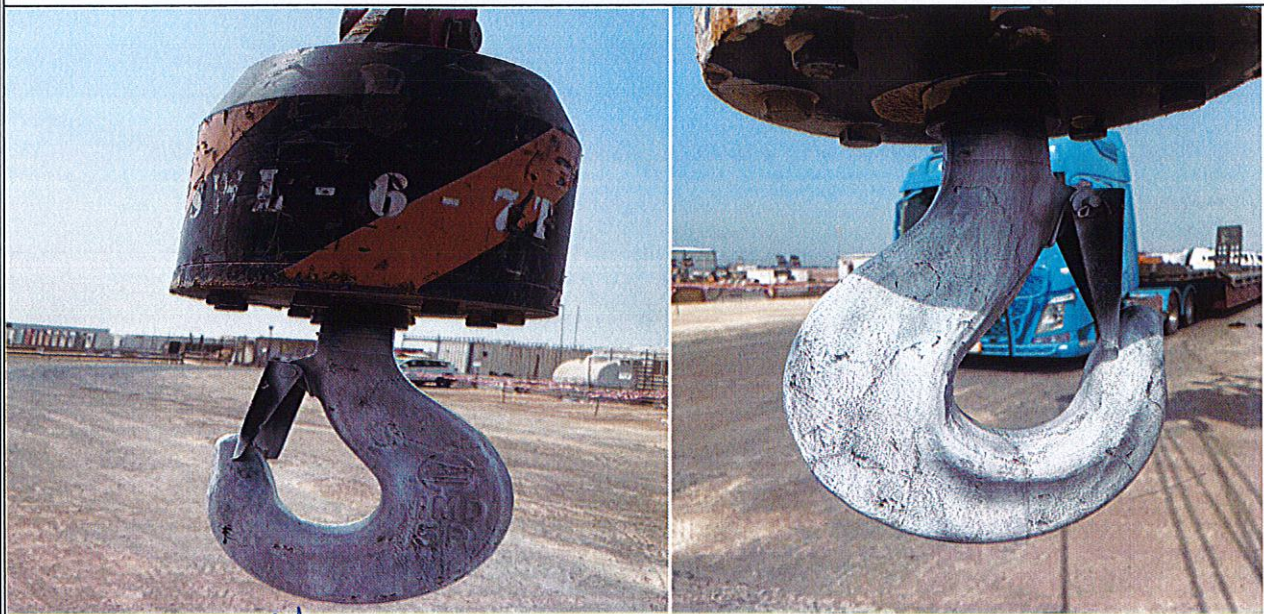

Tested By: NDT Level II Technician/Inspector: <i>[Signature]</i>		Reviewed By: UIC Rep. / Client		Approved By : Owner/Consultant/T.P.I	
Name	MOHAMMED BISHAM	Name		Name	
Date	12/07/2025	Date		Date	



AUTHORISED ONLY WITH UIC STAMP

**SGS INSPECTION SERVICES SAUDI ARABIA CO LTD****شركة اس جي اس لخدمات الفحص العربيّة السعوديّة المحدوده**

P.O Box 0725, Jubail, Saudi Arabia - 31951
Tel : + 966133400044 / Fax : + 966133420212
Email : info@sgs.com

CUSTOMER SATISFACTION SURVEY

Blue Sticker Inspection	RFI No SGS-RFI-08680	Inspection date 18-Jan-2026
Client Sudhir Equipment Rental Co.	Report No SGS-2026-SA-065	Inspector Name Mikecle Araneta
WO No	CRM No NIL	RPO No NA

S.No	Questions	Answer	Remarks
1	Did the Service provider Co. provide the right inspector with a valid qualification card?	Yes	
2	Did the service provider Co. respond for inspection within the expected time frame?	Yes	
3	Was the inspector wearing the required personal protective equipment (PPE) during the inspection?	Yes	
4	Did the inspection conducted safely and in accordance with Aramco's standards?	Yes	

For any enquiry or concern, please contact: Inspection Dept. - ISSD Crane Inspection Unit (CIU)

InspectionDeptOIDCranelInspectionUnitCIU@Exchange.Aramco.com.sa

Client Rep Signature

Imran
Hussain
Sheikh

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
1	GENERAL REQUIREMENTS					
1.1	Equipment documentation is available	ASME B30.5 Sec:5-2.1.5	✓			
1.2	Preventive Maintenance is established and updated records are maintained	ASME B30.5 Sec:5-2.3.1	✓			
1.3	Daily pre-operational inspection checklists are checked	GI 7.030 Para: 5.1.2	✓			
1.4	Vehicle government registration card (ISTIMARA) and Government periodic inspection are maintained and valid at all times for equipment that has a vehicle plate.	GI 7.030 Para: 7.1.2 Note:5	✓			
1.5	Durable load chart is provided in an accessible location	ASME B30.5 Sec: 5-1.1.3 (b)	✓			
1.6	Work areas chart is available	G.I. 7.025 ASME B30.5 Sec 5-1.1.3(2)	✓			
1.7	Operator is certified (for the inspected crane type/ model) and licensed	G.I. 7.025 ASME B30.5 Sec: 5-3.1.1	✓			
1.8	A sign is posted warning the operator not to rely solely on any automatic device as a substitute for safe operating practice	SAES-B067 Sec:4.4	✓			
1.9	Crane is painted safety yellow	SAES-B067 Sec:4.4			✓	Painted Red by OEM
1.10	Crane is painted safety yellow-and-black stripes on offshore facilities	SAES-B067 Sec:4.4			✓	
1.11	Rated capacity of crane is marked (Arabic & English)	SAES-B067 Sec:4.4	✓			
1.12	Fire extinguisher is in place with minimum rating 10 BC	ASME B30.5 Sec: 5-3.4.10	✓			
1.13	Markings and direction of all control levers are clearly displayed	ASME B30.5 Sec:5-1.6.1-1 Sec:5-1.6.1-2	✓			
1.14	Crane backward stability is in accordance with manufacturers standard (minimum radius and no load condition)	ASME B30.5 Sec:5-1.2.1	✓			
2	INSPECTION POINTS (MOBILE & CRAWLER CRANES)					
2.1	Load- holding check valve for boom is operational	ASME B30.5 Sec:5-1.3.1 (d)	✓			
2.2	Two (2) full wraps of rope remain on the drum when hook is in the extreme low position	ASME B30.5 Sec:5-1.3.1	✓			
2.3	Swing control is smoothly operating on	ASME B30.5 Sec:5-1.4.1	✓			

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
	acceleration and deceleration					
2.4	Swing braking operates, as well as positive locking devices (manual and auto)	ASME B30.5 Sec: 5-1.4.2	✓			
2.5	Travel controls are properly operating/functioning	ASME B30.5 Sec: 5-1.1.3	✓			
2.6	Auxiliary travel controls function correctly for multiple control- station cranes	ASME B30.5 Sec: 5-1.5.1			✓	
2.7	Travel brakes and locks for crawler cranes are correctly operating	ASME B30.5 Sec: 5-1.5.3			✓	
2.8	Travel brakes and locks for wheel-mounted cranes are correctly operating	ASME B30.5 Sec: 5-1.5.3	✓			
2.9	Power plant controls of superstructure -mounted power plant working properly	ASME B30.5 Sec: 5-1.6.3	✓			
2.10	Rotation-resistant and fiber-core ropes are not used for boom hoist reeving	ASME B30.5 Sec: 5-1.7.2			✓	
2.11	Sheave grooves have surface smoothness without any defects	ASME B30.5 Sec: 5-1.7.4	✓			
2.12	Sheave guards are in place on the lower block	ASME B30.5 Sec: 5-1.7.4	✓			
2.13	All sheaves can be lubricated (except permanently lubricated types)	ASME B30.5 Sec: 5-1.7.4 (d)	✓			
2.14	All cab glazing are safety glazing material	ASME B30.5 Sec: 5-1.8.1	✓			
2.15	Verify cab doors functionality and condition	ASME B30.5 Sec: 5-1.8.1	✓			
2.16	Seat belt is fitted and in good condition	ASME B30.5 Sec: 5-1.8.1 (f)	✓			
2.17	Walking platforms and areas of structure are skid-resistance	ASME B30.5 Sec: 5-1.8.2	✓			
2.18	Guard rails are fitted	ASME B30.5 Sec: 5-1.9.7			✓	
2.19	Fixed or telescoping bumper for boom stop is functional (if fitted)	ASME B30.5 Sec: 5-1.9.1			✓	
2.20	Shock absorbing bumper for boom stop is functional (if fitted)	ASME B30.5 Sec: 5-1.9.1			✓	
2.21	Hydraulic boom elevating cylinder, used as boom stop, is functional (if fitted)	ASME B30.5 Sec:5-1.9.1	✓			
2.22	Boom angle indicator is fitted, operable, and can be read from the operator station	ASME B30.5 Sec:5-1.9.1			✓	
2.23	Boom shut-off or hydraulic reliefs provided for high	ASME B30.5 Sec:	✓			

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
	angle boom condition	5-1.9.1 (d)				
2.24	Boom length indicator is fitted for telescoping booms ,and is working	ASME B30.5 Sec: 5-1.9.1	✓			
2.25	Anti-two-blocking devices are fitted and working (main and auxiliary)	ASME B30.5 Sec: 5-3.2.3	✓			
2.26	Operation and accuracy of the fitted Load Indicator, RCI or RCL (compare with load chart)	ASME B30.5 Sec: 5-1.9.10.2	✓			
2.27	LMI is fitted, operational and accurate for bool length, rated load, angle, radius, etc. (for 3 ton cranes or more)	ASME B30.5 Sec: 5-1.9.10.2	✓			
2.28	Outriggers and jacks are not leaking oil	ASME B30.5 Sec:5-2.1.3	✓			
2.29	Jack is in good operating condition at each outrigger	ASME B30.5 sec: ASME B30.5 Sec:5-2.1.3 (d)	✓			
2.30	Each outrigger jack locking device is functional (if fitted)	ASME B30.5 Sec: 5-1.9.3 (c)			✓	
2.31	No leakage from each jack seal when the crane is jacked up	ASME B30.5 Sec: 5-1.9.3 (c)	✓			
2.32	Outrigger jack bolts are fully secure	ASME B30.5 Sec: 5-1.9.3 (b)	✓			
2.33	All road wheel nuts are fully secure	ASME B30.5 Sec: 5-2.1.3(b)	✓			
2.34	All tires are serviceable and without damage or excess wear	ASME B30.5 Sec: 5-2.1.3(k)	✓			
2.35	Fuel tank supports and straps are secure	ASME B30.5 Sec: 5-2.1.3(g)	✓			
2.36	Hydraulic oil tank supports and straps are secure	ASME B30.5 Sec: 5-2.1.3(g)	✓			
2.37	Underside of chassis shows no obvious faults	ASME B30.5 Sec: 5-2.1.3	✓			
2.38	Outrigger boxes are not cracked	ASME B30.5 Sec: 5-2.1.3	✓			
2.39	Front and rear steering cylinder anchor points and pins are secure	ASME B30.5 Sec: 5-2.1.3	✓			
2.40	Track rod end joints are not worn and are secure	ASME B30.5 Sec: 5-2.1.3			✓	
2.41	Axle bolts and nuts are fully secure	ASME B30.5 Sec: 5-2.1.	✓			
2.42	Wheel hub oil seals are not leaking	ASME B30.5 Sec: 5-2.1.3	✓			
2.43	Brake linings are not oil contaminated	ASME B30.5 Sec:	✓			

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
		5-2.1.3				
2.44	Brake hoses have not deteriorated, e.g. cracks, splits, leaks, etc.	ASME B30.5 Sec: 5-2.1.3	✓			
2.45	All chassis cross members are not cracked or corroded	ASME B30.5 Sec: 5-2.1.3	✓			
2.46	Transmission mounting bolts and bushings are secure	ASME B30.5 Sec: 5-2.1.3	✓			
2.47	All drive shaft bolts and universal joints are not worn	ASME B30.5 Sec: 5-2.1.3	✓			
2.48	Ring gear bolts are fully secure	ASME B30.5 Sec: 5-2.1.3	✓			
2.49	All hydraulic hoses under chassis have not deteriorated (cracks , splits , leaks)	ASME B30.5 Sec: 5-2.1.2	✓			
2.50	Engine shows no major oil leakage	ASME B30.5 Sec: 5-2.1.3	✓			
2.51	Radiator does not leak water	ASME B30.5 Sec: 5-2.1.3	✓			
2.52	Rope is free of kinking, crushing, birdcaging, or any other damage resulting in distortion of the rope structure • No more 1 broken wire protruding from the core • There are no reductions from nominal rope diameter of more than 5% For running ropes: • No more than 6 randomly broken wires in 1 lay or 3 broken wires in 1 strand of 1 lay For rotation resistance ropes • No more than 2 randomly distributed broken wires in six rope diameters or 4 randomly distributed broken wires in 30 rope diameters • Evidence of any heat damage from any cause.	ASME B30.5 Sec: 5-2.4.3	✓			
2.53	Main hoist drum mounting bolts are secure	ASME B30.5 Sec: 5-2.1.3	✓			
2.54	Rear telescope side and top wear pads are serviceable	ASME B30.5 Sec: 5-2.1.3	✓			
2.55	Bottom and side wear pads of telescope sections are serviceable	ASME B30.5 Sec: 5-2.1.3	✓			
2.56	Boom heel pin bushes are not worn (rock boom up and down to check this)	ASME B30.5 Sec: 5-2.1.3	✓			
2.57	Center swivel coupling pipes and hoses do not leak	ASME B30.5 Sec: 5-2.1.3	✓			
2.58	Center swivel coupling bolts are all secure	ASME B30.5 Sec: 5-2.1.3	✓			

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
2.59	Boom lift cylinder anchor bolts and bushings are secure	ASME B30.5 Sec: 5-2.1.3	✓			
2.60	Swing gearbox bottom oil seal and drive gear are in a serviceable condition (Should be well lubricated)	ASME B30.5 Sec: 5-2.1.3	✓			
2.61	Wire rope clips shall be drop-forged steel of the single saddle U bolt or doubled saddle type clip for end termination.	ASME B30.5 Sec: 5-1.7.3(b)	✓			
2.62	Emergency switch / Power take off switch need to be verified	ASME B30.5 Sec: 5-1.6.1(e)	✓			
3	CRANE CAB					
3.1	Horn and wind speed anemometer are working	ASME B30.5 Sec: 5-3.2.1.6	✓			
3.2	Crane level indicator is fitted and working	ASME B30.5 Sec: 5-1.9.10.6	✓			
3.3	Engine gauges and associated indicators are working	ASME B30.5 Sec: 5-2.1.3 (g)	✓			
3.4	The warning sign stating power line required clearances is visible to the operator	ASME B30.5 Sec: 5-1.9.12(g)	✓			
3.5	Load block sheaves turn freely and are undamaged	ASME B30.5 Sec: 5-2.1.3 (c)	✓			
3.6	Dead end rope anchor is correctly made with a suitable wedge socket and loop-back termination	ASME B30.5 Sec: 5-1.7.3 (d)	✓			
3.7	Hook assemblies are equipped with safety latches	ASME B30.5 Sec: 5-1.7.6	✓			
3.8	Hook assembly labeling and manufacturer data is clearly marked	ASME B30.10 Sec : 10-1.8	✓			
3.9	Hook's weight is clearly marked/printed on the hook	ASME B30.10 Sec: 10-1.10.5 (b)	✓			
3.10	Safe working load of hook is clearly marked on the item	ASME B30.10 Sec : 10-1.8	✓			
3.11	Hook does not show defects such as nicks, cracks and gouges	ASME B30.10 Sec : 10-1.10.5 (d)	✓			
3.12	Hook is not bent or twisted	ASME B30.10 Sec : 10-1.10.5 (f)	✓			
3.13	Hook is not distorted in the throat opening • Max. allowable throat opening is 5% not to exceed 1 1/4 in. (6 mm) compared to new hook, or as per manufacturer recommendations	ASME B30.10 Sec : 10-1.10.5 (g)	✓			
3.14	Maximum wear in the hook bowl is not exceeding 10% (compared to new hook) or as per	ASME B30.10 Sec : 10-1.10.5 (e)	✓			

SAUDI ARAMCO INSPECTION CHECKLIST	SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES	SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT	WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
	manufacturer recommendations					
3.15	Hook is not cracked, gouged or shows nicks	ASME B30.10 Sec : 10-1.10.5 (d)	✓			
3.16	Hook can lock (if it is a self-locking hook)	ASME B30.10 Sec : 10-1.10.5 (h)			✓	
3.17	Inoperative latch (if provided) – any damaged latch or malfunctioning latch that does not close the hook's throat	ASME B30.10 Sec : 10-1.10.5 (i)			✓	
3.18	Rope guards and locked in position with pins (hook block)	ASME B30.5 Sec:5-1.7.4	✓			
3.19	Dead end rope anchor is fitted with a lock pin (hook block)	ASME B30.5 Figure 5-1.7.3-1	✓			
3.20	Dead end rope anchor is correctly made with a suitable wedge socket and loop- back termination	ASME B30.5 Figure 5-1.7.3-1	✓			
3.21	Reverse travel alarm is operational.	General	✓			
3.22	Turning signals and indicators are working correctly	General	✓			
3.23	Road lighting, including spotlights, are in good condition and operable	General	✓			
3.24	Dry friction brakes and clutches shall be protected against rain and other liquids such as oil and lubricants	ASME B30.5 Sec 5-1.9.8	✓			
4	CRAWLER CRANE					
4.1	Track pads are undamaged and drive chain are tensioned	ASME B30.5 Sec: 5-2.1.3 (h)			✓	
4.2	Drive sockets and drive chain tumblers are serviceable	ASME B30.5 Sec: 5-2.1.3 (h)			✓	
4.3	Top and bottom swing rollers and tracks are in good overall condition (Should be well lubricated)	ASME B30.5 Sec: 5-2.1.3 (a)			✓	
4.4	Track idlers are serviceable	ASME B30.5 Sec: 5-2.1.3 (a)			✓	
4.5	Back boom stops are functioning	ASME B30.5 Sec: 5-1.9.1 (a)			✓	
4.6	Back A-Frame is in good condition	ASME B30.5 Sec: 5-2.1.3 (a)			✓	
4.7	Boom cut-out (at maximum angle) is operable	ASME B30.5 Sec: 5-1.9.1 (a-2)			✓	
4.8	Power low lowering is operational	ASME B30.5 Sec: 5-1.3.2(a-1)			✓	
4.9	Boom hoist safety auxiliary ratchet / pawl lock is	ASME B30.5 Sec:				

SAUDI ARAMCO INSPECTION CHECKLIST		SAIC NUMBER	ISSUE DATE	DISCIPLINE	
MOBILE / CRAWLER CRANES		SAIC-U-7007	12-Jan-23	ELEVATING/LIFTING EQUIPMENT	
PROJECT TITLE SUDHIR EQUIPMENT		WBS/BI/JO NUMBER	INSPECTION COMPANY SGS Inspection Services Saudi Arabia Co Ltd		

EQUIPMENT ID NUMBER SRC-STC-080-027	EQUIPMENT DESCRIPTION/TYPE TMS-H	SERIAL NO. TC2080CD0508.	REPORT No.: SGS-2026-SA-065
CAPACITY (SWL) 80 t	MANUFACTURER SANY	FACILITY / LOCATION SUDHIR YARD, DAMMAM	
REQUESTED INSPECTION DATE 18-Jan-2026	RFI No SGS-RFI-08680	TASK COMPLETED DATE 18-Jan-2026	EQUIPMENT OWNER Sudhir Equipment Rental Co.

ITEM	ACCEPTANCE CRITERIA	REFERENCE	PASS	FAIL	N/A	RE-INSP DATE
	engaging	5-1.3.1(c)			✓	
4.10	Boom chords and lacings are undamaged (bent)	ASME B30.5 Sec: 5-2.1.3			✓	
4.11	Sheave grooves are free from surface defects that could cause rope damage.	ASME B30.5 Sec: 5-1.7.4 (a)			✓	
4.12	Pendant ropers are showing no broken wires (see no. 48)	ASME B30.5 Sec: 5-2.4.2			✓	
4.13	Operation of steering brakes is satisfactory	ASME B30.5 Sec: 5-1.5.3			✓	
4.14	Main machinery guarding is in place	ASME B30.5 Sec: 5-1.6.4			✓	
4.15	Main clutch is fully operational	ASME B30.5 Sec: 5-1.6.4			✓	
4.16	Main boom and hoist drum brakes are fully functional	ASME B30.5 Sec: 5-1.3.2(a-1)			✓	

REFERENCE DOCUMENTS:

- 1.ASME B30.5 - 2021 Issue: Mobile & Locomotive Cranes
- 2.ASME B30.10 - 2019 Issue: Hooks
- 3.SAES-B067 - 2020 Issue: Safety Identification and Safety Colors
- 4.SA GI 7.025-2018 Issue: Heavy Equipment Operator and Rigger Testing and Certification
- 5.SA GI 7.030 - 2023 Issue: Inspection and Testing Requirements for Elevating/Lifting Equipment

Load Tested By (If Applicable):

Name	Signature	Date

✓ Inspected ☐ Witnessed by 3rd Party Certified Inspector:

Name	Signature	Certificate No. & Company:
Mikecle Araneta		80019274 & SGS Inspection Services Saudi Arabia Co Ltd

User Representative:

Name	Signature	Date
------	-----------	------

Imran Hussain Sheikh

18-Jan-2026



شركة اس جي اس لخدمات الفحص العربيه السعوديه المحدوده

SGS Inspection Services Saudi Arabia Co Ltd

P.O Box 0725, Jubail, Saudi Arabia - 31951 Tel : +966133400044 / Fax : + 966133420212

Lifting Equipment Inspection Sticker

Sticker Serial No : SGS-PASS-5346

Equipment No : SRC-STC-080-027

Equipment sl No : TC2080CD0508.

Date Inspected : 18-Jan-2026

Next Inspection Date : 17-Apr-2026

Inspected By : Mikecle Araneta

Inspector No : 80019274



www.sgs.com

Saudi Aramco Inspection Department Approved Contractor Agency



SGS INSPECTION SERVICES SAUDI ARABIA CO LTD

شركة اس جي اس لخدمات الفحص العربيّة السعوديّة المحدوده

P.O Box 0725, Jubail, Saudi Arabia - 31951
Tel : + 966133400044 / Fax : + 966133420212
Email : info@sgs.com

Report No: SGS-2026-SA-065



LIFTING EQUIPMENT INSPECTION REPORT	RPO No NA	CRM No NIL	Inspection date 18-Jan-2026	Inspection time 13:00	Previous sticker No SGS-2021-FAIL-185	Issued By SGS
Department / Contractor Sudhir Equipment Rental Co.	Equipment No. SRC-STC-080-027	Equipment Location SUDHIR YARD, DAMMAM	Area DAMMAM	Inspection Result PASS	New Sticker No. SGS-PASS-5346	
Manufacturer SANY	Model STC800T5	Capacity 80 t	Type TMS-H	Equipment Serial Number TC2080CD0508.	Sticker Expiration Date 17-Apr-2026	

Above Equipment was inspected by **SGS Inspection Services Saudi Arabia Co Ltd** in accordance with applicable Saudi Aramco GI's, ASME & API Standards. Deficiencies that require corrective actions are listed below. Specific repairs to correct each deficiency should be noted in the corrective action taken column.

No	NOTES / DEFICIENCIES	CORRECTIVE ACTION TAKEN
*	Re-inspection and functional test been carried out as per G.I.7.030 & ASME B30.5 and found OK at the time of inspection.	
*	Boom Length: 12.70 M - 44.90 M , Five boom section, Max boom angle: 80.1°.	
*	Main Hook, SWL: 80 t , Weight: 800 KG, Serial #: TQ221080050065 Main hoist diameter: 20 MM , # of Fall: 04.	
*	Aux Hook, SWL: 6.5 T, Weight: 140 KG, Serial #: QZG6-5.20 Aux hoist diameter: 20 MM , # of Fall: 01.	
*	Fly Jib stowed during the inspection.	
*	Plate #: 2042 TAA (MVPI valid till: 18/01/2027).	
*	Maintain P.M. service and lubricate all moving parts.	

User Name	Badge No.	Telephone No.	Technical Reviewer Name	SGS Inspector Name	Certificate No.	Telephone No.
Imran Hussain Sheikh	CAC015070	0536839775	aqeel hashmi	Mikecle Araneta	80019274	+966-566714453
Signature			Signature		Signature	

When re-inspection is requested, a complete copy of this report should be ready to be reviewed by the inspector.

Distribution: Original - Proponent, 1st copy - Inspection Agency, 2nd copy - Inspector

Control Report Number : SGS/JBL/M-26/011 WO:-

MAINTENANCE REPORT FOR TRUCK MOUNTED CRANE

1	Fleet Number	SRC-STC-080-027	Service Order No: 26/SC353	
2	Make & Model	SANY STC800T5		
3	Location of Crane	Sudhir rentals New yard - Dammam		
4	Year of Manufacture	2022		
5	Name Plate Details	2042 TAA		
6	Chassis Hour/Kilo Meter Reading	-		
7	Crane Hour Meter Reading	2006		
8	Last Inspection Done On	2/3/2026		
9	Next Inspection	2506		
10	Operator Name	Imran Hussain		
11	Technician Name	Zeesan		

SR NO	DESCRIPTION	OBSERVATIONS	CONDITION	REMARKS
		CONDITION (✓ = Satisfactory X = Repair O = Replace ● = Work done)		
1	ENGINE:			
	Engine oil	✓	O	
	Engine oil filter	✓	O	
	Fuel filter	✓	O	
	Water separator	✓	O	
	Air filter	✓	O	
	Engine oil pressure (In hot and cold condition)	✓		
	Radiator	✓		
	Oil Cooler	✓		
	Fuel lines and Fuel system	✓		
	Water pump	✓		
	Vee Belt (tension and condition)	✓		
	Turbo charger	✓		
	Water temperature	✓		
	Any leakages	✓		
	Controls	✓		
	Cleanliness	✓		
	Any abnormal sound	✓		
	Soundproofing	✓		
2	HYDRAULICS			
	Hydraulic oil	✓		
	Filter element	✓		
	Breather element	✓		
	System pressure	✓		
	Hydraulic Pump	✓		
	Hydraulic hoses	✓		
	Cylinders	✓		
	Any Leakages	✓		
	Operation	✓		
	Control valve bank	✓		
	Any abnormal sound	✓		
3	POWER TRAIN			
	TRANSMISSION	✓		
	Transmission mounting	✓		
	Transmission oil	✓		
	Transmission oil filter element	✓		
	Transmission system pressure (For/ Rev)	✓		
	Control lever	✓		
	Any leakages	✓		
	Any abnormal sound during operation	✓		
4	FINAL DRIVE			
	Final drive Oil	✓		
	Any leakages	✓		
	Any abnormal sound	✓		
	Prop shaft	✓		
	Lubrication	✓		
	Tightness of bolts	✓		

5	STEERING SYSTEM			
	System Pressure	✓		
	Any leakages	✓		
	Cylinders	✓		
	Hoses	✓		
	Pins & Bushes	✓		
6	OUTRIGGERS / STABILIZERS			
	Box Frame	✓		
	Lubrication	✓	o	
	Support Pads	✓		
	Cylinders	✓		
	Hose pipes and connections	✓		
7	REVOLVING FRAME/ TURN TABLE			
	Slewing Gear	✓	o	
	Slewing Gear Lubrication	✓		
	Slewing Gear Bolts	✓		
	Check for Cracks / Damages	✓		
8	COUNTER WEIGHTS			
	Attachment connections / bolting	✓		
	Proper Size	✓		
9	OPERATOR CAB			
	Glass Visibility	✓		
	Operator Seat & Seat Belt	✓		
	Doors and Windows	✓		
	Windshield Wipers	✓		
	Cabin Light	✓		
	Rear View Mirrors	✓		
	Control Panel	✓		
	All meters / gauges	✓		
	Appropriate Load Charts & Warning Signs	✓		
	Proper & Adequate access (steps/walkways)	✓		
	Fire Extinguisher	✓		
	Inside / Outside Condition	✓		
	Air Conditioning System	✓		
10	ELECTRICAL SYSTEM			
	Battery	✓		
	Battery Isolator switch	✓		
	Electrical wiring	✓		
	All Lights	✓		
	Beacon Lights	✓		
	Switches	✓		
	Horn (For/Rev)	✓		
11	BRAKING SYSTEM			
	Service Brake	✓		
	Parking Brake	✓		
	Emergency Brake	✓		
	Hoist/Winch Brake	✓		
	Swing Brake	✓		
12	BOOM SECTIONS			
	Luffing Cylinder	✓		
	Boom box sections	✓		
	Boom Lubrications	✓	o	
	Hoist Lines Guides/Sheaves/Running Rollers	✓		
	Boom Backstop	✓		
	Boom Head Sheaves	✓		
	Fly Jib	✓		
13	SHEAVE SYSTEM			
	Proper Sheave Match / Wear	✓		
	Sheave Condition	✓		
	Lubrication / Move Freely	✓		
14	HOOK & HOOK BLOCK SYSTEM			
	Sheaves Function Smoothly	✓		
	Hook Rotates Freely/Lubricated	✓		
	Proper Bracket and Guides	✓		
	Properly Reeved	✓		
	Hook Safety Latch	✓		
		✓		

15	WIRE ROPE			
	Overall Condition	✓		
	Wire rope measured	✓		
	End Connection	✓		
	Lubrication	✓	0	
	Clips	✓		
16	SAFETY DEVICES			
	Load Indicator	✓		
	Antitwo Block Device	✓		
	Boom Backstop Device	✓		
	Swing Radius Warning Device	✓		
	Boom Angle Indicator	✓		
	Leveling Indicator Device (spirit level)	✓		
	Drum Rotation Indicator	✓		
	Anemometer	✓		
	Beacon Lamp	✓		
	Emergency Stops	✓		
17	TYRES			
	Size	✓		
	Tyre Inflation Pr	✓		
	Condition	✓		
18	APPEARANCE			
	Denting	✓		
	Painting	✓		
19	DOCUMENTATIONS			
	History File	✓		
	Plant Service Sheet	✓		
	Maintenance Records	✓		
	Wire Rope Certificate	✓		
	Hook Block Certificate	✓		
	Yearly Inspection Certificate	✓		
20	COMMENTS:	PERIODICAL CRANE MAINTENANCE DONE		
		Engine oil changed.All filters replaced.		
		Completely Grease applied Boom,outrigger,turn table,nipple,wire rope.		


Inspected By


Plant Engineer/Supervisor


Technical & Operations Manager

MAINTENANCE REPORT FOR TRUCK MOUNTED CRANE

1	Fleet Number	SRC-STC-080-027	Service Order No: 25/SC169	
2	Make & Model	SANY STC800T5		
3	Location of Crane	Heavy engineering industries and shipbuilding co Rastanura		
4	Year of Manufacture	2022		
5	Name Plate Details	2042 TAA		
6	Chassis Hour/Kilo Meter Reading	–		
7	Crane Hour Meter Reading	1468.51		
8	Last Inspection Done On	19/11/2025		
9	Next Inspection	1968.51		
10	Operator Name	Imran Hussain		
11	Technician Name	Bivek		
SR NO	DESCRIPTION	OBSERVATIONS	CONDITION	REMARKS
		CONDITION (✓ = Satisfactory X = Repair O = Replace) ● = Work done		
1	ENGINE:			
	Engine oil	✓	O	
	Engine oil filter	✓	O	
	Fuel filter	✓	O	
	Water separator	✓	O	
	Air filter	✓	O	
	Engine oil pressure (In hot and cold condition)	✓		
	Radiator	✓		
	Oil Cooler	✓		
	Fuel lines and Fuel system	✓		
	Water pump	✓		
	Vee Belt (tension and condition)	✓		
	Turbo charger	✓		
	Water temperature	✓		
	Any leakages	✓		
	Controls	✓		
	Cleanliness	✓		
	Any abnormal sound	✓		
	Soundproofing	✓		
2	HYDRAULICS			
	Hydraulic oil	✓		
	Filter element	✓		
	Breather element	✓		
	System pressure	✓		
	Hydraulic Pump	✓		
	Hydraulic hoses	✓		
	Cylinders	✓		
	Any Leakages	✓		
	Operation	✓		
	Control valve bank	✓		
	Any abnormal sound	✓		
3	POWER TRAIN			
	TRANSMISSION	✓		
	Transmission mounting	✓		
	Transmission oil	✓		
	Transmission oil filter element	✓		
	Transmission system pressure (For/ Rev)	✓		
	Control lever	✓		
	Any leakages	✓		
	Any abnormal sound during operation	✓		
4	FINAL DRIVE			
	Final drive Oil	✓		
	Any leakages	✓		
	Any abnormal sound	✓		
	Prop shaft	✓		
	Lubrication	✓		
	Tightness of bolts	✓		

5	STEERING SYSTEM			
	System Pressure	✓		
	Any leakages	✓		
	Cylinders	✓		
	Hoses	✓		
	Pins & Bushes	✓		
6	OUTRIGGERS / STABILIZERS			
	Box Frame	✓		
	Lubrication	✓	o	
	Support Pads	✓		
	Cylinders	✓		
	Hose pipes and connections	✓		
7	REVOLVING FRAME/ TURN TABLE			
	Slewing Gear	✓	o	
	Slewing Gear Lubrication	✓		
	Slewing Gear Bolts	✓		
	Check for Cracks / Damages	✓		
8	COUNTER WEIGHTS			
	Attachment connections / bolting	✓		
	Proper Size	✓		
9	OPERATOR CAB			
	Glass Visibility	✓		
	Operator Seat & Seat Belt	✓		
	Doors and Windows	✓		
	Windshield Wipers	✓		
	Cabin Light	✓		
	Rear View Mirrors	✓		
	Control Panel	✓		
	All meters / gauges	✓		
	Appropriate Load Charts & Warning Signs	✓		
	Proper & Adequate access (steps/walkways)	✓		
	Fire Extinguisher	✓		
	Inside / Outside Condition	✓		
	Air Conditioning System	✓	o	
10	ELECTRICAL SYSTEM			
	Battery	✓		
	Battery Isolator switch	✓		
	Electrical wiring	✓		
	All Lights	✓		
	Beacon Lights	✓		
	Switches	✓		
	Horn (For/Rev)	✓		
11	BRAKING SYSTEM			
	Service Brake	✓		
	Parking Brake	✓		
	Emergency Brake	✓		
	Hoist/Winch Brake	✓		
	Swing Brake	✓		
12	BOOM SECTIONS			
	Luffing Cylinder	✓		
	Boom box sections	✓		
	Boom Lubrications	✓		
	Hoist Lines Guides/Sheaves/Running Rollers	✓		
	Boom Backstop	✓		
	Boom Head Sheaves	✓		
	Fly Jib	✓		
13	SHEAVE SYSTEM			
	Proper Sheave Match / Wear	✓		
	Sheave Condition	✓		
	Lubrication / Move Freely	✓		
14	HOOK & HOOK BLOCK SYSTEM			
	Sheaves Function Smoothly	✓		
	Hook Rotates Freely/Lubricated	✓		
	Proper Bracket and Guides	✓		
	Properly Reeved	✓		
	Hook Safety Latch	✓		
		✓		

