THITE VALUERS & ENGINEERS PVT. LTD.

PUNE OFFICE :
3rd floor, "Gayatri", CTS No. 2060, Vijayanagar Colony, Sadashiv Peth,
Behind S. P. College & Near Dake's English Classes, off Tilak Road, Pune 411 030.
Phones : 2433 2322, 2433 2223, 9822877010
Email : thitevaluers@gmail.com

Branches :
Mumbai : 022 - 24382454 / 24382455
Sangli : 0233 - 2321547 / 2376849

Website : www.thitevaluers.com

SHEKHAR L. THITE
B.E.,M.Tech., F.I.V., A.M.I.E.
CEO & Tech. Director

CRISIL RATED VALUER
Rating - NSIC - CRISIL SE 2B, Indicates high performance capability.

• GOVT. APPROVED VALUERS • CHARTERED ENGINEERS • LENDER'S INDEPENDENT ENGINEER, TEV CONSULTANTS CORPORATION BANK, STAND CHART BANK,CANARA BANK, SARASWAT BANK, COSMOS BANK, BANK OF BARODA, UNION BANK, DENA BANK, PNB ETC. • ENLISTED IN THE DIRECTORY OF INDUSTRIAL CONSULTANTS MAINTAINED BY IDBI, IFCI & ICICI.

Silver jubilee Period (1983 - 2008)

Ref. No.: PS-130/PJA17-109/MRP/A

Date: 16/01/2017

Duplicate Copy

To,
The Branch Manager,
Corporation Bank
Branch: Sarasbaug, Pune

Sub: Valuation Report for Bank Loan Purpose

Client Name: Mrs. Ashwini D. Phalke

Dear Sir,
Please find enclosed herewith the subject Valuation Report.

Location of the Property : Marriage Hall (Nishigandha Palace) on site (as per Na Order Transit Godown) NA Land at Gat No. 42/1B (Part), Nahvara- Inamgaon Road, Near Phalke Mala, Opposite Ajit Petroleum, Village: Pimplesuti, Tal. Shirur, Dist.: Pune.

Details		Fair market value (₹)
Market Value	Land	1,09,00,000.00
	Building	2,49,00,000.00
	Plot development	20,00,000.00
	Total	**3,78,00,000.00**
[Rupees Three Crore Seventy Eight Lacs Only]		

This report has 10 pages [Including photographs]
Kindly acknowledge the receipt.
Thanking you,

Yours faithfully,
FOR THITE VALUERS AND ENGINEERS PVT. LTD.

Mr. A. R. Kumbhar – Mob. 7888000501
(Chief Engineer)

(S. L. THITE)
PANEL VALUER
CORPORATION BANK

Scanned with OKEN Scanner

Ref. No.: PS-130/PJA17-109/MRP/A

PROPERTY VALUATION REPORT

I. GENERAL INFORMATION

1.	Name of the party/purchaser and address		Mrs. Ashwini D. Phalke
2.	Name/s of the reported owner/Name/s of persons in whose name/s the property registered and address	:	Mrs. Ashwini D. Phalke
3.	Location of the Property	:	Marriage Hall (Nishigandha Palace) on site (as per Na Order Transit Godown) NA Land at Gat No. 42/1B (Part), Nahvara-Inamgaon Road, Near Phalke Mala, Opposite Ajit Petroleum, Village: Pimplesuti, Tal. Shirur, Dist.: Pune.
4.	Purpose of Valuation	:	Bank loan purpose
5.	Person/s Accompanying / Available at the site at the time of visit/inspection/valuation	:	Mr. Gaikwad (Security)
6.	Details of legal opinion verified	:	--

7. List of Documents produced for perusal
   - ✓ ADTP Approved plan under commencement certificate No. 7392 dated 23/11/2011
   - ✓ Sub Divisional Office Maval Collector NA Order No. NA/SR/471/2011 dated 05/06/2012
   - ✓ Extract of 7/12 dated 25/10/2013
   - ✓ Extract of 8A dated 25/10/2013
   - ✓ Our earlier valuation report ref. no. PS-031/PJN12-227/SSP dated 23/06/2012 for Same Bank and Branch (previous value ₹ 55,30,000.00)

8.	Date of Inspection	:	11/01/2017
9.	Date of Valuation	:	16/01/2017
10.	Approximate distance from the branch to the property	:	About 145-150 km

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

11. Situation/location/brief description of the land/site and brief description of the building : This property is in the form of plot along with construction situated in middle class locality in commercial area (for na land) and agricultural area.

12. Boundaries of the property :

	As Actual
East	By Property of Mr. Anil Phalke
West	By Property of Mr. Prakash Phalke
South	By Property of Mrs. Ashwini Phalke
North	By Navhara Inamgaon Road and Petrol Pump

13. Property Tax Details : Details not provided

14. Assuming the entire property is let out, the probable monthly rent and advance building rent : Notional Monthly Rent expected ₹ 80,000 to ₹ 90,000/- Per month

15. Whether the building plan has been approved? :

- If Yes, Date of approval, approving Authority and whether the building has been constructed as per the approved plan. : ADTP under Pune's letter Approved plan under commencement certificate No. 7392 dated 23/11/2011 is provided for our perusal.
  Construction is not as per sanctioned plan and less than sanctioned area.
  As per plan transit godown but on site marriage hall is constructed.

- If no, the reasons for non approval : --

16. General Remarks : --

II. VALUATION DETAILS

A. Land

1. The Total Area (Extent of the site / land) : As per Extract of 7/12 area of Plot = 2 Hector 67 R i.e. 26700 sqm

As per sanctioned plan area of Plot : please refer below :

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

As per sanctioned Plan	Area (in sqm)
Total Area of Land	26700
Area as per Extract 7/12	12000
Area of plot Under NA	12000
Area under road widening + internal Road	1295.30
Balance Area	10704.70
Net Plot Area (0.75%)	8028.52 sqm
Permissible Built up Area 25%	2007.13 sqm
Proposed Built up Area	2002 sqm

Plot Area consideration for valuation

	Area in sqm
Area of Land	12000
Less Under road widening area + serviced area)	(231.60 + 232.05) = 463.65
Net Area of Land	11536.35 sqm
	11536.35 sqm i.e. 124177 sft/43560 sft = 2.851 Acre

2.	Description of the site / land	:	
a.	Character of locality	:	Commercial
b.	Classification	:	Middle Class
c.	Development of surrounding areas	:	Semi Developed
d.	Is the locality subjected to frequent flooding	:	No
e.	Feasibility to the civic amenities like School, Hospital, Offices, Markets etc.	:	About 1-2 km
f.	Shape of the land	:	Irregular
g.	Type of use to which it can be put	:	Commercial
h.	Any other restriction of usage	:	Sanctioned for Commercial
i.	Nature of right, whether leasehold freehold	:	Freehold
j.	Road Facility	:	Tar
k.	Is it a corner plot	:	Yes
l.	Water supply / potentiality	:	Yes
m.	Underground sewerage system	:	No
n.	Any other sentimental / social issue which may affect the value	:	--
3.	General Remarks	:	--
4.	Unit Rate as per Government	:	For stamp duty purpose the Govt. of Maharashtra has fixed the rate for land in this area is ₹ 950/- sqm

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

It may be noted that the Govt. guideline value are for Stamp duty purpose, they are generally constant along a particular road i.e. it doesn't take into account the advantage of particular property Vis-à-Vis its location. Rates of property vary from site to site and within a site from micro-site to micro-site. That is why our valuation differs from Govt. Stamp duty ready reckoner rate.

5. Prevailing Unit market rate : ₹ 1,000/- per sqm. For land

6. Unit rate adopted in this valuation : ₹1,000/-- per sqm. For land

7. If Unit rate adopted is different from prevailing market rate Reasons for the same : --

8. Valuation of the site / land : As per Plan Area of Plot = 11536 sqm
Rate Adopted = ₹ 1,000/sqm
Less : 5 % due to construction on plot
Hence Value = 11536 sqm x 1,000.00 x 0.95 = ₹ 1,09,59,200.00
Say = ₹ 1,09,00,000.00

B. BUILDING

1. Type of constructions :
2. Quality of Construction :
3. Appearance of the Building :
4. Number of Floors :
5. Maintenance of the Building :
6. Description of the Building :
a. Foundation :
b. Superstructure : Please refer below table
c. Roof :
d. Doors :
e. Windows :
f. Sanitary fittings :
g. Flooring :
h. Electricity Supply :

THITE VALUERS & ENGINEERS PVT. LTD.

A) Marriage Hall (actual) (as per plan Transit Godown)	It is a single storey usual RCC framed structure with pre-coated GI sheet roof having kota tile flooring, dry distemper internally, casing capping electrification, Internal height is about 28-30', etc. Overall appearance is average. Architectural quality is Good. Measured built up area = 9325 sft (including Entrance lobby).

Scanned with OKEN Scanner

B) Dinning Hall	It is a single storey pre-coated GI sheet roof having kota flooring, dry distemper internally, internal height is about 28-30' etc. Overall appearance is average. Architectural quality is Good. Measured built up area = 4050 sft.
C) Kitchen	It is a single stroey RCC framed structure with RCC slab having kota flooring, dry distemper internally, casing capping electrification, M.S. sliding grill and T.W. door frame with solid core flush door, Aluminium sliding windows, internal height is about 9', etc. Overall appearance is average. Architectural quality is average. Measured built up area = 1368 sft
D) Toilet Block	It is a single stroey RCC framed structure with RCC slab having kota flooring, dry distemper internally, casing capping electrification, T.W. door frame with solid core flush door, Aluminium sliding windows, internal height is about 10' etc. Overall appearance is average. Architectural quality is average. Measured built up area = 832 sft.

7. Total Plinth Area : For Area details please refer above point No. B

8. Age of Construction : **For Marriage Hall and Dinning Hall :**
About 6 years old
(This is based on ADTP Approved plan under commencement certificate No. 7392 dated 23/11/2011.)

For Kitchen and Toilet Blocks :
Reportedly 6 years old
(This is based on oral information given by the borrower)

9. Total residual life of the building estimated : Under normal condition
A) For Marriage Hall and Dinning Hall : About 54 years
B) For Kitchen and Toilet Blocks : About 69 years

10. General Remarks : --

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

11. Replacement rate of construction with the existing conditions and specification : ₹ 1,600/- per sft.

12. Replacement cost of construction : ₹2,49,00,000.00

13. Depreciation Value at the rate of : Depreciated rate adopted for valuation

14. Present Value of construction : Refer below

Sr. No.	Details	Built up area [sft]	Rate adopted [per sft] in ₹	Value in ₹
A]	Marriage Hall	9325	1,600/-	1,49,20,000.00
B]	Dinning Hall	4050	1,600/-	64,80,000.00
C]	Kitchen	1368	1,600/-	21,88,800.00
D]	Toilet Block	832	1,600/-	13,31,200.00
	Total			2,49,20,000.00
	Say			**2,49,00,000.00**

15. Plot development : Such as Compound wall, Front Designed RCC Construction, Door, Borewell, Overhead Water Tank etc.
Lumpsum value = ₹ 20,00,000.00

16. Longitude of the Property : + 74.532217° E
17. Latitude of the Property : + 18.592742° N

C. TOTAL VALUATION

1. Valuation of the Land : ₹ 1,09,00,000.00
2. Valuation of the Building : ₹ 2,49,00,000.00
3. Valuation of plot development : ₹ 20,00,000.00

TOTAL : **₹ 3,78,00,000.00**

(Amount in Words) **[Rupees Three Crore Seventy Eight Lacs Only]**

Realizable Sale Value : 5 % less than fair market value
i.e. ₹3,59,10,000.00

Distress Sale value : 15 % less than fair market value
i.e. ₹ 3,21,30,000.00

D. INSURANCE VALUE

₹ 2,49,00,000.00

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

III. DECLARATION

1. The facts furnished above are true and correct to the best of my knowledge and belief.
2. We have no direct or indirect interest in the property valued.
3. We have inspected the site/property on 11/01/2017

IV. ANY OTHER REMARK

- The valuation is based on the site visit. The documents and information given by the borrower were also considered.
- The valuation is subject to clear and marketable title and adequacy of engineering design.
- This valuation report will remain valid only for the purpose for which it is made. The market value obtained in this report is defined as follows – Market value is the estimated amount for which an asset should exchange on the date of valuation between a willing buyer and a willing seller in an Arm's length transaction after proper marketing wherein the parties had each acted knowledgeably and without compulsion. (As defined by the International Valuation Standards Committee, London).
- Emphasis of this report is on the value of the property and not on the area measurement or title verification or legal aspects of the property.
- Past performance of Real Estate Market need not necessarily indicate the future trends
- The encumbrance on the asset due to any other loan, lien, government dues, duties, other rights if any etc. is not considered in this valuation. In fact we have treated the assets as free of encumbrances.
- The opinion about valuation is true and correct to the best of our knowledge and belief. We have no direct or indirect interest in the assets valued.
- The Latitudes and Longitudes are obtained using satellite technology through google maps. The accuracy of these readings have some limitations.
- Documents such as Registered agreement, Index II, Completion Certificate etc. are not provided for our perusal. Hence this valuation is based on few assumptions.

THITE VALUERS & ENGINEERS PVT. LTD.

Scanned with OKEN Scanner

Ref. No.: PS-130/PJA17-109/MRP/A

In my opinion, the present market value of the property discussed in the report (above) by adopting prevailing market rate for the property is as follows,

Details		Fair market value (₹)
Market Value	Land	1,09,00,000.00
	Building	2,49,00,000.00
	Plot development	20,00,000.00
	Total	**3,78,00,000.00**
		[Rupees Three Crore Seventy Eight Lacs Only]

Visited by : Mr. M. R. Patil
(Sr. Engineer)
Verified by : Mr. A. R. Kumbhar
(Chief Engineer)
Entered by : Mrs. Madhura Kulkarni

FOR THITE VALUERS AND ENGINEERS PVT. LTD.

THITE VALUERS & ENGINEERS PVT. LTD.


(S. L. THITE)
PANEL VALUER
CORPORATION BANK

For: Mrs. Ashwini Phalke dated 16/01/2017

Scanned with OKEN Scanner

Ref. No.: PS-130/PJA17-109/MRP/A

Client Name :Mrs. Ashwini D. Phalke

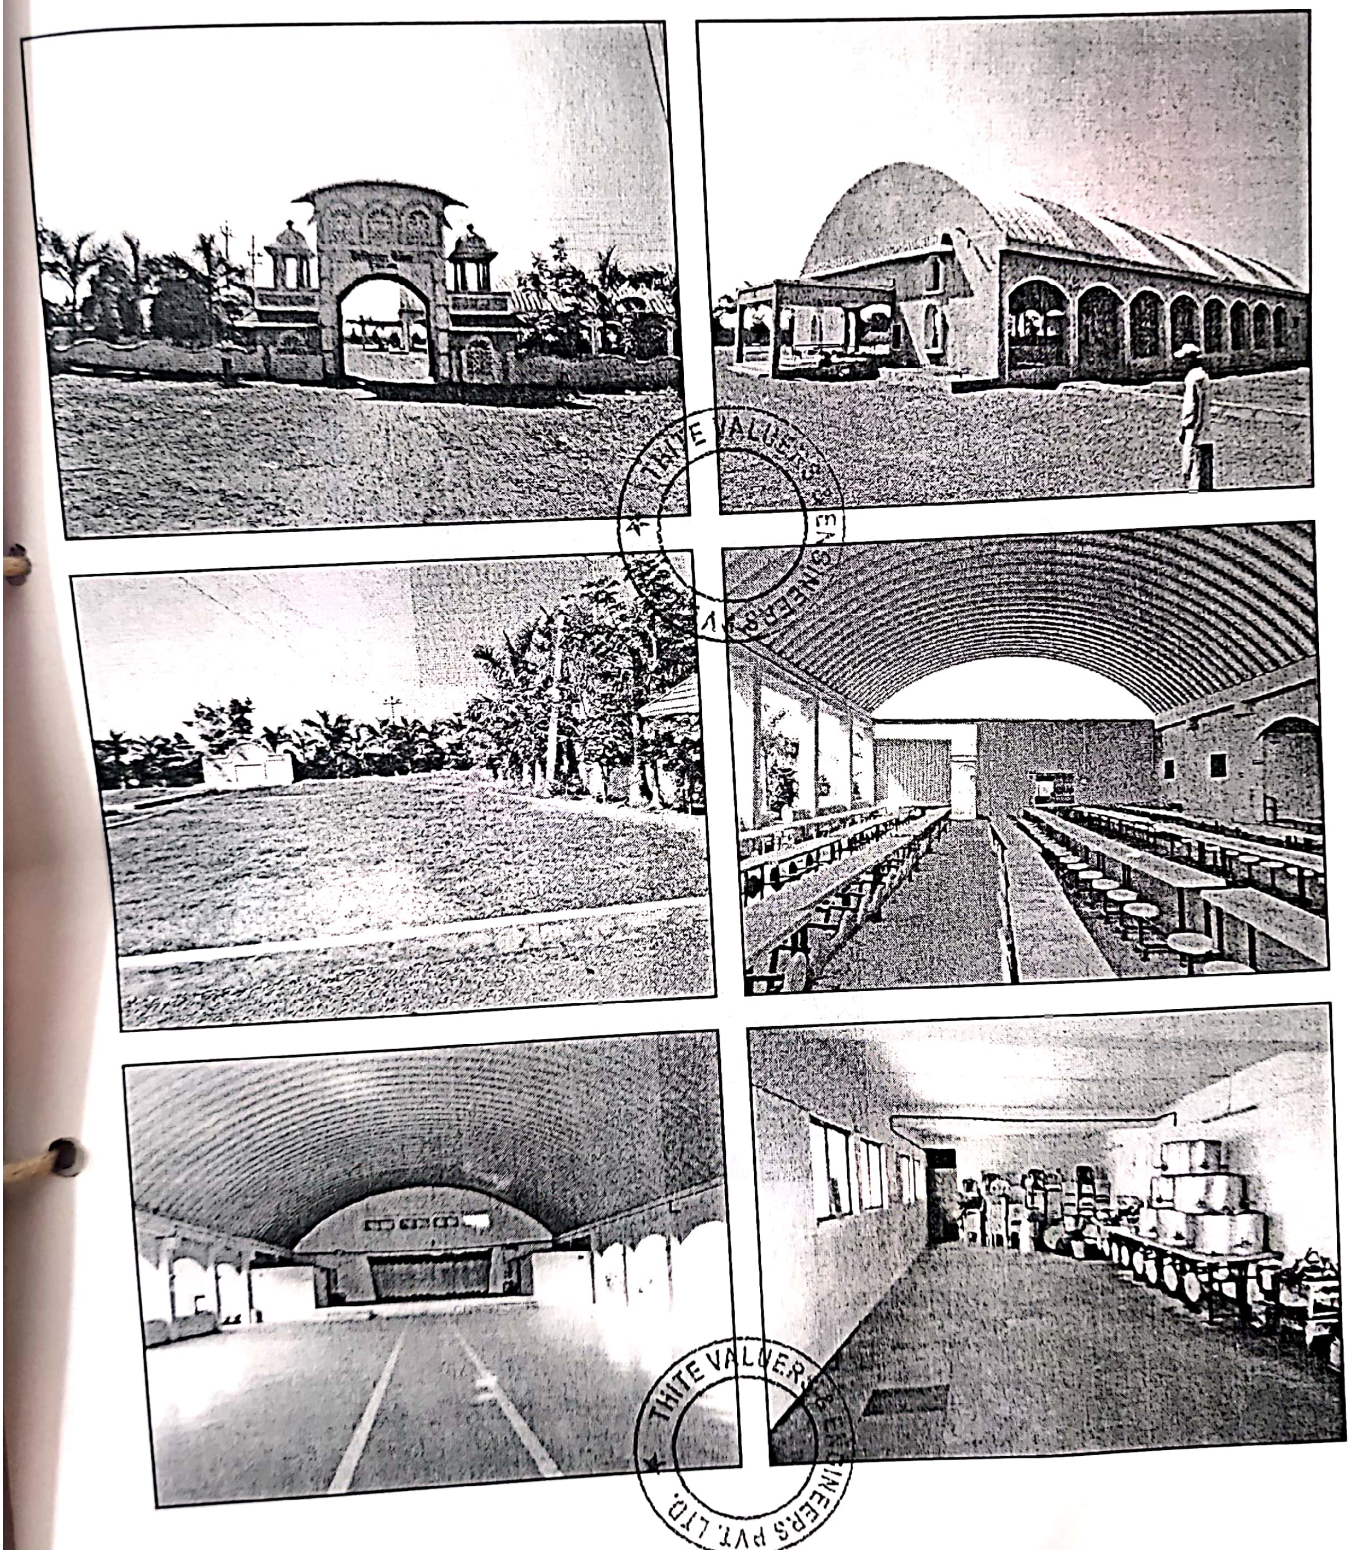

Scanned with OKEN Scanner