



**Office of the District Fire Officer,
Banshankari Fire Station,
Karnataka Fire & Emergency Services,
Banashanakari 2nd Stage, Bengaluru-560 070.**



No. 15/DFO/BFS/FSR-School/2026

Dated: 14-05-2026.

ANNEXURE – 1

Group - B Educational Building

NBC-2016, Part-4, Table 7(11) 3.1.3 Group B Educational Buildings Sub Division B1 & B2.

(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC-2016 are mandatory).

To,

The Authorized Signatory,

M/s. Arundhati Gurukulam,

Run by Navatma Trust,

No.2, Raghavasadanam, Pampa Mahakavi Road,

Uttaradi Math Compound, Shankarapuram,

Basavanagudi, Bengaluru-560 004.

Sir,

Sub : Issue of **"Fire Safety Recommendation"** with respect of fire prevention, fire fighting and evacuation measures required at **"M/s. Arundhati Gurukulam,** Run by Navatma Trust, No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004.

Ref : 1) Your request letter dated: 13-05-2026.

2) FSO Inspection report No: 14/FSO/BFS/2026 Date: 14-05-2026.

<<<<>>>

With reference to the subject cited above, the premises of **M/s. Arundhati Gurukulam,** Run by Navatma Trust, No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004. was inspected by the Fire Station Officer, Banshankari Fire Station, Bengaluru on 14-05-2026 with respect to Fire prevention, Fire fighting and Evacuation measures to be complied in the above premises and has submitted the details as under.

A. Details of the Building/premises .

1.	Name and address of the applicant	M/s. Arundhati Gurukulam, Run by Navatma Trust, No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004.
2.	Name and address of the premises.	M/s. Arundhati Gurukulam, Run by Navatma Trust,



		No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004.
3.	Name and address of the building owner	M/s. Arundhati Gurukulam, Run by Navatma Trust, No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004.
4.	Number of Buildings	: One Building.
5.	Number of floors	: Ground floor and 3 upper floors.
6.	<u>Floor wise details of occupancy</u>	
	Ground floor	: Class Rooms-08, Office Rooms-02,
	First floor	: Class Rooms-08,
	Second floor	: Class Rooms-08,
	Third floor	: Open Hall, Room
7.	Height of the building	: 14.80 mtrs.
8.	Site area	: 3 Acres.
9.	Built-up area of each floor:-	
	Ground floor	: 656.63 Sq. mtrs.
	First floor	: 656.63 Sq. mtrs.
	Second floor	: 656.63 Sq. mtrs.
	Third floor	: 262.65 Sq. mtrs.
10.	Total built-up area	: 2,248.49 Sq.mtrs.
11.	Surrounding properties:-	
	East (Front)	: 12.00 mtrs wide Road.
	West (Rear)	: Residential Building.
	North (Side)	: Residential Building.
	South (side)	: Sathya Pramoda Kalyana Mantapa Building.
12.	<u>Set-back area available around the building :-</u>	
	East (Front)	: 6.50 mtrs
	West (Rear)	: Nil
	North (Side)	: Nil
	South (side)	: Nil




B. On inspection of the school building premises, the following fire prevention, fire fighting and evacuation measures are recommended considered absolutely essential from fire safety point of view:-

Sl. No (1)	Details (02)	Existing (03)		Recommendations (04)
1.	Accessibility to the premises	The premises is accessible from 12.00 mtrs wide roads located on the Eastern side. The road is hardened to carry the weight of 45,000 Kgs.		Complied.
2.	No. of entrances & Width	One Entrance width of 4.20 mtrs & One Exit width of 1.80 mtrs have been provided		Complied.
3.	Diesel generators.	01 Diesel Generator capacity of 40 KVA have been provided.		It should be connected to all fire fighting installations and emergency provisions in the building.
4.	Number of staircases available	No. of staircases	One	Complied.
		Width of staircases	1.00 mtrs.	
		Width of treads	26 cms.	
		Height of risers	17 cms.	
		Nos. of riser per flight	10 risers per flight	
		Height of handrails	0.90 mtrs.	
		Head room clearance	3.20 mtrs	
5.	No. of Lifts and Capacity	Nos. of lifts	----	Not Required
		Capacity of lifts	----	
6.	Portable Fire extinguishers	Not Provided.		A. One ABC Powder extinguisher of 06kg capacity should be placed available for every 100.00 Sq.mtrs of the built up area of each floors. B. One CO₂ type of 4.5kg Extinguisher should be Provided for Electrical Panel board and Electrical Room.



7.	First aid hose reel hose	Not Provided.	One hose Reel Hose of 19 mm size and of adequate length to reach the farthest point of the each floor, near the staircase shall be provided with a shutoff branch. The hose reel hose has been connected to an overhead tank.
8.	Terrace tank over respective tower terrace.	One Overhead RCC tank Capacity of 20,000 ltrs have been provided.	Complied.
9.	Underground static water storage tank.	One Underground Water tank capacity of 10,000 ltrs have been provided.	Complied.
10.	At the terrace tank level with minimum pressure of 3.5 kg/cm ²	Not Maintained.	An electrically driven pump capable of delivering 450 LPM at minimum pressure of 3.5 kg/cm ² shall be installed near the overhead tank.
11.	Escape routes	Not Marked.	Directions in which the students have to move in the event of an emergency shall be displayed in the corridor on each floor during evacuation.
12.	Fire order (Fire Safety plans)	Not Displayed.	Fire order shall be displayed in near staircase landing at each floor. This shall be contains the telephone of Fire Control Room i.e. 101, 080-22971500, 080-22971550, 080-22971600 & of 080-22971539 of Banashankari Fire Station.
13.	Fire Siren	Not installed.	A Fire Siren shall be installed in the premises to inform the inmates in case of a fire and emergency and evacuate the area.
14.	No smoking board.	Not Displayed.	COPTA Sec-4, direction "No Smoking area smoking here is an offence" board should be written in English & Kannada both languages shall be prominently displayed at inside the entry/exit of the each floor.

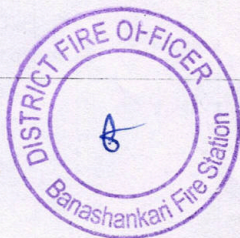

15.	Electrical cables on termination points in the electrical panel and distribution boxes.	Not coated.	Electrical cables on termination points in the electrical panel and distribution boxes should be coated with certified Transparent Fire Retardant Coating.
16.	Fire Fighting training	Not Trained.	40% of the staffs/Teachers shall be got trained in fire prevention, fire fighting & evacuation at R.A.Mundkur fire & emergency service Academy, Bannerghatta road, Bangalore-560 029.

Under the above circumstance, the Karnataka Fire & Emergency Services Department is issuing **Fire Safety Recommendation** to "**M/s. Arundhati Gurukulam**, Run by Navatma Trust, No.2, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru-560 004." subject to condition and compliance of the above recommendations in Column-4 of Part-B within 3 months and compliance from the undersigned.


Note: This Fire Safety Recommendation Report is issued from the fire prevention and fire fighting point of view Karnataka State Fire & Emergency Services Department is not responsible for the ownership of the land, its location and other disputes, which may arise in due course.

"In case the fire prevention and fire fighting measures installed in the building as per the recommendation of the department are not maintained in good working condition, if the evacuation measures are not properly followed and if any additional construction work is taken up in the building/premises, This Fire Safety Recommendation deemed to be cancelled and necessary legal action will be initiated against developer/management/ tenant. And also separate NOC has to be obtained from the department for storage of Chemicals, Solvents, Petroleum products(Petrol/Diesel), LPG etc., in the building/premises."

"This Fire Safety Recommendation is valid for only one year from the date of issue".

All requirements recommended above are as per National Building Code-2016 Part-4 clause 3.1.3 of Fire and Life safety will have to be complied with mandatorily.

Yours faithfully,

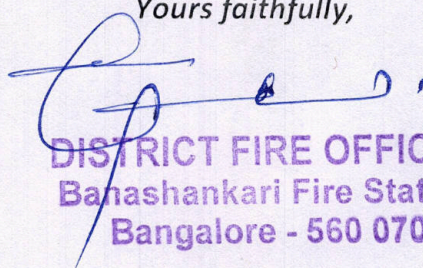
DISTRICT FIRE OFFICER
Bahashankari Fire Station
Bangalore - 560 070



ಚಲನ್ ಚಾಲ್ತಿ ಅವಧಿ Challan Validity	ಜಿಲ್ಲೆ District	ಇಲಾಖೆ Department	ಡಿಡಿಓ ಕಛೇರಿ DDO Office	
7 Days	BENGALURU URBAN	DEPARTMENT OF KARNATAKA FIRE & EMERGENCY SERVICES	DIVISIONAL FIRE OFFICE, KARNATAKA FIRE AND EMERGENCY SERVICES, BANGALORE SOUTH RANGE, BANGALORE	
ವರ್ಗ Category	ದಿನಾಂಕ Date	ಚಲನ್ ಉಲ್ಲೇಖ ಸಂಖ್ಯೆ Challan Reference Number	ಡಿಡಿಓ ಕೋಡ್ DDO Code	
Government	14/05/2026 16:17:23	CR0526007000130276	140050	
ಸಂದಾಯದಾರನ ಹೆಸರು Remitter Name		Arundhati Gurukulam	ಮೊಬೈಲ್ ಸಂಖ್ಯೆ Mobile Number	9611171540
ವಿಳಾಸ Address	NAVATMA, No.2, Arundhati Gurukulam, Raghavasadanam, Pampa Mahakavi Road, Uttaradi Math Compound, Shankarapuram, Basavanagudi, Bengaluru.560004.			
ಉದ್ದೇಶ Purpose	ಲೆಕ್ಕ ಶೀರ್ಷಿಕೆ Head of Account	ಉಪ ಉದ್ದೇಶದ ಹೆಸರು Sub Purpose Name	ಉದ್ದೇಶ ನಿರ್ದಿಷ್ಟ ಐಡಿ Purpose Specific ID	ಮೊತ್ತ Amount
COLLECTION OF FEES AND OTHER RECEIPTS FROM FIRE DEPARTMENT	0070~60~109~0~02~000	12.FOR ISSUE OF ADVISE ON FIRE PREVENTION AND FIRE FIGHTING FOR NON HIGH RISE BUILDINGS.	NA :	22000.00
ಸಂದಾಯ ಮಾಡುವ ಬ್ಯಾಂಕ್ Remittance Bank	State Bank of India e Pay	ಒಟ್ಟು ಮೊತ್ತ Grand Total	22000.00	
		ಒಟ್ಟು ಮೊತ್ತ ಅಕ್ಷರಗಳಲ್ಲಿ Total Amount in Words	Twenty Two Thousand Only	
ಪಾವತಿ ವಿವರಗಳು\Payment Details				
ಪಾವತಿ ವಿಧ Payment Mode		Netbanking		

*ನಿಮ್ಮ ವಹಿವಾಟನ್ನು ಸಂಸ್ಕರಿಸಲಾಗಿದೆ. ಮುಂದಿನ ಉಲ್ಲೇಖಕ್ಕಾಗಿ ದಯವಿಟ್ಟು ವಹಿವಾಟಿನ ಸಂಖ್ಯೆಯನ್ನು ಬರೆದಿಟ್ಟುಕೊಳ್ಳಿ. ವಹಿವಾಟು ಸಂಖ್ಯೆ

Your Transaction has been processed. Please note the Transaction number for future reference. Transaction No. 1488522408735

*ಕ್ರೆಡಿಟ್ ಕಾರ್ಡ್/ಡೆಬಿಟ್ ಕಾರ್ಡ್ ಮೂಲಕ ಮಾಡಿರುವ ಎಲ್ಲಾ ಪಾವತಿಗಳ ಮೇಲೆ ಹೆಚ್ಚುವರಿ ಸೇವಾ ಶುಲ್ಕ ಅನ್ವಯವಾಗುತ್ತದೆ. ಹಾಗೂ ಬ್ಯಾಂಕ್ ಅದನ್ನು ನೇರವಾಗಿ ಖರ್ಚು ಹಾಕುತ್ತದೆ.

Additional Service charges are applicable for all payments made through CC/DC and the same would be debited directly by the bank.

*ಯಾವುದೇ ಸಂದರ್ಭದಲ್ಲಿ ಸಂದಾಯದಾರನು ಶುಲ್ಕ ಮರುಪಾವತಿಯನ್ನು ಕೊರಬಾರದು

Under no circumstances the remitter will seek a Charge Back