Discharge Measurement Summary

Date Generated: Thu Jan 20 2022

File Information

File Name	08314000.81.WAD
Start Date and Time	2020/08/17 11:17:48

Site Details

Site Name	SILE CANAL
Operator(s)	MJW

System Information

Sensor Type	FlowTracker
Serial #	P3537
CPU Firmware Version	3.9
Software Ver	2.30
Mounting Correction	0.0%

Units (Metric Units)

Distance	m
Velocity	m/s
Area	m^2
Discharge	m^3/s

Discharge Uncertainty

Category	ISO	Stats
Accuracy	1.0%	1.0%
Depth	0.2%	0.0%
Velocity	0.3%	1.0%
Width	0.2%	0.2%
Method	1.1%	-
# Stations	3.9%	-
Overall	**4.2%**	**1.4%**

Summary

Averaging Int.	40	# Stations	13
Start Edge	LEW	Total Width	1.829
Mean SNR	22.6 dB	Total Area	1.799
Mean Temp	22.92 °C	Mean Depth	0.983
Disch. Equation	Mid-Section	Mean Velocity	0.7985
		Total Discharge	**1.4362**

Measurement Results

St	Clock	Loc	Method	Depth	%Dep	MeasD	Vel	CorrFact	MeanV	Area	Flow	%Q
0	11:17	0.00	None	0.000	0.0	0.0	0.0000	1.00	0.0000	0.000	0.0000	0.0
1	11:17	0.15	0.2/0.8	1.073	0.2	0.858	0.6569	1.00	0.6298	0.164	0.1030	7.2
1	11:19	0.15	0.2/0.8	1.073	0.8	0.215	0.6027					
2	11:21	0.30	0.8/0.2	1.073	0.2	0.858	0.8084	1.00	0.7973	0.164	0.1304	9.1
2	11:20	0.30	0.8/0.2	1.073	0.8	0.215	0.7862					
3	11:22	0.46	0.2/0.8	1.073	0.2	0.858	0.8796	1.00	0.8132	0.164	0.1330	9.3
3	11:23	0.46	0.2/0.8	1.073	0.8	0.215	0.7468					
4	11:25	0.61	0.8/0.2	1.073	0.2	0.858	0.9052	1.00	0.8121	0.164	0.1328	9.2
4	11:24	0.61	0.8/0.2	1.073	0.8	0.215	0.7191					
5	11:26	0.76	0.2/0.8	1.073	0.2	0.858	0.9161	1.00	0.8220	0.164	0.1344	9.4
5	11:27	0.76	0.2/0.8	1.073	0.8	0.215	0.7279					
6	11:30	0.91	0.8/0.2	1.073	0.2	0.858	0.9357	1.00	0.8518	0.164	0.1393	9.7
6	11:29	0.91	0.8/0.2	1.073	0.8	0.215	0.7679					
7	11:31	1.07	0.2/0.8	1.073	0.2	0.858	0.9383	1.00	0.8508	0.164	0.1391	9.7
7	11:32	1.07	0.2/0.8	1.073	0.8	0.215	0.7634					
8	11:35	1.22	0.8/0.2	1.073	0.2	0.858	0.9276	1.00	0.8458	0.164	0.1383	9.6
8	11:33	1.22	0.8/0.2	1.073	0.8	0.215	0.7641					
9	11:36	1.37	0.2/0.8	1.073	0.2	0.858	0.9049	1.00	0.8094	0.164	0.1323	9.2
9	11:37	1.37	0.2/0.8	1.073	0.8	0.215	0.7139					
10	11:39	1.52	0.8/0.2	1.073	0.2	0.858	0.8590	1.00	0.8146	0.164	0.1332	9.3
10	11:38	1.52	0.8/0.2	1.073	0.8	0.215	0.7702					
11	11:40	1.68	0.2/0.8	1.073	0.2	0.858	0.7445	1.00	0.7365	0.164	0.1204	8.4
11	11:41	1.68	0.2/0.8	1.073	0.8	0.215	0.7285					
12	11:41	1.83	None	0.000	0.0	0.0	0.0000	1.00	0.0000	0.000	0.0000	0.0


Rows in italics indicate a QC warning. See the Quality Control page of this report for more information.


Discharge Measurement Summary


Date Generated: Thu Jan 20 2022

File Information	
File Name	08314000.81.WAD
Start Date and Time	2020/08/17 11:17:48

Site Details	
Site Name	SILE CANAL
Operator(s)	MJW

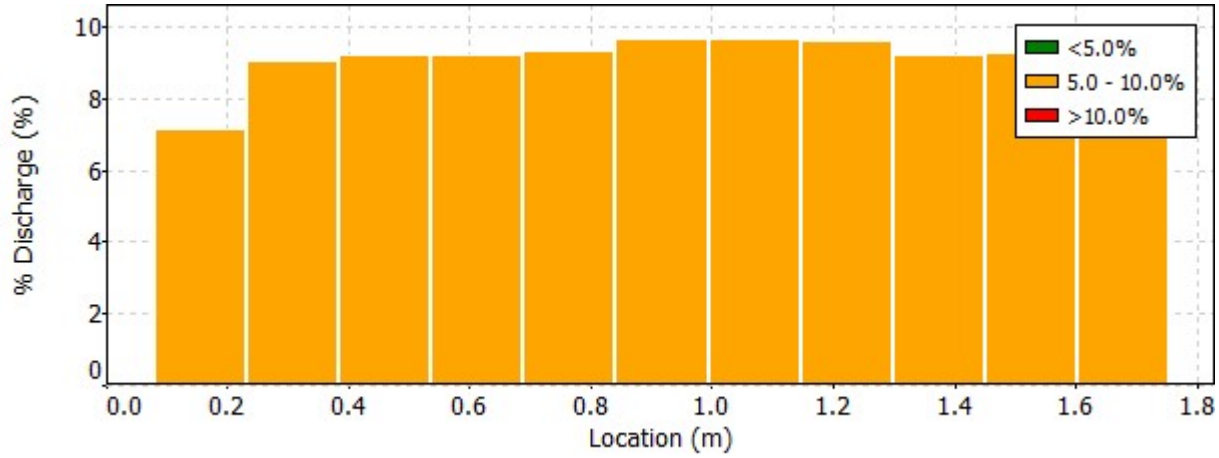

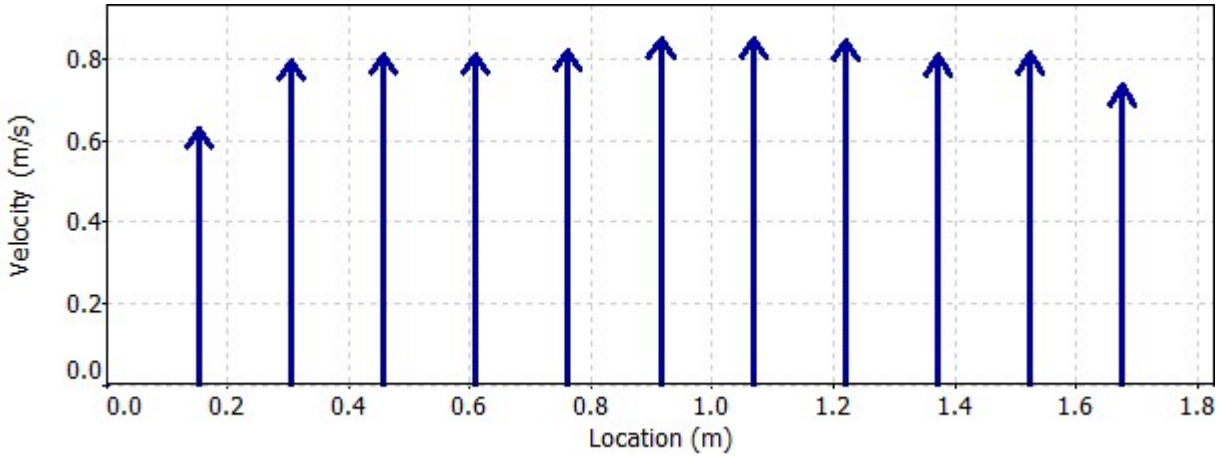

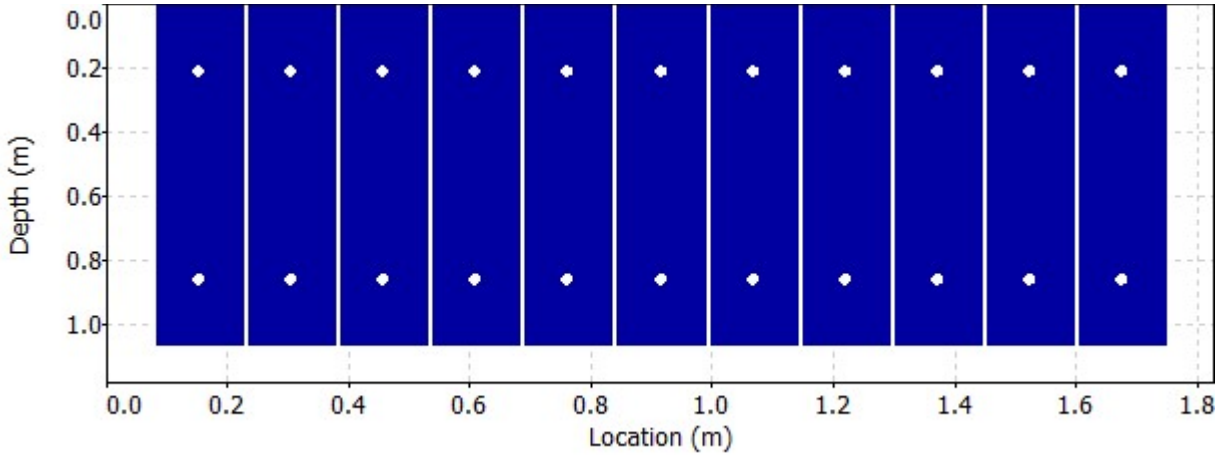

Discharge Measurement Summary

Date Generated: Thu Jan 20 2022

File Information	
File Name	08314000.81.WAD
Start Date and Time	2020/08/17 11:17:48

Site Details	
Site Name	SILE CANAL
Operator(s)	MJW

Quality Control


No Quality Control warnings

Discharge Measurement Summary

Date Generated: Thu Jan 20 2022

File Information		Site Details	
File Name	08314000.81.WAD	Site Name	SILE CANAL
Start Date and Time	2020/08/17 11:17:48	Operator(s)	MJW

Automatic Quality Control Test (BeamCheck)

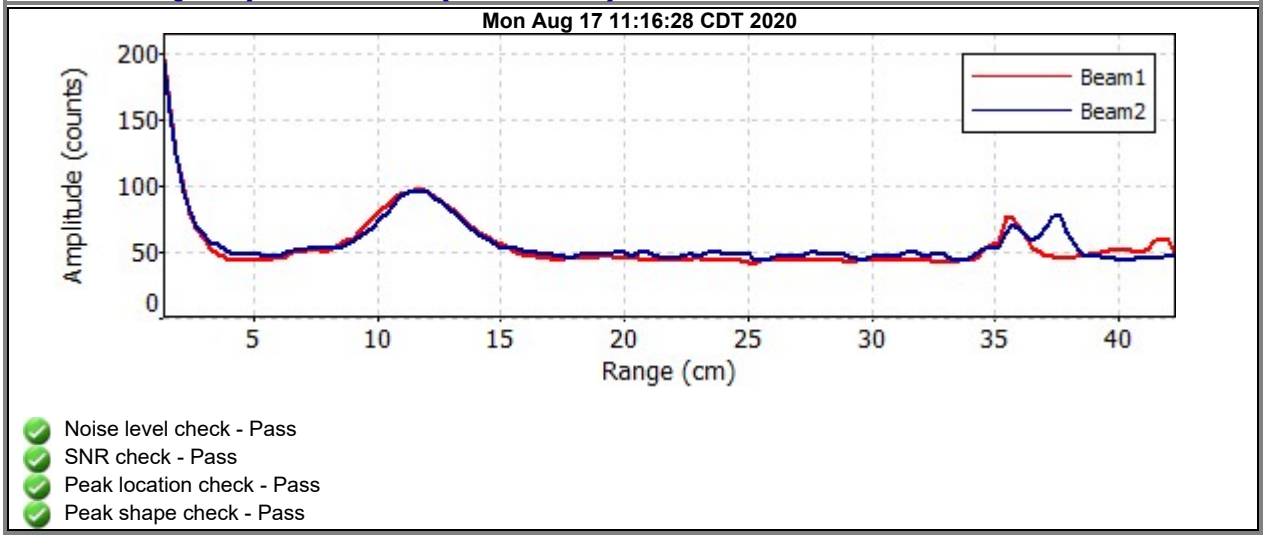

- Noise level check - Pass
- SNR check - Pass
- Peak location check - Pass
- Peak shape check - Pass