8D- Report

Contact Person (Customer):	Dominik Kieser		8D started on:	17.07.2025	ELEKTRA GmbH
Customer:	Elektra	Supplier:	AVO Carbon Germany GmbH		
Complaint number (Customer):	200000541	Complaint number (Supplier):	250705		Form: 840 01 04 Rev: 05

Select your language: English

Material name:	Kohlebürste	Drawing no.	O000003237
Material number:	10000705-00	Drawing revision	B

Claim: **in progress**

D1 - Team

8D - Team

Name (Header)	Position	Phone	Email
Joachim Gehl	Qualitymanagement	1723889953	joachim.gehl@avocarbon.com
Name (Problem solving team)	**Position**	**Phone**	**Email**
Khaled Amri	Logisitk		khaled.amri@avocarbon.com
Gabriel Gebretzki	Packaging		

D2 - Problem description

Describe the problem fact based
die KB 1026620 war in KB 1026621 vermischt.

2 Kartons einer unbekannten KB waren auf der Palette von 1026621 vermischt,

Why is it a problem?
die falschen KB können nicht in den Bürstenträgern verbaut werden

How was it discovered?
bei Line stop

When did it occur?
14.07.2025

How many parts are affected?
unbekannte KB: 2 Kartons = 5000 Teile
KB 1026620 - unbekannte Stückzahl

Who discovered it?
Produktionsmitarbeiter

Where was it discovered?
in der Produktion

Drawing, Photo, Sketch

When more space is needed for illustrations. Images

1. Soll: Kohlebürste 10000705-00 / Lieferschein: 555254

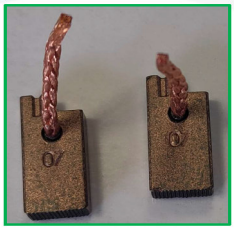

Menge: 5.000 Stück = 2x Kartons
Kohle wird bei Elektra nicht verwendet.

2. Soll: Kohlebürste 10000705-00 / Lieferschein: 555254

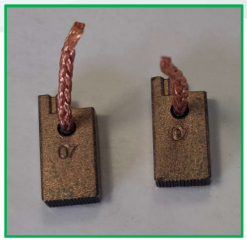

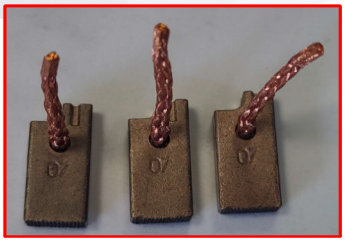

Menge: 30.000 Stück suspekt
Kohlebürste 10000705-00 ist vermischt mit Kohlebürste 10000706-00.

☑ First occurrence defect ☐ Repetitive defect

Suspected quantity at the customer:	30.000	Suspect Quantity in transport:	0
Suspected faulty quantity at the supplier:	0	If yes, delivery note number:	
Are further part numbers affected, if YES which ones:	0		

D3 - Containment actions

Containment actions	Date	Responsible	Status		
Register the complaint + Quality alert	16.07.2025	Joachim Gehl	x	x	x
Check the production-, quality- and maintenance data	16.07.2025	Joachim Gehl	x	x	x
Information of all department leader during shop floor meeting QRQC	17.07.2025	Joachim Gehl	x	x	x

Status:	Open				In processing	X			Closed	X	X		Validated	X	X	X

First delivery after implementation of containment actions

Identification (with) Label	Responsible	Delivery date/CW	Delivery note number	Remarks