Assymex Monterrey S.A. de C.V.

QUALITY CONTROL REPORT (10D)

QCR	18799	Date:	24-09-2024
AssyMex Contact / Title:	Leticia Castillo	Customer Contact / Title:	Martin Sosa
Contact Phone:		Contact Phone:	8128607691
Email:	leticia.castillo@avocarbon.com	Contact Email:	martin.sosa@irt-products.com

ONLY FILL THIS SECTION FOR INTERNAL SITUATIONS DETECTED AT ASSYMEX PLANT

- ☐ INTERNAL PPM
- ☐ EXTERNAL AUDIT BY CUSTOMER
- ☐ EXTERNAL AUDIT BY IATF
- ☐ INTERNAL AUDIT BY IATF
- ☐ INTERNAL METRIC:
- ☐ OTHER:

ONLY FILL THIS SECTION FOR QUALITY PROBLEMS DETECTED WITH CUSTOMER

- ☐ **Level 1 - Customer Return** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary. Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☐ **Level 2 - Quality Rejection** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary. Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☐ **Level 3 - Quality Concern** - Description of Root Cause & Corrective Action Plan are mandatory within 5 days. All Incoming stock 100% certified.
- ☐ **Level 4 - Notification** - All Incoming stock 100% certified.

WHAT IS THE PROBLEM ? > Use 4W + 2H to know what is the Current Situation ? Customer View and AssyMex View

- What happened? *Description of the Problem*	Brushcard without ferrite on inductor	- Why is it a problem?	Low perfomance of motor (low inductance)

BAD PART

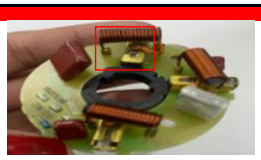

Lack of ferrite.

GOOD PART

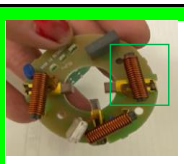

With ferrite on inductor

- When it happened? *Date: dd-mm-yyyy*	24-09-2024	- Where detected? *Incoming, Production Line, Customer, Warranty, etc.*	In production line Trico
- How detected?	Visualy	- How many bad parts?	1

Additional Information for Customer

Customer Part Number:	95015-94	AssyMex Part Number:	33-0152
Customer Lot Number:	23/08/2024	AssyMex Lot Number:	23624
Customer Inventory:	1,344	AssyMex Inventory:	1300
In Transit Inventory:	0	Logistic Platform Inventory:	0

Material Disposition

- ☐ Return to Supplier. RMA #
- ☐ Sort by Supplier.
- ☐ Sort / Rework by External Company WO #
- ☐ Scrap. Supplier's expense.
- ☐ Use as received
- ☐ Sort / Rework by AssyMex WO #

CORRECTIVE ACTION REPORT - 10D REPORT

1.- Problem Solving Team Members

Leader:	Leticia Castillo	Title:	Quality Enngenier	Phone:	8117945185
Email:	leticia.castillo@avocarbon.com	Fax:		Mobile:	

Group: Sughey Rangel, Matilde Serrano, Marco Estrada, Ramses Rendon, Alicio Flores

2.- Describe the Problem

Inductor without ferrite

- Was part reworked by supplier ?	NO	- When was it manufactured ?	24/09/2024
- Are we capturing the defect when reinjecting product in normal process ? If YES, explain how ?	NO	- Did a similar problem happen previously at AssyMex or internally ? If YES, when ?	NO

3.- Immediate Countermeasures / Problem Containment ? (24 hours)

IMMEDIATE COUNTERMEASURES IN SUPPLIER PERIMETER	RESPONSIBLE	DATE	WHERE?
Inspection visual 100%	Daniel Morales	24/09/2024	Trico Plant

IMMEDIATE COUNTERMEASURES IN AssyMex PERIMETER	RESPONSIBLE	DATE	WHERE?
Inspection visual 100%	Leticia Castillo	24/09/2024	Assymex

Sorting Activity >> by Supplier

	Total Sorted	Total Bad Parts		PPM	Sorting Date	Responsible
- Suspect Inventory in Customer plant :	1344	4	=	2976.190476	24/09/2024	Daniel Morales
- Suspect Inventory in AssyMex plant :	1300	0	=	'----'	24/09/2024	Leticia Castillo
- Suspect Inventory in Transit :	NA		=	'----'		
- Suspect Inventory in Logistic platform :	NA		=	'----'		
- Suspect Inventory in Supplier plant :	0	0	=	'----'		

Identification of OK Parts

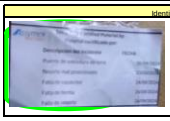

Certification label per box

- Production dates of sorted parts:	From: 23-08-2024	To: 24-09-2024
- Production dates of bad parts:	Oldest part: 23-08-2024	Most recent part: 23-08-2024

First Certified Good Shipment	Lot Number:	269
	Date:	24-09-2024