8D report

Customer plant:	Dunkermotoren	**Supplier:**	AVO Carbon Germany	**Date of claim:**	15.05.2025
Customer contact:	Hardy Huber	**AVO contact:**	Joachim Gehl		
Customer reference:	200232681	**AVO reference:**	250503		

QUICK RESPONSE (D1-D3)
This document must be issued within 24 hours after claim notification

D 1. Description of the problem

1.a What is the problem? Use 5W+2H to describe what is the current situation.

Problem description	Kanten ausgebrochen	What happened	Kanten ausgebrochen
		Why is it a problem	?
Incident type	Customer claim		
Part number AVO	1020510 / 27579.52267	When did it happen	?
Part number Customer	BUERSTE GR63 QUAL. 14501	Who detected it	Mitarbeiter im Wareneingang
Batch number	284680	Where was it detected	bei Wareneingangsprüfung
Recurrence	Non-recurrent	How was it detected	bei Sichtprüfung
Defect S/R	No	How many bad parts	12 von 25 geprüften Teilen
Standard process used	Yes		
When was the part produced?	Pressing machine => 13.02.2025 - 17.02.2025 Presse K15 - 6070 Grinding machine =>		

nOK part picture/ sketch

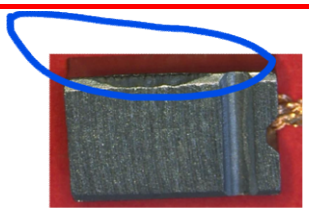

OK part picture/ sketch

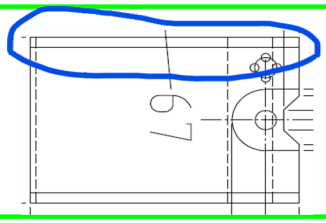

1.b Problem solving team

Name	Position	Location	E-mail
Joachim Gehl	Quality Management	AVO Germany	joachim.gehl@avocarbon.com
Gunther Luschtinetz	Quality Management	AVO Germany	gunther.luschtinetz@avocarbon.com
Martin Röhr	Production	AVO Germany	
Mustafa Yorulmaz	Production	AVO Germany	
Khaled Amri	Logistic	AVO Germany	

1.c Tools to use

Yes	Ishikawa	5why's	LLC	Audit	Other

1.d First analyse of problem / potential root causes

Potential root cause(s): nicht sachgemäß eingespannter Fasenschleifstift; nicht vollständig gefüllte Kavität; beschädigter Unterstempel;
Bitte stellen sie uns zur Analyse NIO_Muster zur Verfügung.
If you use our expressnumber, please use only economic express.

Samples of nok parts required in plant for analyse: Yes

Express shipping number account: FedEx 186141300

D 2. Risk on similar products and processes

Can this defect happen on similar parts?

Other family product	Yes
Other line	---
Other tools/work station	Yes
Other	---

Comments (compulsory, if yes)

Die festgestellten Fehler können bei gegebenen Voraussetzungen bei allen Produkten / Maschinen auftreten

D 3. Containment

Sorting criterias (add additional sheets if needed)

Location in the supply chain	N° of involved parts	N° parts sorted	N° nok parts	Ppm	Date	Responsible
Parts at customer	16.111	0	---	---	---	Hardy Huber
Parts in transport	0	0	0	0	---	---
Parts at AVO Germany stock	0	0	0	0	---	Joachim Gehl
Parts at AVO production	0	0	0	0	---	Joachim Gehl

First contained shipment information

Immediate actions to prevent production and delivery of nok parts ?

Containment actions	Responsible	Date planned	Date closed
Register the complaint + Quality alert	Joachim Gehl	19.05.2025	19.05.2025
Check the production-, quality- and maintenance data	Joachim Gehl	19.05.2025	19.05.2025
Information of all department leader during shop floor meeting QRQC	Joachim Gehl	19.05.2025	19.05.2025