

Preliminary Report No.: CANPC25029887901

Date: Dec 12, 2025

Page 1 of 5

Client Name: EARTH4EARTH TECHNOLOGY LTD

Client Address: 85 GREAT PORTLAND STREET LONDON ENGLAND W1W 7LT

Sample Name: L10 low carbon bricks

Refer No.: SHIN2512000594CPC01

Manufacturer: earth4Earth Technology (Wuhan) Co., Ltd.

Material and Mark: Clay + Additives

Product Specification: For both internal and external brick

The above sample(s) and information were provided by the client.

SGS Job No.: GZPC2512008047

Sample Receiving Date: Dec 01, 2025

Testing Period: Dec 01, 2025 ~ Dec 12, 2025

Test Requested: Select test(s) as requested by the client.

Test Method(s): With reference to EN 16516-2017.
Testing was performed by Environmental Chamber (0.05m³),
followed by sampling using Tenax-TA and DNPH tube, analysis using
Thermodesorption System with Gas Chromatography Mass Spectrometry
(TDS-GC/MS) and High Performance Liquid Chromatography-DAD
(HPLC-DAD).

Test Result(s): Please refer to next page(s).

Signed for and on behalf of
SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch

Jessie-JX Li
Approved Signatory

Test Result(s):

Test Part Description:

SN ID	Sample No.	SGS Sample ID	Description
SN1	001	CAN25-0298879-0001.C001	Gray solid

Remarks:

- (1) 1 mg/kg = 1 ppm = 0.0001%
- (2) MDL = Method Detection Limit
- (3) ND = Not Detected (< MDL)
- (4) "-" = Not Regulated

Volatile Organic Compounds(VOC)

No.	Compound Name	CAS No.	Results [µg/m³]	Calculated results in model room [µg/m³]	Carcinogenic [Y]
			3days		
1		-	-	-	-
2		-	-	-	-
3		-	-	-	-
4		-	-	-	-
5		-	-	-	-
6		-	-	-	-
7		-	-	-	-
8		-	-	-	-
9		-	-	-	-
10		-	-	-	-
11		-	-	-	-
12		-	-	-	-
13		-	-	-	-
14		-	-	-	-
15		-	-	-	-
16		-	-	-	-
17		-	-	-	-
18		-	-	-	-
19		-	-	-	-
20		-	-	-	-
21	TVOC	-	ND	ND	
22	TSVOC	-	ND	ND	

Remark:

1. ND=not detectable (<MDL)
2. MDL= 5.0µg/m³ (Except carcinogens), MDL= 1.0µg/m³ (Carcinogen)
3. µg/m³ = micrograms per cubic metre
4. Results were based on semi-quantitative analysis and calculated by toluene TIC calibration curve.
5. Qualitative analysis bases on the NIST & Wiley Library search results. Substance name will be provided when substance searched by NIST & Wiley library is of a similarity > 85%. "Unknown" will be provided when substance searched by NIST & Wiley library with a similarity < 85%.
6. > = exceed the range of calibration curve.
7. * = saturated peak was found in the chromatogram
8. Calculated VOC concentrations in the model room (model room volume = 31.4 m³ and air exchange rate = 0.5 h⁻¹)

Carbonyl Compounds

Compound Name	CAS No.	Results in chamber [µg/m ³]	Calculated results in model room [ppm]
		3days	
Formaldehyde	50-00-0	ND	ND
Acetaldehyde	75-07-0	ND	ND

Remark:

1. ND=not detectable (<MDL.)
2. MDL= 2.0µg/m³
3. Calculated VOC concentrations in the model room (model room volume = 31.4 m³ and air exchange rate = 0.5 h⁻¹)


Test condition

Chamber volume (m ³)	0.05
Test temperature (°C)	23±1
Relative humidity (rH%)	50±3
Air exchange rate (1/h)	0.5
Loading factor (m ² /m ³)	whole
Tenax-TA sampling flow (mL/min)	200
Tenax-TA sampling time (min)	25
Tenax-TA sampling volume (L)	5
DNPH sampling flow (mL/min)	300
DNPH sampling time (min)	60
DNPH sampling volume (L)	18


Chromatogram:

VOC

丰度

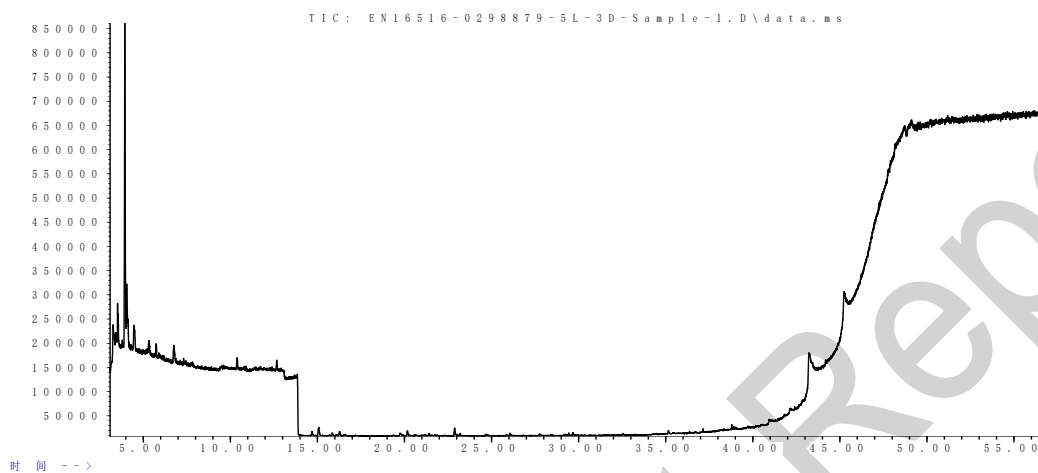


Carbonyl Compounds

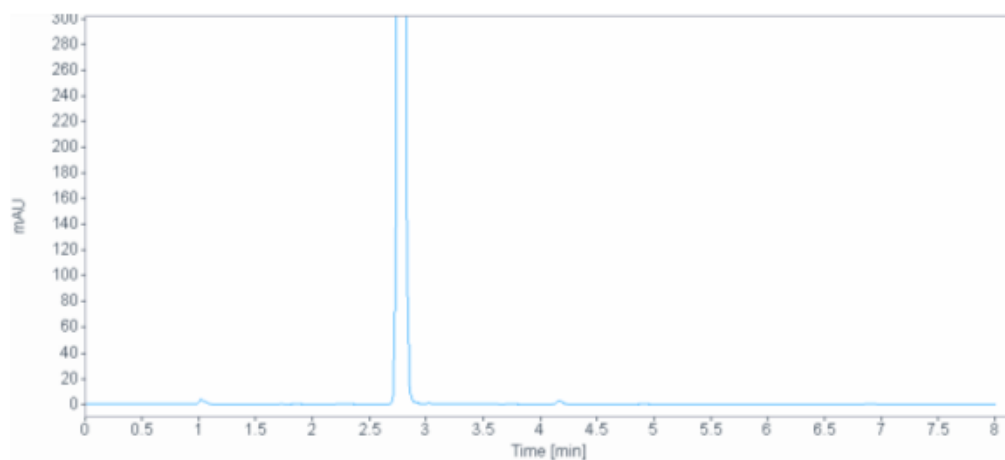

Unless otherwise stated, the decision rule for conformity reporting is based on Binary Statement for Simple Acceptance Rule ($w=0$) stated in ILAC-G8:09/2019.

Sample Photo:

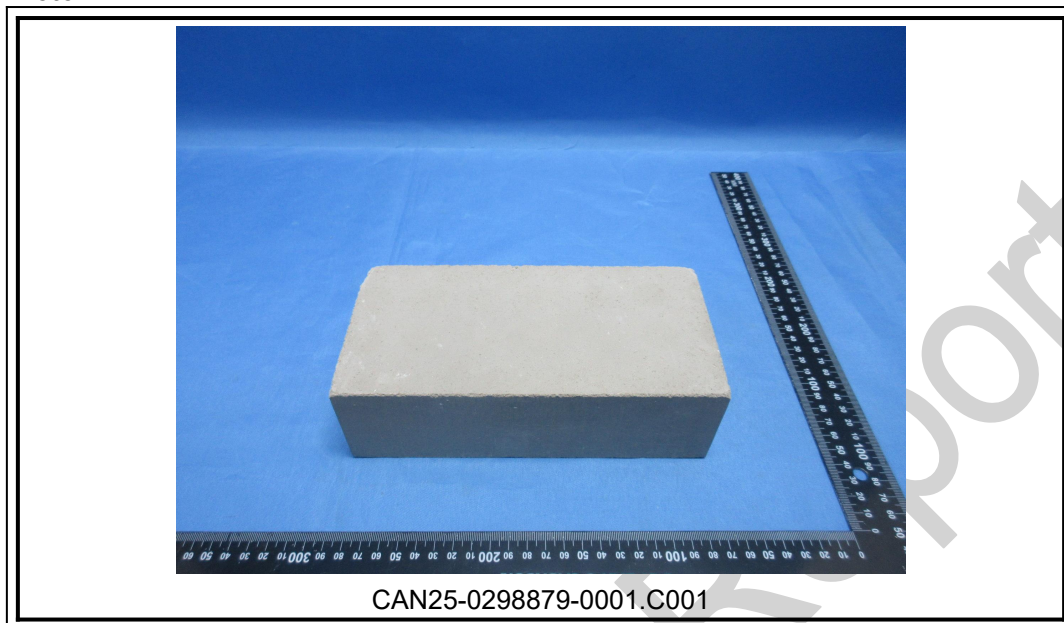

SGS authenticate the photo on original report only
*** End of Report ***