

TAX INVOICE

Ashburton Kingdom Hall of Jehovah's Witnesses
264 Cameron Street
Ashburton 7700

Invoice Date
20 Feb 2025

Invoice Number
INV-000719

GST Number
077-379-177

Active Maintenance
21 Waymouth Street,
Fairton, Ashburton, 7700
M 021 483 376
E steven@active.mbol.nz
W active.mbol.nz

Description	Quantity	Unit Price	Amount NZD
Heat pump maintenance to Toshiba Ceiling Cassette in Main Auditorium.	1.00	130.00	130.00
20/02/15 - Carried out 30 point check, found noisy vibration, filter badly blocked, and indoor unit coil very dirty. Outdoor unit had debris inside the unit partially blocking the drain channel. Removed cover and filter, scrubbed, washed and left to dry. Removed top cover from outdoor unit and removed debris from inside outdoor unit around and under outdoor unit. Applied coil cleaner and washed coil and fan blade and fan blade cover. Washed and flushed out drain and channel and made sure flowing clear. Fitted back top cover and secured. Removed fan cowling, removed controller box from position. Applied coil cleaner, washed indoor coil, and scrubbed coil thoroughly. Forced water into drain and flushed out drain and made sure flowing clear, applied coil deodorizer to coil.. Fitted back all covers and secured. Checked operation heating 55 degrees / cooling 7 degrees. Working well. * I would recommend filter be cleaned every 3 months *i			
Heat pump maintenance to MHI high wall heat pump in Side Meeting Room.	1.00	110.00	110.00
20/02/15 - Carried out 30 point check, found filters dirty, indoor unit coil OK, drum fan blade and cowling dirty. Outdoor unit had debris inside the unit partially blocking the drain channel, found drain elbow completely blocked with sludge. Removed covers and filters, scrubbed, washed and left to dry. Removed top cover from outdoor unit and removed debris from inside outdoor unit around and under outdoor unit. Applied coil cleaner and washed coil and fan blade and fan blade cover. Removed drain elbow and cleared, flushed out drain and channel. Fitted back top cover and secured. Applied coil cleaner, washed indoor coil, and scrubbed coil thoroughly. Using coil cleaner washed drum fan blade and flushed out drain and made sure flowing clear, applied coil deodorizer to coil.. Fitted back all covers and secured. Checked operation heating 45 degrees / cooling 12 degrees. Working, but not as efficiently as it should be . * I would recommend filters be cleaned every 3 months *			
Coil cleaner and deodorizer	2.00	10.00	20.00
Subtotal			260.00
TOTAL GST 15%			39.00

TOTAL NZD

299.00

Due Date: 27 Feb 2025


Thank you for your business.

Please make the payment in the bank account:

Active Maintenance

01-0190-0564535-00

Please enter invoice number as reference.

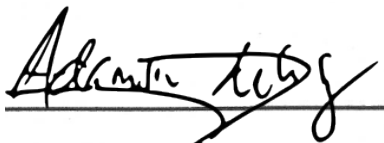

APPROVED BY:

Adamson dela Cruz



PAYMENT ADVICE

To: Active Maintenance
21 Waymouth Street,
Fairton, Ashburton, 7700
M 021 483 376
E steven@active.mbol.nz
W active.mbol.nz

Customer	Ashburton Kingdom Hall of Jehovah's Witnesses
Invoice Number	INV-000719
Amount Due	299.00
Due Date	27 Feb 2025
Amount Enclosed	
	Enter the amount you are paying above