
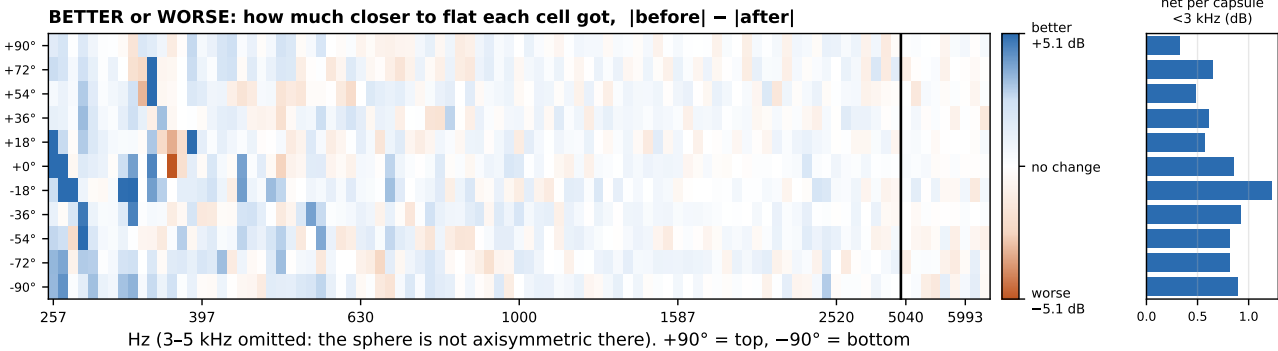
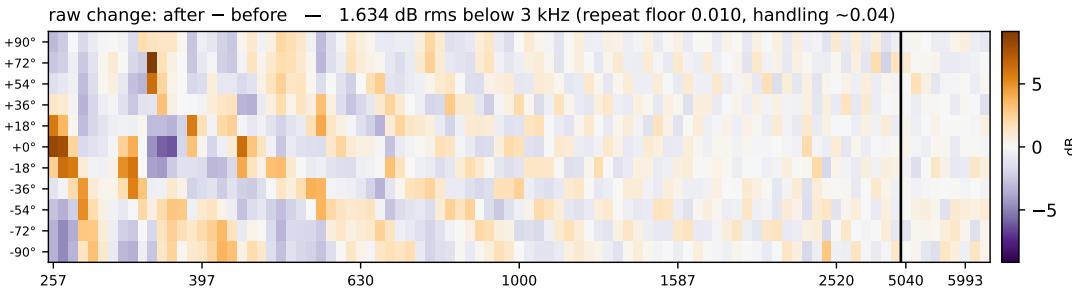
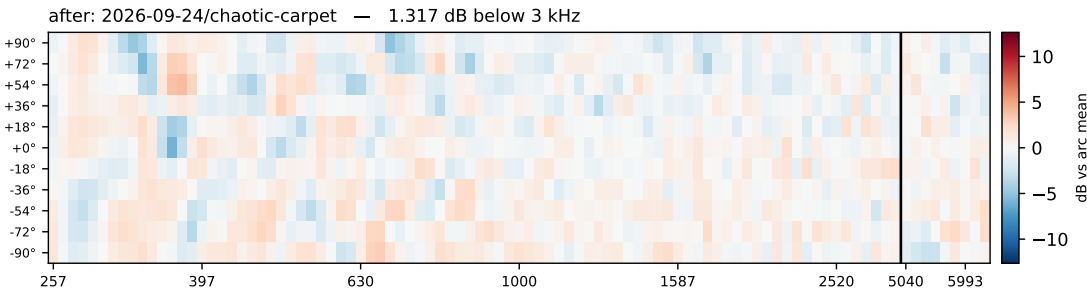
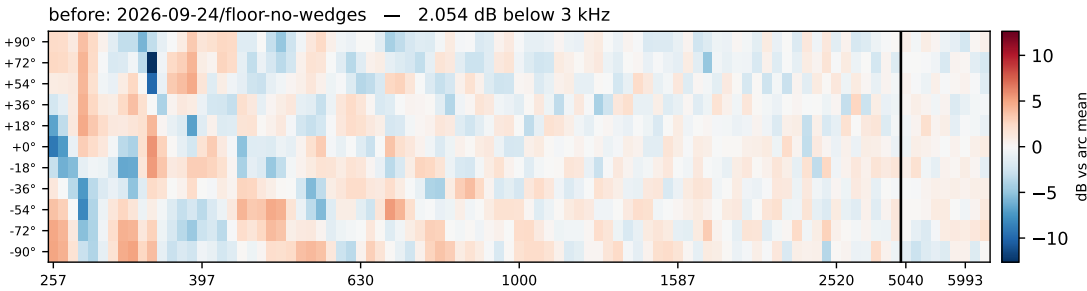


Carpet vs the empty floor (wedges off) · same afternoon, source not moved: room error below 3 kHz 2.054 → 1.317 dB (-0.737, better)

2026-09-24/floor-no-wedges → 2026-09-24/chaotic-carpet · below 3 kHz, 617 of 946 cells moved >0.05 dB toward flat and 287 away from it · 95 tones · 11 calibrated capsules

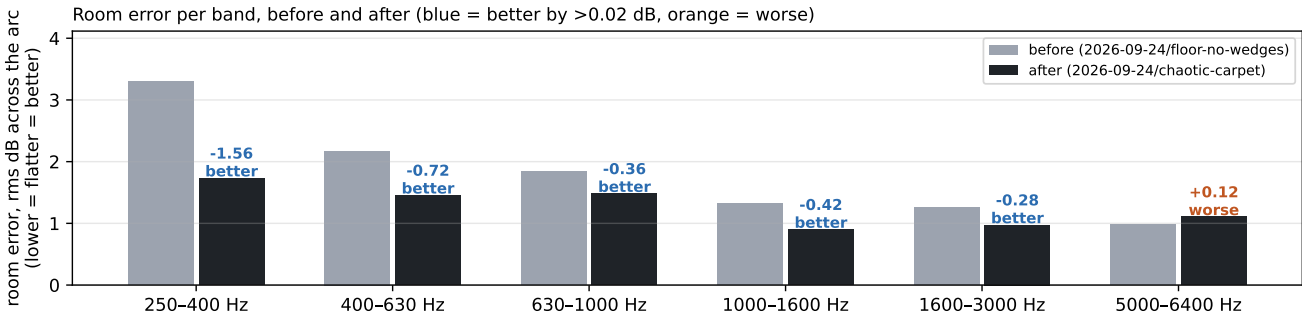

Evaluation and the prop-plane check

SoundVisualizer · 2026-10-01 · 11 calibrated capsules on a 0.84 m arc · 95 tones, 257 Hz–6.35 kHz · page 1: waterfall, 24 Sep afternoon, from the stripped floor on the source is in one position (tilt change vs the empty floor -0.02 / -0.02 / -0.03 dB per unit sin(ϕ) for the three carpet arrangements)

The method


Chambers are qualified one one-third-octave band at a time against the free-field ideal: reported as qualified between two bands, the cut-off the lowest band above which everything passes, noise and pure tones separately. Limits: ± 1.5 dB to 630 Hz, ± 1.0 dB from 800 Hz (Cunefare et al. 2003, J. Acoust. Soc. Am. 113(2), p. 882, quoted on page 3). **Our adaptation:** eleven fixed positions around an axisymmetric source, so the reference is the arc mean; **band level** = each capsule's mean over the 8–9 tones in the band, worst capsule against the limit; **pure tones** = share of single tone $\times$ capsule cells inside. Within ± 0.03 dB of a limit is marginal (the largest difference between two same-day runs of one unchanged state, 5 pairs).

BAND	LIMIT	TONES	EMPTY FLOOR	TONES IN LIMIT	CARPET ON IT	TONES IN LIMIT
250 Hz	± 1.5	3	5.71	36 %	0.59	88 %
315 Hz	± 1.5	8	2.60	28 %	1.41	62 %
400 Hz	± 1.5	8	2.05	36 %	0.87	75 %
500 Hz	± 1.5	8	2.25	44 %	1.09	57 %
630 Hz	± 1.5	8	1.64	52 %	1.37	69 %
800 Hz	± 1	8	1.42	42 %	1.14	52 %
1000 Hz	± 1	9	0.89	41 %	0.89	66 %
1250 Hz	± 1	8	0.72	61 %	0.64	83 %
1600 Hz	± 1	8	1.39	47 %	1.53	68 %
2000 Hz	± 1	8	0.98	65 %	0.87	76 %
2500 Hz	± 1	8	0.81	53 %	0.80	68 %

MEASURE	EMPTY FLOOR	CARPET ON IT
Room error below 3 kHz (dB)	2.054	1.317
Band-level qualified from	2000 Hz	2000 Hz
Bands clearly over the limit (of 11)	7: 250, 315, 400, 500, 630, 800, 1600 Hz	2: 800, 1600 Hz
Bands marginal	1: 2000 Hz	0: – Hz
Pure-tone cells inside the limit	47 %	68 %

Blue = inside, yellow = marginal, orange = over. The cut-off is set by the highest failing band, so read it with the lists. Three carpet arrangements, 14:37 / 14:48 / 14:57: room error 1.317 / 1.318 / 1.324; the table shows the first.

The prop-plane check: is the polar rounder than before?

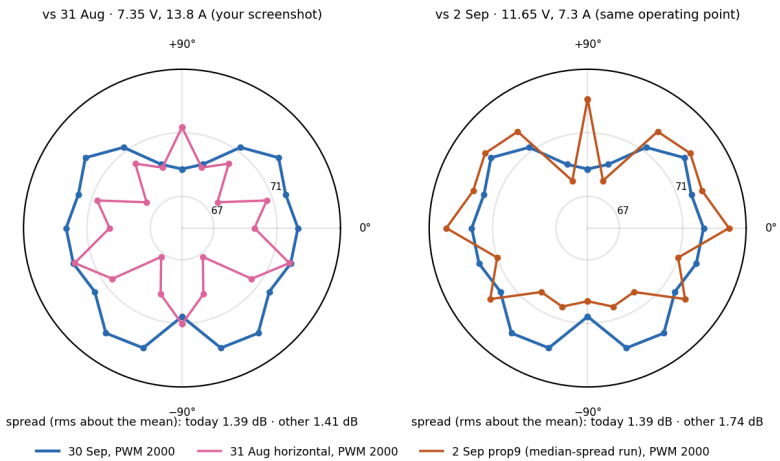

TONE-NOTCHED BROADBAND, 315 HZ–8 KHZ, CELLS WITHIN ± 1.3 DB OF THE POLAR MEAN	RUNS	PWM 2000: MEDIAN (RANGE)	WORST CELL	PWM 1900: MEDIAN (RANGE)
30 Sep, today	1	66 %	3.1 dB	72 %
2 Sep, same operating point (11.65 V, 7.3 A, -4.0 N)	10	71 % (65–79)	3.4 dB	76 % (65–84)
31 Aug (7.35 V, 13.8 A, $+6$ N: a different operating point)	5	65 % (38–68)	7.5 dB	62 % (38–66)

- Against 31 Aug the polar is clearly rounder where it counts: the worst capsule is 3.1 dB off the mean instead of 7.5 dB, and the 31 Aug runs range down to 38 % of cells in tolerance. That run is the one in the screenshot.
- Against 2 Sep, which had the same voltage, current and thrust, it is not rounder: 66 % against a median of 71 % (65–79), inside the scatter of the 2 Sep runs. Between 31 Aug and 2 Sep the supply went from 7.35 to 11.65 V.
- It is a prop-plane measurement. The ends of the arc read louder than its centre at 2 and 4 kHz by $+2.3$ and $+2.2$ dB today; the flat-arc runs, where the true difference is zero, show the same ($+1.5$ and $+4.3$ dB median). So that structure is position-fixed error, not directivity.

Semi-anechoic room solutions that apply to this chamber

What fails (accepted configuration, evaluated on its own): clearly over the ISO limit at 250, 500, 800, 1600 Hz, marginal at 630, 1250 Hz; the blade tone sits at 215–258 Hz and its third harmonic at 713 Hz. Nearest reflectors measured: extra path 0.68 m at -72° and 1.49 m at $+36^\circ/+54^\circ$, i.e. 1.98 and 4.34 ms. Source: chamber-fighting-guide.pdf §03, 29 facilities.

SOLUTION	WHAT THE PAPERS GIVE	APPLIES TO US?	WHAT WE ALREADY KNOW
1. Move the geometry (source, arc, reflector)	Sets the ceiling for everything else. Reaching 500 Hz needs every reflector ≥ 0.69 m of extra path, 250 Hz needs 1.37 m (gate ≥ 5 ms, Matelján, ARTA note 4).	Yes, first, free. The 0.68 m surface is just short for 500 Hz.	Source position was the largest lever in our trials: moving the speaker about 20 cm closer took the room error from 1.96 to 1.31 dB within one afternoon (25 Sep).
2. Measured room correction per position and tone	Source measured once in a real chamber and again in the room, band by band: "the uncertainty in measurements is minimal (below 0.55 dB for frequencies above 200 Hz)" (du Plessis et al. 2022, p. 29).	Yes, the strongest. Valid for a fixed source and fixed microphones — our arc — not for a flying drone.	Needs a reference run in a chamber (the university's 300 m³). Void if a capsule is re-seated: 1 cm moves the response ± 6 dB at high frequency (Bellmann & Klippel, p. 7). Must be checked against the prop at 200–250 Hz (Mehrgou 2012, p. 34).
3. Average over source speed	Tones are where a modal room hurts most; a pattern that changes over a 19 % frequency step averages out over a speed ladder. No published residual.	Yes, cheap. Hardware exists; 12–15 PWM steps.	Tone-pattern holes of 8 dB moved with a 19 % frequency step in the flat-arc runs; the polar shape of 30 Sep depends on speed outside 1.3–2 kHz.
4. Time gating	Lowest usable frequency ≈ 1 / gate length: "the time-bandwidth requirement is satisfied on frequencies above 177.9Hz" for a 5.6 ms gate (Matelján, p. 8).	Only above 500 Hz: our gate is 1.98 ms.	Good for naming the 0.68 m and 1.49 m reflectors; cannot reach the blade tone.
5. Absorb: foam, wedges	34 cm of depth per 250 Hz; cost about $\times 4$ per octave down (Orrego et al. 2018, p. 477).	Not at 250 Hz. Yes at 630–1000 Hz: about 10 cm on the named surface.	The floor under the arc and source mattered most (wedges off: 2.05 $\rightarrow$ carpet 1.32, same afternoon); the same material on the walls did nothing.
6. Subwavelength absorber	"99.2% absorptance at 239 Hz in experiment" in 100 mm (Long et al. 2020, Sci. Rep. 10:13823).	The one exception for the blade tone, but only if the 238 Hz error is the room, not the stand.	Decide with the reverse-rotation capture first.
7. Hemi-anechoic floor	Removing the floor treatment costs ~ 3 dB broadband and up to 10 dB at the blade tone, repeatability 0.5 dB (Ma et al. 2022, p. 7).	Already in play: our floor is treated.	Floor changes moved the score; the same material on the walls did nothing.
Active absorption, intensity or holography, outdoors	9.6 dB up to ~ 600 Hz (Haasjes 2025); 1–3 dB (ISO 9614-1); outdoors agreed to 0.1 dB at ≥ 20 dB signal-to-noise (Kim et al. 2022).	Not now.	Outdoors only for an absolute-level check.

Order for this chamber

- Record the room (hub height, dimensions, what stands within 1.5 m of the arc ends) and move the 0.68 m reflector or the arc away from it.
- One capture with the propeller turning the other way, everything else identical: separates stand-induced from room-induced asymmetry.
- Loudspeaker correction at the blade harmonics (215–258 Hz, 713 Hz) for the eleven positions, then compare with the propeller at the same positions.
- Speed ladder to average the tones.
- Treat only the surfaces the sweep names (about 10 cm of foam at 630–1000 Hz).

"there is correlation between the results from the loudspeaker and engine but not in every frequency bands especially not in the regions of 200 and 250 Hz."
Mehrgou 2012, KTH TRITA-AVE 2012:42, p. 34 – the reason step 3 ends with a propeller comparison
"TABLE I. Maximum allowable difference in anechoic rooms between measured and theoretical free-field levels per ISO 3745 and ANSI S12.35."
Cunefare et al. 2003, J. Acoust. Soc. Am. 113(2), p. 882

Where the accepted configuration stands, and what the method cannot say

- Evaluated on its own (25 Sep): room error 1.387 dB, qualified from the 2000 Hz band, 65 % of tone cells inside the limit. Published small rotor chambers report cut-offs of 63–275 Hz (29 facilities; METU's semi-anechoic room, 160 Hz, Kayhan 2008 p. 63); ours is 7–32 times higher, by a test easier in one respect (the arc mean, not the ideal, is the reference) and harder in another (the worst of eleven capsules).
- Deviation from the arc mean is blind to an error shared by all eleven positions; the ISO traverse has not been run, so this ranks bands and does not certify. The anechoic table is used because the floor under the arc is absorbing.
- Open, unexplained:** in the third carpet arrangement (14:52–14:58, 24 Sep; neighbours chaotic-carpet-2 before, wall-mount-a 34 min after) every capsule's level rose by the same amount, growing with frequency: +1.7 dB at 1–3 kHz, +4.4 dB at 5–6.4 kHz, none at 257–400 Hz. No tilt, so the sphere was not re-aimed. Room-only changes that afternoon (carpet laid, made chaotic, re-arranged) moved the mean level by at most 0.13 dB in any band, so redistributed absorber is not the cause. The same shape recurs on 25 Sep between in-plane-b and curtain (+4.4 dB at 5–6.4 kHz again), when the sphere was reported unmoved. Candidates: a change in the source's output, or something reflective in the beam. Test: a 5 kHz tone on live_tone with an absorber held in the beam. It cancels in the arc-relative score.
- Only same-day pairs with an unmoved source are compared. The grid starts at 257 Hz, above the blade tone; 3–5 kHz is excluded (sphere), 5–6.4 kHz indicative.