

Jensens BIL-SERVICE

Ingeniør Rybergsgate
3007 DRAMMEN

Tlf.: 32822885
Fax:

Foretaksregisteret
OrgNr: N0982831245MVA

Email: jensen@jensens-bilservice.no
web: www.jensens-bilservice.no

KONTANTFAKTURA

Bilgehan Gunaydin
Grams alle 37
3039 Drammen

NUMMER....: 33425
DATO.....: 10.03.25 08:20
SIDE.....: 1
KUNDENR...: 26630
ORDREN...: 31155

MERKE:	MODELL:	REG.NR.	KM	CHASSISNR:	REKV.NR:	VÅR REF.:
MERCEDES-B	GLC 350 e 4MATIC	DR31124	140835	WDC2539541V008686		ANDRE

Varenummer	Tekst	Antall	Stykkpris	I Alt Eks.Mva.
------------	-------	--------	-----------	----------------

Arbeid utført:
ASSYST PLUS, stor service utført etter fabrikantens spesifikasjoner (se vedlegg) Skiftet olje og oljefilter på motor

Tillegg ifm service:
- "feilmelding på batteri med beskjed om å ikke skifte gir" = korttest/feilsøk - isolasjonsfeil på PTC-varmer.

Merknad til bileier:
- ikke skiftet kupefilter
- rustne bremseskiver foran
- slitte bremseskiver bak
- slakk i høyre nedre bæream

2	Stor service B med Plus pakke	1,00	3 920,00	3 920,00
2	inkl motorolje (Premium) , oljefilter			
DIA	MB diagnose, avlesning/nullstilling	1,00	1 040,00	1 040,00

I ALT
4 960,00

NETTO
4 960,00

GRUNNLAG
MVA-FR. MVA-PL. 25% MVA
4 960,00 1 240,00

Å BETALE
6 200,00

Digital Service Report

Vehicle info

Vehicle	GLC 350 e 4MATIC
First reg. date	22.06.2017
FIN	WDC2539541V008686

Next Service	03.2026 165835 km
--------------	----------------------

(Please note the additional information in your vehicle (owner's manual, service booklet and service interval indicator) on the performance of the next service)

Service report 6

Jensens Bil-Service
Ing. Rybergsgt. 104
Drammen

Date	10.03.2025
Rep.-order-no.	33423
Mileage	140835 km

Performed services

Service	Service B
Workshop code	8NOW
Remaining time	16 Days
Remaining distance	15610 km

Oil quality/viscosity

Description	Engine oil
Oil quality	229.5
Viscosity	

Replaced / renewed

Engine: oil and filter change ☒

Until next service

Mercedes-Benz Mobilo ☐
Warr. against rusting through ☐

Service-intervals in accordance with Mercedes-Benz AG specification

Complied with ☐

Addworks


accomplished ☒

Service history

	Jensens Bil-Service	Date	10.03.2025
	Ing. Rybergsgt. 104	Mileage	140835 km
	Drammen	Service	Service B
	Jensens Bil-Service	Date	26.03.2024
	Ing. Rybergsgt. 104	Mileage	131445 km
	Drammen	Service	Service A
Mercedes-Benz	Andresen Bil AS, avd. Ski	Date	04.05.2021
	sveien 5	Mileage	63524 km
	Ski	Service	Service B
Mercedes-Benz	Erik Arnesen Helsefy AS	Date	09.06.2020
	Østensjøveien 12	Mileage	39500 km
	Oslo	Service	Service A
Mercedes-Benz	Bertel O. Steen Ullevål AS	Date	12.06.2019
	Klaus Torgårdsvei 3	Mileage	27667 km
	Oslo	Service	Service B
Mercedes-Benz	Bertel O. Steen Ullevål AS	Date	30.05.2018
	Klaus Torgårdsvei 3	Mileage	13532 km
	Oslo	Service	Service A

Model 253 (except 253.99)

Service B with Plus Package

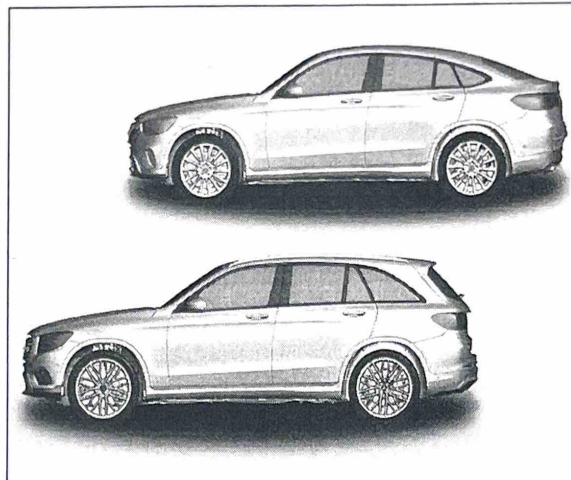

P00.20-2875-11

Customer: Bilgehan Gunaydin

License plate number: DR31124

Order number: -

Completion time/date: 3/6/2025

FIN/VIN: WDC2539541V008686 / -

Kilometers: 140835

Service code: B0

Workshop code: 8N0W

Remaining distance: 15600

Remaining time: 20

Service consultation performed

Yes: X

No: -

Oil type/viscosity: According to sheet 229.5 | BB00.40-P-0229-05A

*Recommend Mercedes-Benz oil

Notes/explanations: - Recommended for the lowest possible fuel consumption (use lowest SAE viscosity class of the MBBEVO sheet in each case; observe possible restrictions of approved SAE viscosity classes!); Use only SAE 0W-40 or 5W-40.....

Engine oil fill capacity: 6,5 l with 4MATIC | 7,0 l without 4MATIC

The following activities are hereby confirmed:

- Completion of relevant service operations

Signature.....

B		Input condition not OK:	<input checked="" type="checkbox"/>
Completed			
<input checked="" type="checkbox"/>			
<input type="checkbox"/>	Service reception The reception report for service on the vehicle is available in completed form.	<input type="radio"/>
General		AP00.20-P-0009Z	
General		AP00.20-P-0009Z	

i To be performed by the Service Advisor (where market-specific conditions require). Process all the acceptance items and maintenance items as listed in the service sheet, only then is the service scope completely performed.

<input type="checkbox"/>	Methods for conducting all subsequent service items known. If methods are not known, ↓ see document references for the relevant methods. Overview of service overviews	AP00.20-P-1600UWC
<input type="checkbox"/>	Brake system Perform brake test and enter result in table.	<input type="radio"/>
<input type="checkbox"/>	Vehicle exterior Check exterior lighting for proper operation.	<input type="radio"/>
<input type="checkbox"/>	Check function of headlamp range adjustment. Vehicles with dynamic LED headlamps or with the headlamp range adjuster on the exterior lights switch.	<input type="radio"/>
<input type="checkbox"/>	Check and correct headlamp adjustment. i The adjustment of headlamps on vehicles with level control system or dynamic LED headlamps is to be invoiced as an additional operation.	<input type="radio"/>
<input type="checkbox"/>	Check charging cable and vehicle socket. Model 253.311/353/354/911/953/954	<input type="radio"/>
<input type="checkbox"/>	Vehicle interior Check windshield wipers, windshield washer system for proper operation.	<input type="radio"/>
<input type="checkbox"/>	Check starter. Model 253.354/954	<input type="radio"/>
<input type="checkbox"/>	Replace activated charcoal particle filter.	
<input type="checkbox"/>	Engine compartment Brake system: Check fluid level.	<input type="radio"/>
<input type="checkbox"/>	Check air flap in engine compartment. Engine 177	<input type="radio"/>
<input type="checkbox"/>	Plus package: Tires Check, correct tire pressure, and enter set tire pressure in table.	<input type="radio"/>
<input type="checkbox"/>	Plus package: Trunk Check/correct tire pressure spare wheel and enter set tire pressure into table. Vehicles with spare wheel.	<input type="radio"/>
<input type="checkbox"/>	Check TIREFIT tire sealant. Vehicles with TIREFIT. i Enter expiration date here:	<input type="radio"/>
<input type="checkbox"/>	Check first-aid kit (soft sided). i Replace TIREFIT, invoice as additional operation. Except code 819L (People's Republic of China) i Enter expiration date here:	<input type="radio"/>
<input type="checkbox"/>	Check first-aid kit (soft sided). i Replace first aid bag, invoice as an additional operation. Vehicles with first aid kit (soft sided). With code 819L (People's Republic of China) i Enter expiration date here:	<input type="radio"/>
	 i Replace first aid bag, invoice as an additional operation.	

<input type="checkbox"/>	Check trunk lighting for proper operation.	○
<input type="checkbox"/>	Plus package: Engine compartment Windshield washer system: Check/correct fluid level. 1 When using cleaning compounds for summer/winter, make sure the mixing ratio matches the given ambient temperature.	
<input type="checkbox"/>	Plus package: Vehicle interior Check lamps in instrument cluster and interior lighting.	○
Additional operations		
service 3		
<input type="checkbox"/>	Engine compartment Engine: Change oil and oil filter.	
Service 10		
<input type="checkbox"/>	Vehicle interior Panoramic sliding sunroof: Clean and lubricate guide mechanism.	
Service 15		
<input type="checkbox"/>	Vehicle exterior Trailer hitch: Check condition and operation.	

Brake values

	Left	Right
Front		
Rear		
Parking brake		

Set tire pressure in kPa or psi (100 kPa = 1 bar)

	Front axle	Rear axle	Spare tire
kPa/psi			