



NMG
Geotechnical, Inc.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
FOR THE PLANNED SCHOOL LOCATED
SOUTHEAST OF SIENNA PARKWAY AND O'NEIL DRIVE,
LADERA RANCH, CALIFORNIA

OSO
BRANDE

February 4, 2002

Project No. 01079-02

Prepared for:

Capistrano Unified School District
32972 Calle Perfecto
San Juan Capistrano, California 92675


404477

Prepared by:

Quin Kinnebrew, CEG, REA II

714
771
3050

315
5354

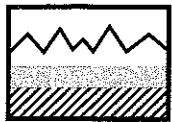

NMG
Geotechnical, Inc.

February 4, 2002

Project No. 01079-02

To: Capistrano Unified School District
32972 Calle Perfecto
San Juan Capistrano, California 92675

Attention: Mr. Bob Sendzik

Subject: Phase I Environmental Site Assessment for the planned school site located southeast of Sienna Parkway and O'Neil Drive, Ladera Ranch, California.

NMG Geotechnical, Inc. is pleased to present the results of a Phase I environmental assessment conducted for the subject site. The purpose of this study was to assess the potential for hazardous material contamination at and immediately adjacent to the site. As noted in our report, evidence for potentially impacted soil and/or groundwater was not encountered at the site or adjoining properties during this assessment.

Based on the findings of this assessment, further environmental investigations into the release of hazardous materials at the subject site are not considered warranted.

If you have any questions or comments regarding the attached report, please contact our office.

Respectfully submitted,

NMG GEOTECHNICAL, INC.

Quin Kinnebrew, CEG, REA II
Project Geologist

QK/WG/je

Distribution: (3) Addressee

TABLE OF CONTENTS

Section	Page
EXECUTIVE SUMMARY	1
1.0 INTRODUCTION	1
1.1 Purpose	1
1.2 Scope of Work	1
2.0 SITE OVERVIEW	2
2.1 Location	2
2.2 Site Description	2
2.3 Site History	2
2.4 Geology	2
2.5 Hydrogeology	2
3.0 ASSESSMENT REVIEW	3
3.1 Site Inspection and Observations	3
3.2 Project Vicinity	4
3.3 Review of Aerial Photographs	4
3.4 Review of Maps and Reports	5
3.5 Environmental Database Review	5
3.6 Agency Contacts and Materials	6
3.7 Discussions with Onsite Representative	6
4.0 FINDINGS	7
4.1 Building Construction Materials	7
4.2 Onsite Hazardous Material Use	7
4.3 Subject Site Vicinity	7
5.0 CONCLUSIONS AND RECOMMENDATIONS	8
5.1 Conclusions	8
5.2 Recommendations	8
6.0 LIMITATIONS	9
AERIAL PHOTOGRAPHS REVIEWED	1

Figures

Figure 1 - Site Location Map	Rear of Text
Figure 2 - Site Plan	Rear of Text

Appendices

Appendix A - References and Aerial Photographs Reviewed
Appendix B - Photographs and Topographic Maps
Appendix C - Environmental Data Resources, Inc. Report

EXECUTIVE SUMMARY

Based on records reviewed during this assessment, the site was in an undeveloped and natural state up to 1999. The site had been used primarily as part of a larger cattle ranch for grazing and dry farming. There were no known manmade structures located within the site prior to 1999. Mass grading of the site began in 1999 and was completed in the summer of 2001. Since this time, the site has been either vacant or used as a temporary storage area for construction materials, such as lumber and utility pipe. No other site uses are known.

At the time of the site reconnaissance, the site was in an undeveloped state, comprised of a leveled graded pad. Aboveground structures were not located within the site. One desilting basin, used for the drainage of surface water, was located in the site's southern portion. Indications of other underground structures were not observed at the time of the site reconnaissance. Potentially hazardous material sources and/or releases were not observed on any portion of the site, or the properties immediately adjoining the site.

Although the site may have been in light agricultural use (dry farming), pesticides and/or herbicides are not suspected within the near-surface soils beneath the site. Any pesticides and/or herbicides at the site were likely mixed and/or placed at lower depths during the development of the site.

There are no properties within one mile of the site that are listed in environmental databases as having the potential to impact the underlying soil and/or groundwater with hazardous materials.

Based on the findings of this assessment, further environmental investigations into the release of hazardous materials at the subject site are not considered warranted.

1.0 INTRODUCTION

1.1. Purpose

The purpose of this study was to assess whether hazardous material contamination has impacted the planned school site located southeast of Sienna Parkway and O'Neil Drive, in Ladera Ranch, California (Figure 1)

1.2. Scope of Work

This Phase I environmental site assessment was conducted in conformance with the scope and limitations of ASTM Standard E1527-00. The scope of work for this assessment included the following:

- Site reconnaissance to visually assess current site utilization, potential onsite use or storage of hazardous materials, and indications of surface and subsurface contamination.
- Review of local geology and hydrogeology using readily available data.
- Review of current and historical conditions and uses of the site and the immediate vicinity using available resources, including:
 - Aerial photographs
 - Environmental and geologic reports and maps
 - State and federal government databases
 - U.S. Geological Survey topographic maps
 - Discussion with those knowledgeable of the site
- Preparation of this report.

The references used in this study are listed in Appendix A. Color photocopies of selected photographs taken during the site reconnaissance are included as Appendix B. Copies of aerial photographs and topographic maps are also provided in Appendix B. The search of select government documents was subcontracted to Environmental Data Resources, Inc. (EDR). A copy of the full EDR report is included as Appendix C.

2.0 SITE OVERVIEW

2.1 Location

The planned school site is located southeast of Sienna Parkway and O'Neil Drive, in Ladera Ranch, California. The school site extends up to 650 feet east of Sienna Parkway, and 670 feet south of O'Neil Drive. The site can be located in the Orange County Thomas Brothers Guide (2002 Edition) Page 952, Grid E2.

2.2 Site Description

At the time of the site reconnaissance, the site appeared to have been recently mass graded into a relatively level lot. Soil covered the entire site. Aboveground buildings or other permanent structures were not located within the site. One desilting basin, used for the drainage of surface water, was located in the site's southern portion. Indications of other underground structures were not encountered within the site. For a more detailed description of the site, refer to Section 3.1.

2.3 Site History

Since before 1942 and up to 1999, the site had been in an undeveloped state and was part of a larger cattle ranch, used for dry farming and grazing. Mass grading of the site began in 1999 and was completed in the summer of 2001. Since this time, the site has been either vacant or used as a temporary storage area for construction materials, such as lumber and utility pipes. No other site uses are known. It is our understanding that DMB Ladera, LLC currently owns the site.

2.4 Geology

The subject site is underlain with up to 110 feet of soil fill (GMU, 2001). The fill materials are comprised of colluvium, alluvium, landslide debris, and bedrock of the Monterey Formation, and generally consist of mixtures and layers of clay, silt, and sand with occasional pebbles and cobbles. These fill materials were excavated from onsite sources and from undeveloped areas within the immediate site vicinity (GMU, 2001).

The fill materials underlying the site are underlain with semi-consolidated rocks of the Monterey Formation. The Monterey Formation is generally comprised of thinly bedded, uncemented shale and siltstone interbedded with sandstone.

2.5 Hydrogeology

Minor perched water is present within some of the more permeable soil and rock materials underlying the site and adjoining properties. Seepage, an indication of perched groundwater, was observed at the bottom of the fill underlying the site (up to 110 feet below ground surface). The perched groundwater beneath the site is anticipated to flow toward the south-southwest, coincident with the regional topographic gradient.

3.0 ASSESSMENT REVIEW

3.1 Site Inspection and Observations

On January 31, 2002, a NMG Geotechnical, Inc. representative visited the site to assess its current utilization, and to visually search for indications of surface and subsurface contamination. Features observed during this reconnaissance are shown on the Site Plan (Figure 2). Photographs taken during the site reconnaissance are included in Appendix B. Observations made during the site reconnaissance are presented below.

- At the time of the site reconnaissance, the site existed as a mass graded, leveled lot (Photo Nos. 1 through 8). Soil covered the entire site. Pavement and/or vegetation were not located within the site.
- Aboveground structures are not located within any portion of the site. The only aboveground items noted within the site were surveyor stakes and barricades around a southern desilting basin.
- A desilting basin (a drainage area and inlet for rainwater removal) is located in the site's southern portion (Photo No. 9). Indications that potentially hazardous materials had been dumped into the basin or inlet were not observed at the time of the site reconnaissance.
- Stained soil was not encountered within the site.
- Fill ports and vent pipes to USTs were not observed within or adjacent to the subject site.
- Clarifiers, ponds, pits, and sumps, or other below ground waste disposal areas were not observed onsite.
- Indications of septic systems were not observed on any portion of the site or adjoining areas.
- Groundwater monitoring and/or vadose zone wells were not observed within or adjacent to the subject site.
- Mounds or depressions, suggesting trash or other solid waste disposal at the subject site or surrounding areas, were not observed during this assessment.
- Aboveground storage tanks were not observed within or adjacent to the subject site.
- Pools of liquid or potentially hazardous substances were not observed on any portion of the site during the site reconnaissance.
- Wastewater discharge pipes were not observed on any portion of the site at the time of the site reconnaissance.
- Unusual or noxious odors were not detected during the site reconnaissance.

3.2 Project Vicinity

Properties adjoining the site were reviewed for evidence of possible contaminant releases. A brief description of these properties is provided below.

- O'Neil Drive, is located immediately north and along the site's northern side (Photo No. 10). This road was being paved at the time of the site reconnaissance. Concrete curb and gutters were located along this road. The shoulders of the road were soil covered, and in use as parking areas and temporary driveways. A rough graded lot covered with soil is located north of the site and this roadway. Potentially hazardous material sources and/or releases were not observed along O'Neil Drive or on the undeveloped lot (soil covered) located immediately to the north.
- An undeveloped lot covered with soil is located immediately east of the site (Photo Nos. 11 and 12). Aboveground and underground structures were not observed on any portion of this lot. Potentially hazardous material sources and/or releases were not observed on this lot.
- The property located south of the site exists as a leveled, undeveloped lot covered with soil (Photo No. 13). Aboveground and underground structures were not observed on any portion of this property. A tractor was parked in the central portion of this property. Potentially hazardous material sources and/or releases were not observed on this property.
- A partially graded roadway, Sienna Parkway, is located along the site's western side (Photo Nos. 14 and 15). An ascending slope is located west of this road and the site's central and southern portions. Aboveground structures, temporary in appearance, are located west of the site's northern portion (Photo No. 16). Potentially hazardous material sources and/or releases were not observed along Sienna Parkway or properties located west of the site.

3.3 Review of Aerial Photographs

The following aerial photographs were reviewed to assess the site use over time, and to look for evidence of potentially hazardous material storage, usage, and/or disposal areas. Copies of the aerial photographs are included in Appendix B.

- In the 1952 aerial photograph, the subject site and surrounding properties (rolling hillside terrain) are undeveloped and appear in a natural state. Light grasses and/or brush cover the site and the adjoining properties. Most of the site slopes generally toward the east. Horno Creek traverses through the site's eastern side. An unpaved jeep trail is visible approximately 500 feet west of the site. Part of the site's upper (western) portion appears to have been plowed at some time in the site's past. Aboveground structures are not visible within the subject site. Indications of potential contaminant sources, such as landfills, large aboveground tanks, oil wells, or pipelines, are not visible onsite or within 1,000 feet of the site.
- In the 1968, 1977, 1989, and 1994 aerial photographs, the subject site and adjoining properties are in a similar state to that noted in the 1952 aerial photograph. Relatively large

utility poles are faintly visible approximately 300 feet west of the site in these photographs. Potential contaminant sources are not visible onsite or within 1,000 feet of the site.

3.4 Review of Maps and Reports

The **1942 Santiago Peak, California quadrangle** (15-minute topographic map; Appendix B) shows the site and adjoining properties as undeveloped hills and valleys. Aboveground and/or underground structures are not shown onsite. The closest manmade structures shown include a jeep trail and a well (marked as a groundwater well) located approximately 500 feet to the west and 700 feet to the south, respectively. Other manmade structures are not shown within 2,000 feet of the site. Structures of concern, such as pipelines, oil wells, and landfills are not shown within the site boundaries, or within 2,000 feet of the site.

The **1948, 1968, 1978, and 1981 San Juan Capistrano, California quadrangles** (7-minute topographic maps; Appendix B and Figure 1) show the site and adjoining properties in a similar state to that noted in the 1942 topographic map. In 1968, 1978, and 1981, aboveground electric lines are shown approximately 300 feet west of the site. In 1978 and 1981, a jeep trail is shown roughly paralleling the aboveground electric lines. Structures of concern are not shown within the immediate site vicinity.

The **Munger Map Book** (1967) showing oil and gas fields in California and Alaska was reviewed for information regarding oil wells within and adjoining the subject site. Oil wells are not shown within the subject site. The closest oil well (Union O'Neil 4520/21) is shown approximately 750 feet south (down gradient) of the site. This oil well, likely the well shown on the topographic maps, is marked as abandoned. According to the Munger Map Book, no other oil wells are located within 2,000 feet of the site.

3.5 Environmental Database Review

Environmental Data Resources, Inc. (EDR) conducted a search of available environmental records for the site and properties up to two miles away from the site. The search exceeded the specific requirements of ASTM Standard Practice for Environmental Site Assessments, E-1527-00, including those associated with government databases, search distances, and data currency. EDR's report, dated December 07, 2001, is included as Appendix C of this report. Pages 1 and 2 of the executive summary for the EDR report list the federal and state environmental databases searched for this investigation. A description of these databases is provided at the rear of EDR's report.

A map provided in the EDR report shows the location of the subject site and properties within the search distances defined by ASTM (Page 2 in Appendix C).

The EDR report indicates that the subject site is not listed in the environmental databases reviewed. In addition, there are no properties within one mile of the site listed in the environmental databases reviewed.

3.6 Agency Contacts and Materials

Records for underground storage tanks and hazardous-material releases in Unincorporated Orange County are maintained by the Orange County Health Care Agency (OCHCA). Ms. Germaine Bedard, Office Specialist (Record Section) stated that the OCHCA files its records by street addresses only. Vacant, undeveloped sites without formal street address are unlikely to have records.

Due to the absence of building structures onsite and the site's recent development, the Orange County Building Department was not contacted with regards to potential contaminant sources, such as underground storage tanks, clarifiers, sumps, and hydraulic hoist.

3.7 Discussions with Onsite Representative

Goffman, McCormick & Urban, Inc. (GMU) provided geotechnical services during grading of the site and adjoining properties. A representative of the GMU, Mr. Bob Mutchnik, noted that they monitored onsite soil removal and placement activities since grading was initiated in 1999. Aboveground structures were not located onsite prior to the start of grading. Underground structures, such as fuel storage tanks and clarifiers, were not encountered during soil removals. Stained and/or odorous soils were also not encountered during soil removals.

Soils placed onsite as fill were either derived onsite or from properties immediately adjoining the site. All of the adjoining properties were in an undeveloped and natural state at the time grading was initiated. The onsite soil materials were not imported from distant and/or suspect sources. The soils placed within the site were generally comprised of alluvium, colluvium, landslide debris, and bedrock of the Monterey Formation. Odiferous and/or stained soils were not encountered during the grading process. Fill placement at the site was completed in August 2001.

Mr. Bob Sendzik, a representative of the Capistrano Unified School District, reviewed closing documents for the site. Mr. Sendzik noted that environmental-related encumbrances and/or liens were not specified in the title report prepared for the subject site.

4.0 FINDINGS

4.1 Building Construction Materials

Due to the absence of buildings, asbestos- and lead-containing materials are not suspected at the subject site.

4.2 Onsite Hazardous Material Use

Pesticides/Herbicides - Due to the site's possible dry farming use in the past, there is a relatively low potential that pesticides and/or herbicides are present in the soil beneath the site. Any pesticides and/or herbicides at the site were likely in the upper surficial soils, which were removed prior to fill placement. These materials, if any, were likely mixed with clean soil and/or placed at lower depths during fill placement.

Chemical/Petroleum Hydrocarbon Materials - Records of potentially hazardous chemical/petroleum hydrocarbon use at the subject site were not found during this assessment. Evidence suggesting the presence or release of such materials into the soil and/or groundwater was not found during the site reconnaissance or review of background materials.

Potential Hazardous Materials Storage Structures - Evidence for aboveground or underground storage tanks, clarifiers, sumps, or other potentially hazardous material-containing structures was not observed on any portion of the site or encountered during a review of background materials. Such structures were also not encountered during grading of the site. According to the EDR report (Appendix C), no underground storage tanks are registered at the site.

Regulatory Actions - Regulatory actions are not known or suspected of having been issued for the subject site.

4.3 Subject Site Vicinity

Landfills - No Landfills were reported within one mile of the subject site.

Regional or Adjacent Hazardous Material Releases - National Priority Sites (NPL; large-scale releases of hazardous materials) are not reported within one mile of the site. In addition, there are no regulatory listed properties within one mile of the site that have, or have the potential to, impact the underlying soil and/or groundwater.

Radon - Orange County radon levels, included in Appendix C (Page A27), reportedly average 0.500 picocuries in first floor levels (for zip code 92675). The EPA's maximum allowable level is 4 picocuries. Radon concentrations above the EPA's allowable level are not expected at the subject site.

5.0 CONCLUSIONS AND RECOMMENDATIONS

5.1 Conclusions

Based on records reviewed during this assessment, the site was in an undeveloped and natural state up to 1999. The site had been used primarily as part of a larger cattle ranch for grazing and dry farming. There were no known manmade structures located within the site prior to 1999. Mass grading of the site began in 1999 and was completed in the summer of 2001. Since this time, the site has been either vacant or used as a temporary storage area for construction materials, such as lumber and utility pipe. No other site uses are known.

At the time of the site reconnaissance, the site was in an undeveloped state, comprised of a leveled graded pad. Aboveground structures were not located within the site. One desilting basin, used for the drainage of surface water, was located in the site's southern portion. Indications of other underground structures were not observed at the time of the site reconnaissance. Potentially hazardous material sources and/or releases were not observed on any portion of the site, or the properties immediately adjoining the site.

Although the site may have been in light agricultural use (dry farming), pesticides and/or herbicides are not suspected within the near-surface soils beneath the site. Any pesticides and/or herbicides at the site were likely mixed and/or placed at lower depths during the development of the site.

There are no properties within one mile of the site that are listed in environmental databases as having the potential to impact the underlying soil and/or groundwater with hazardous materials.

5.2 Recommendations

Based on the findings of this assessment, further environmental investigations into the release of hazardous materials at the subject site are not considered warranted.

6.0 LIMITATIONS

This Phase I environmental site assessment, conducted in January 2002, is based on information made available during the course of this assessment. The information obtained during this assessment, at a minimum, complies with criteria specified in Standard Practice for Environmental Site Assessments: Phase I, ASTM Standard E 1527-00. This standard, as well as this assessment, does not include the following:


- Subsurface or geotechnical evaluations of the site;
- Soil, water, or material sampling and analysis; or
- Sampling or testing for asbestos, lead, or radon.

The findings presented in this report are carefully documented statements of fact, based on materials *reasonably ascertained* during the course of this assessment. They represent legally defensible distillate of the due diligence effort conducted by NMG on behalf of the client. We do not disclaim or disavow our Findings.

Based on the findings of this investigation, NMG states its conclusions. Generally, these statements are our opinions. Any applicable facts that materially affect our opinion are so stated. Additional services are recommended when doing so is in the best interest of client.

NMG represents the report, addenda, and amendments thereof as results of an environmental due diligence evaluation of the property.

The report is the property of the client for whom it was prepared. Its distribution to others is at client's discretion. To the best of our professional ability, NMG warrants that users of the Report may rely upon it as an accurate reflection of the environmental conditions of the property at the time it was evaluated.

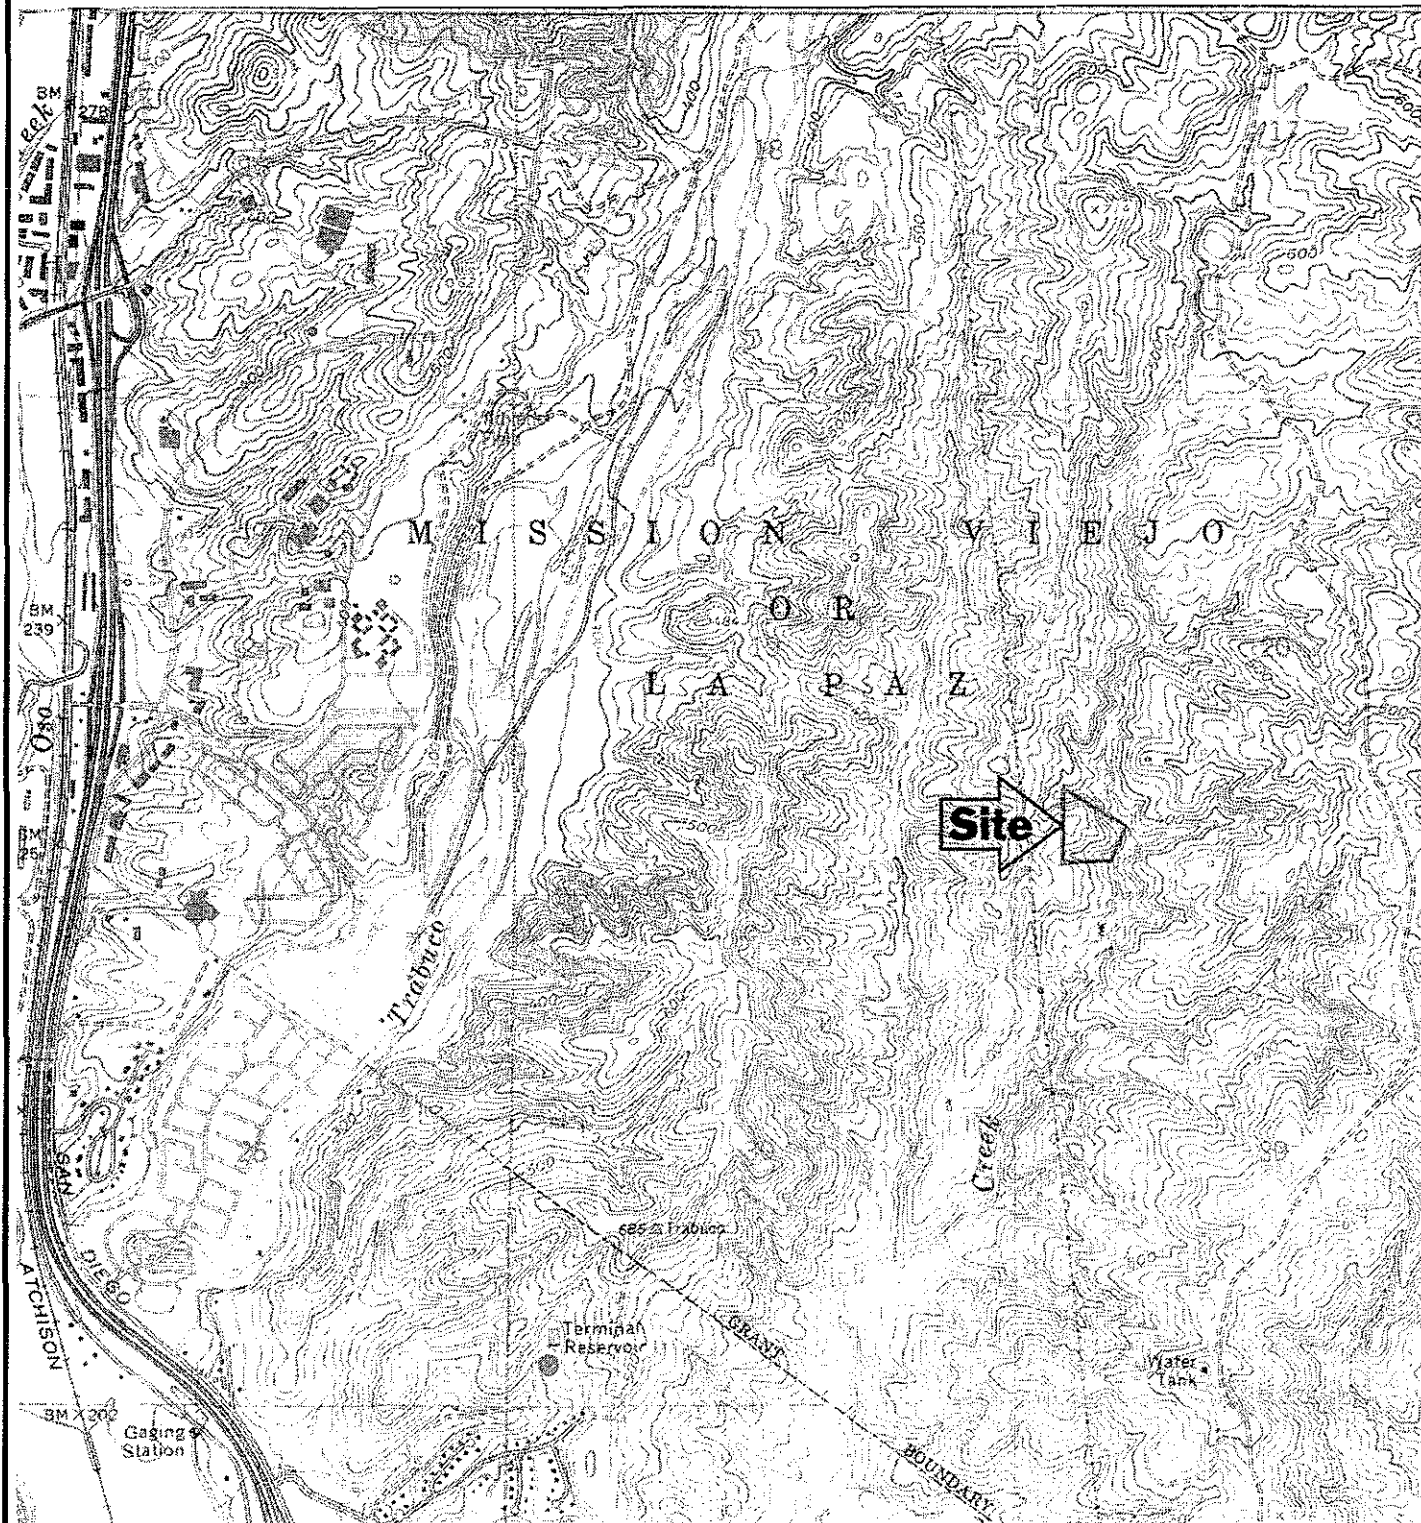

**SITE LOCATION MAP
LADERA III SCHOOL SITE
LADERA RANCH, CALIFORNIA**

Project Number: 01079-02

Project Name: CUSD/LADERA

Date: 2/4/02

Figure No. 1

NMG
Geotechnical, Inc.

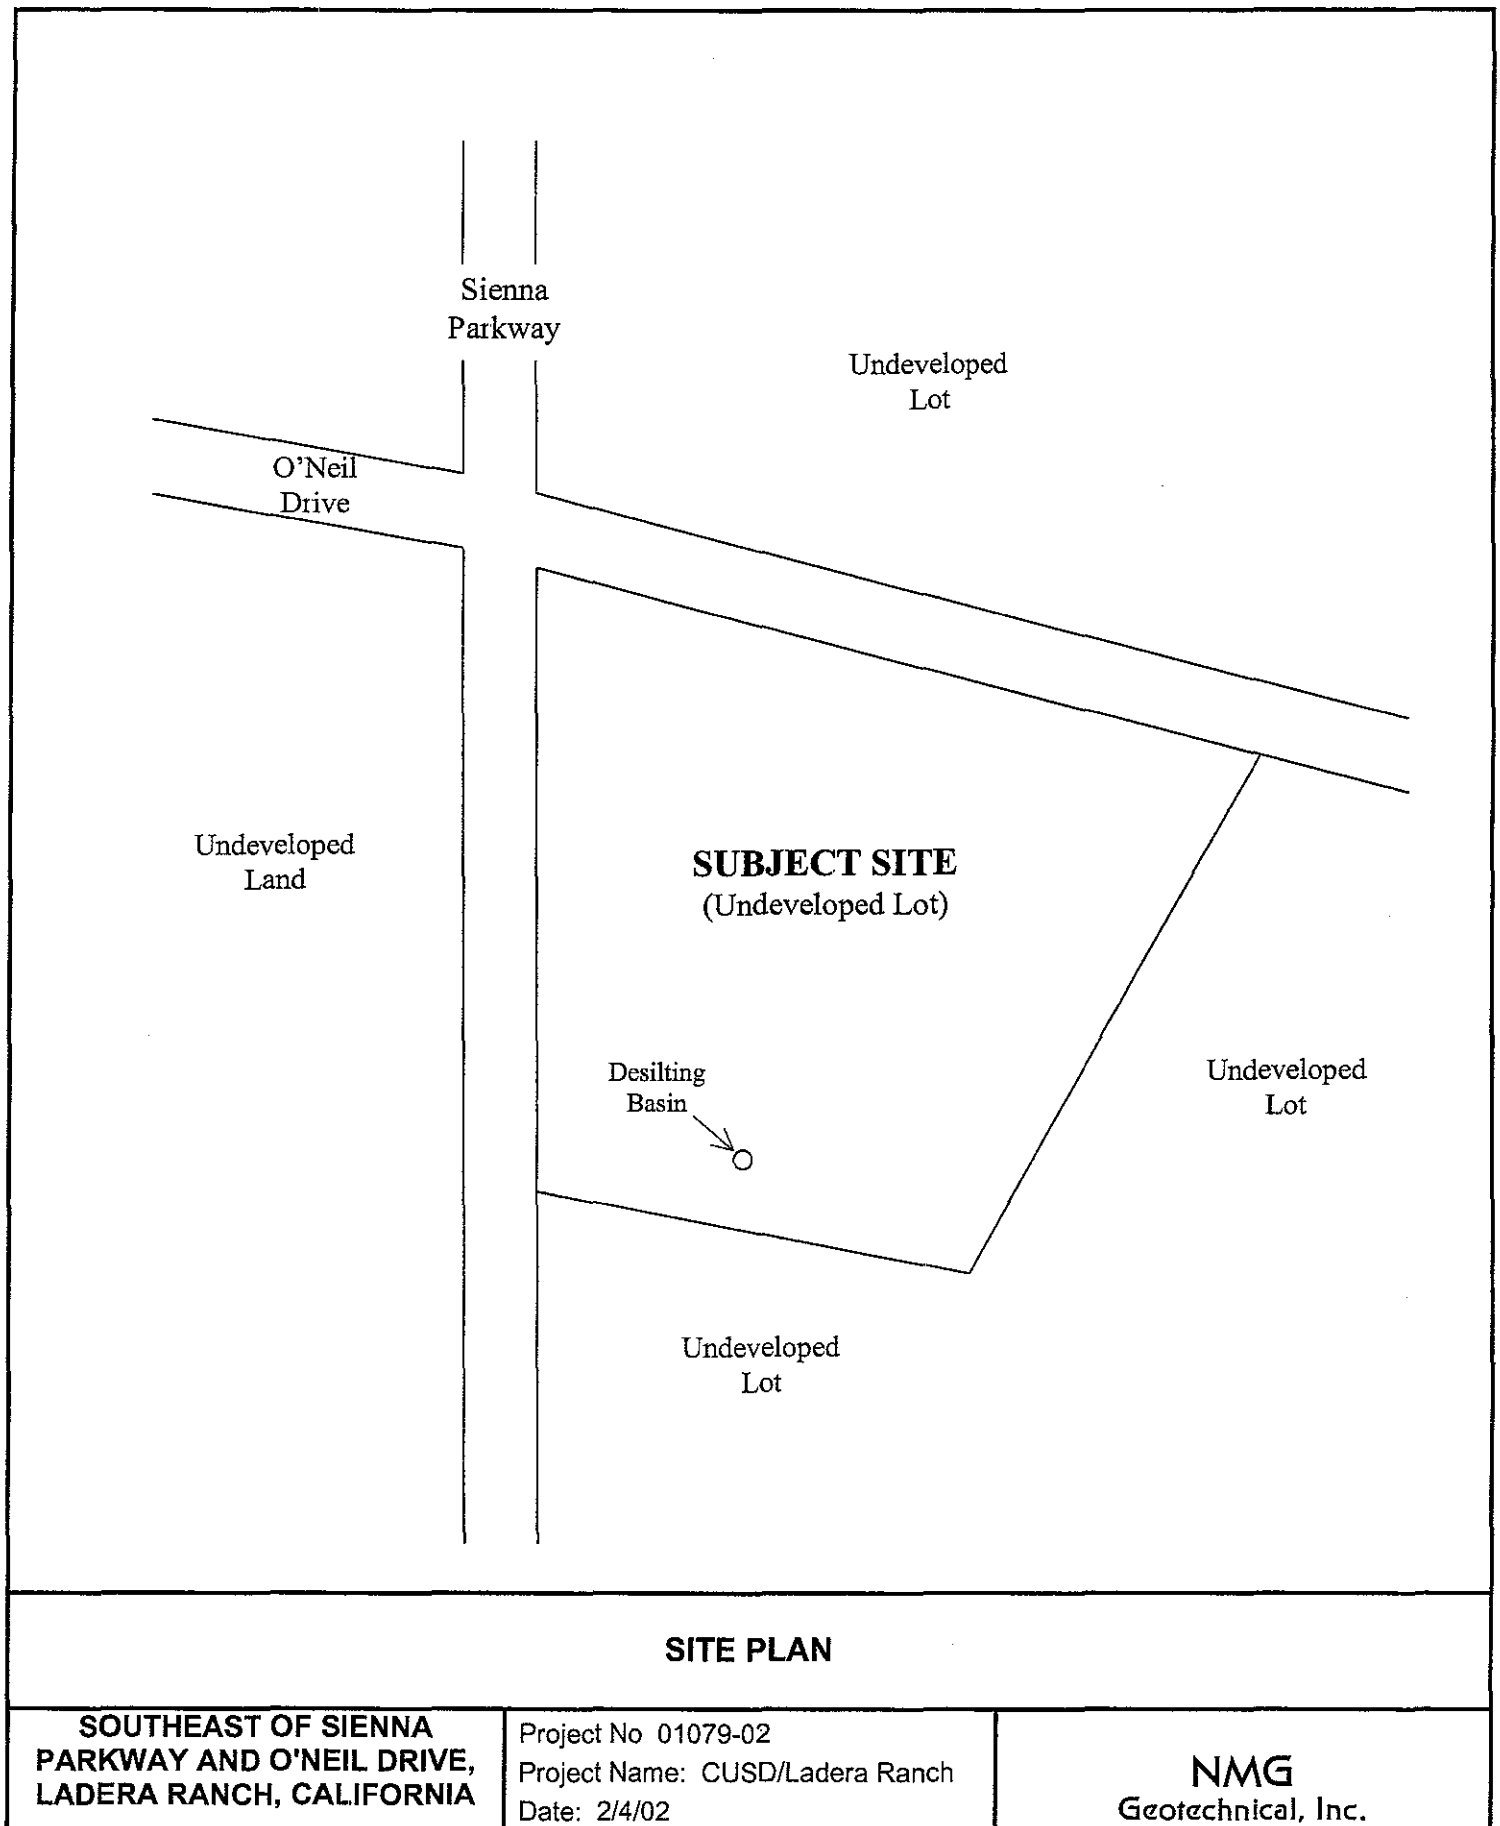


FIGURE 2

APPENDIX A

APPENDIX A

REFERENCES

- Goffman, McCormick & Urban, Inc (GMU), 2001, Personal Communication with Mr. Robert Mutchnik regarding the property located southeast of Sienna Parkway and O'Neil Drive, Ladera Ranch, California on December 11, 2001.
- Munger Map Book, 1967, California and Alaska Oil and Gas Fields: Munger Map Company, Los Angeles, California.
- United States Geological Survey (USGS), 1942, Santiago Peak, California 15 Minute Quadrangle, Scale 1"=5,208'.
- United States Geological Survey (USGS), 1948, San Juan Capistrano, California 7.5 Minute Quadrangle, Scale 1"=2,000'.
- United States Geological Survey (USGS), 1968, San Juan Capistrano, California 7.5 Minute Quadrangle, Scale 1"=2,000'.
- United States Geological Survey (USGS), 1974 (photorevised 1978), San Juan Capistrano, California 7.5 Minute Quadrangle, Scale 1"=2,000'.
- United States Geological Survey (USGS), 1977 (photorevised 1981), San Juan Capistrano, California 7.5 Minute Quadrangle, Scale 1"=2,000'.

AERIAL PHOTOGRAPHS REVIEWED

<i>Date</i>	<i>Scale</i>	<i>Source</i>
1952	1" = 1,111'	Pacific Air
1968	1" = 1,200'	Teledyne
1977	1" = 1,000'	Teledyne
1989	1" = 666'	USGS
1994	1" = 666'	USGS

APPENDIX B

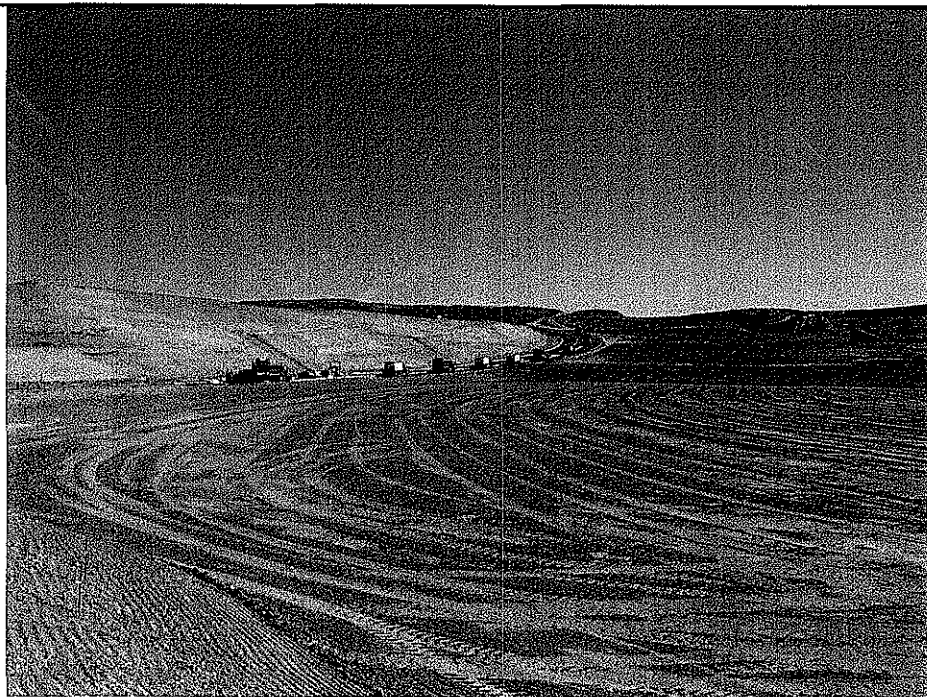


Photo No. 1 – East view of site's northern portion.



Photo No. 2 – Southeast view of site's central and southern portions.

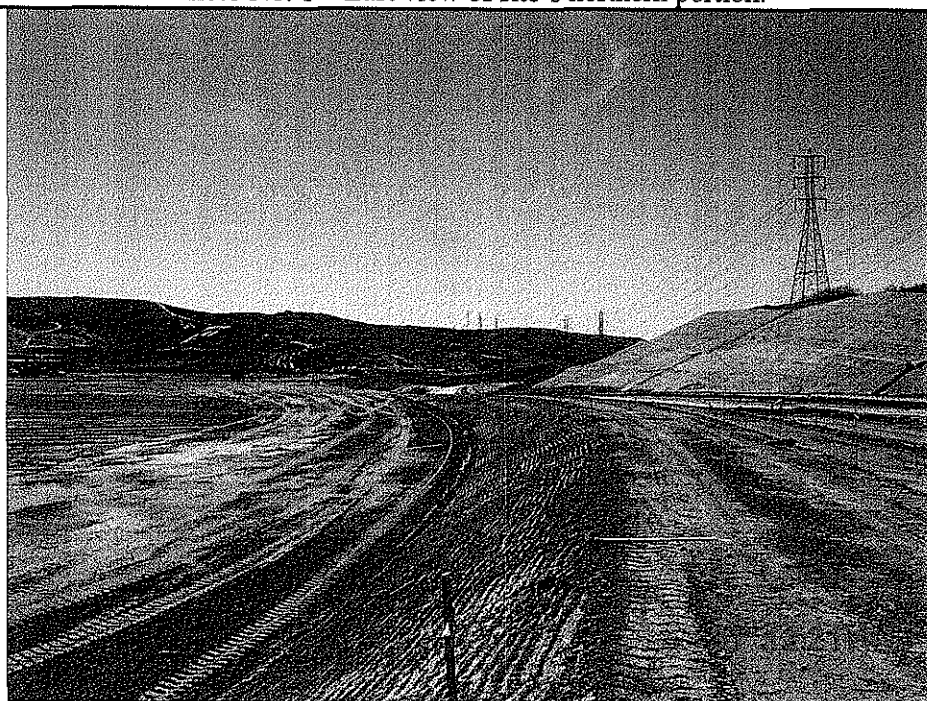


Photo No. 3 – South view of site's western side.



Photo No. 4 – West view of site's southern side.

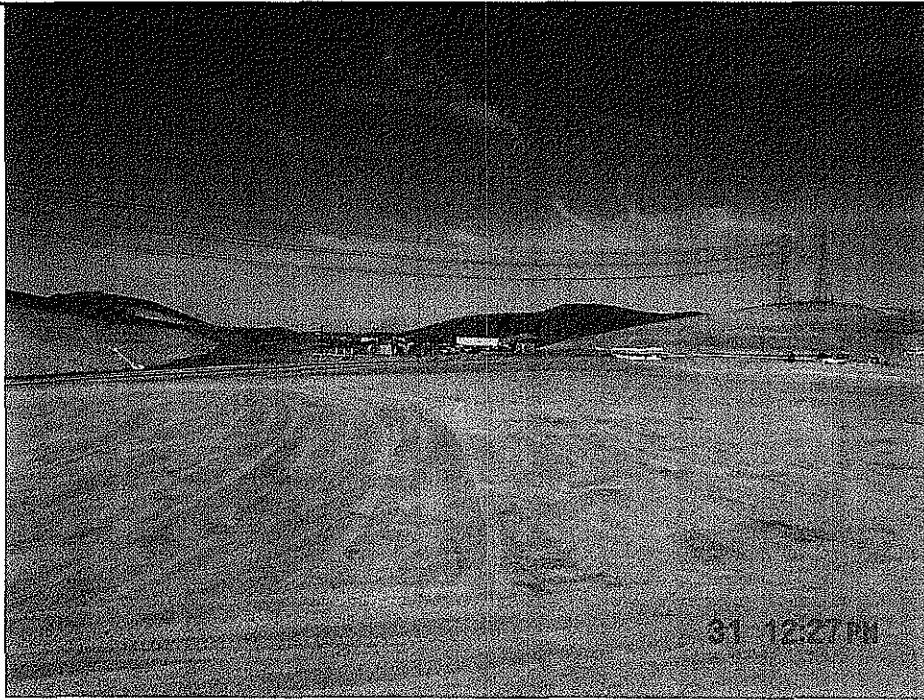


Photo No. 5 –Northwest view of site's central portion.



Photo No. 6 – North-northwest view of site's eastern portion.

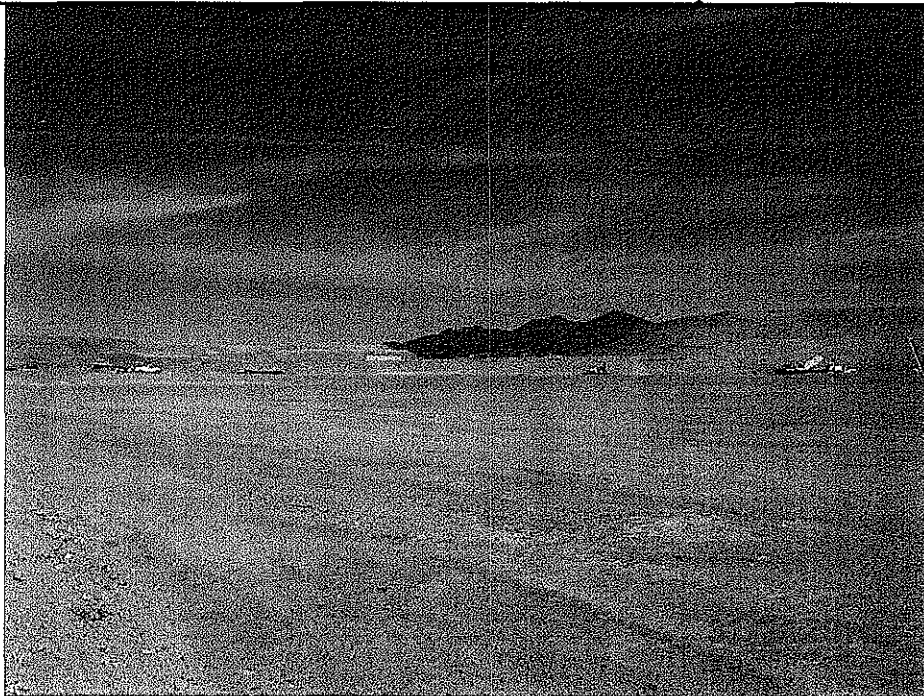


Photo No. 7 – North-northeast view of site.



Photo No. 8 – Northeast view of site.

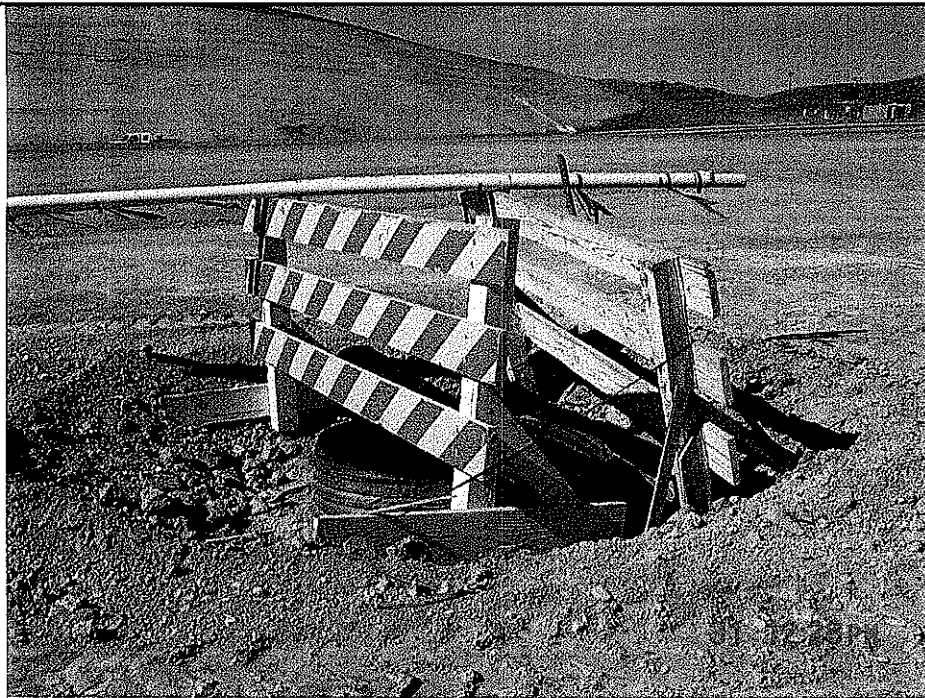


Photo No. 9 – Northwest view of desilting basin in site's southern portion.

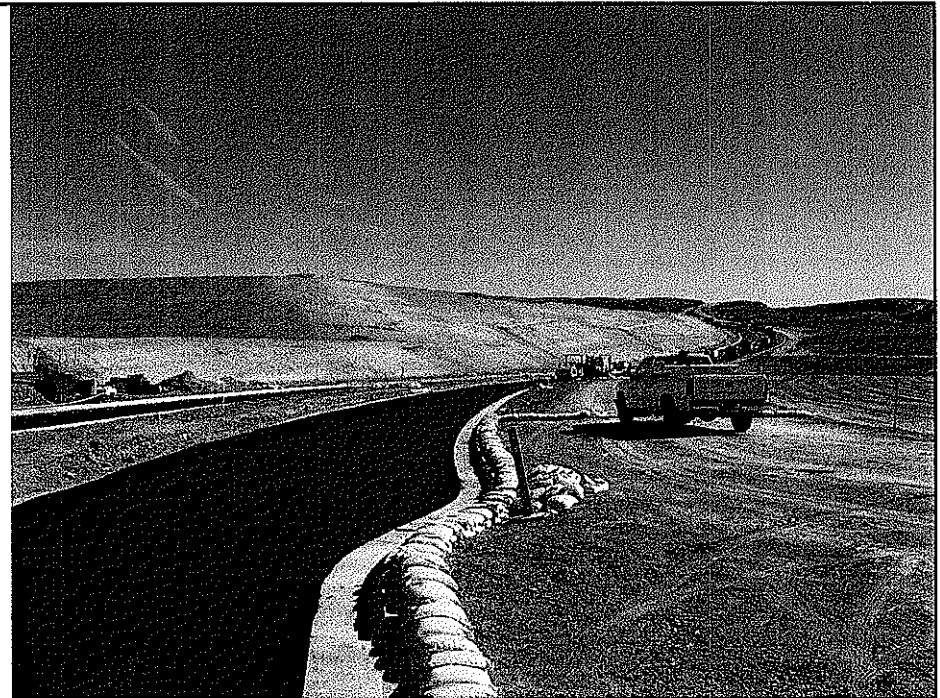


Photo No. 10 – East view of roadway located north of site.



Photo No. 11 – North-northeast view of property located east of site.



Photo No. 12 – Northeast view of property located east of site.



Photo No. 13 – Southwest view of property located south of site.

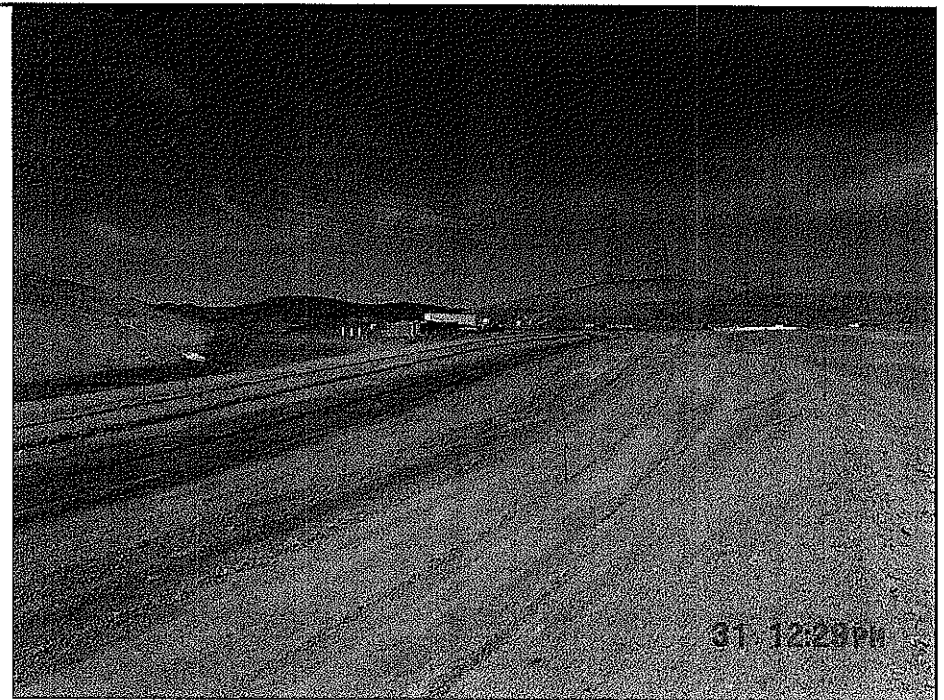


Photo No. 14 – North-northwest view of roadway west of site.



Photo No. 15 – West view of properties west of site.

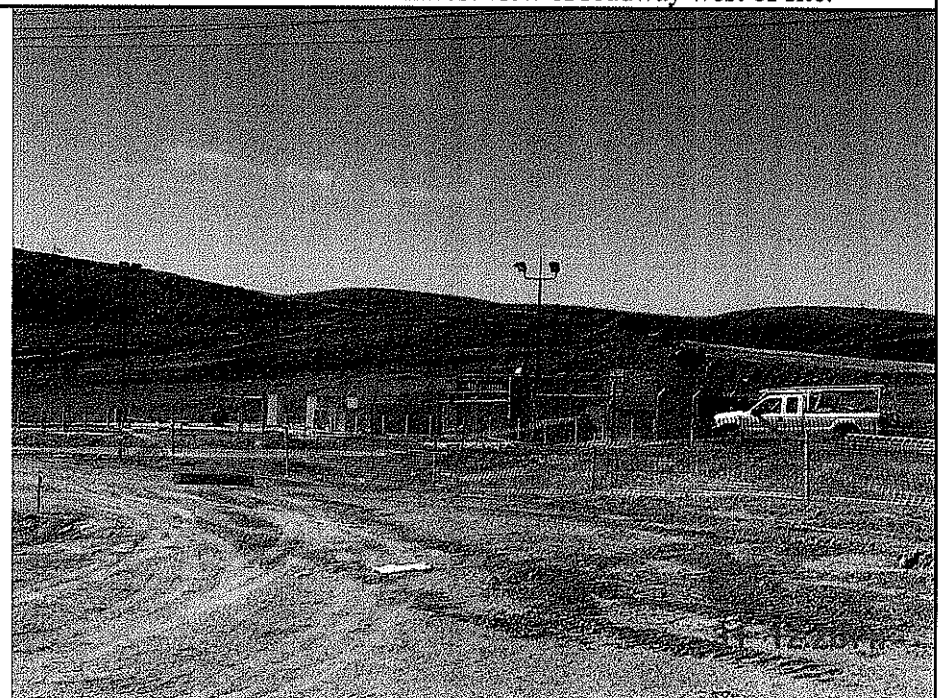


Photo No. 16 – West-southwest view of structures west of site.

APPENDIX C



The EDR Radius Map with GeoCheck®

**Planned School Site
Vacant Land
Ladera, CA 92675**

Inquiry Number: 711799.1s

December 07, 2001

The Source For Environmental Risk Management Data

**3530 Post Road
Southport, Connecticut 06490**

Nationwide Customer Service

**Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com**

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary.....	ES1
Overview Map.....	2
Detail Map.....	3
Map Findings Summary.....	4
Map Findings.....	6
Orphan Summary.....	7
Government Records Searched/Data Currency Tracking.....	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum.....	A-1
Physical Setting Source Summary.....	A-2
Physical Setting Source Map.....	A-6
Physical Setting Source Map Findings.....	A-7
Physical Setting Source Records Searched.....	A-8

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer

Copyright and Trademark Notice

This report contains information obtained from a variety of public and other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL EDR BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.

Entire contents copyright 2001 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and the edr logos are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc. (EDR). The report meets the government records search requirements of ASTM Standard Practice for Environmental Site Assessments, E 1527-00. Search distances are per ASTM standard or custom distances requested by the user.

TARGET PROPERTY INFORMATION

ADDRESS

VACANT LAND
LADERA, CA 92675

COORDINATES

Latitude (North): 33.543600 - 33° 32' 37.0"
Longitude (West): 117.637700 - 117° 38' 15.7"
Universal Transverse Mercator: Zone 11
UTM X (Meters): 440794.9
UTM Y (Meters): 3711542.2

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property: 2433117-E6 SAN JUAN CAPISTRANO, CA
Source: USGS 7.5 min quad index

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable") government records either on the target property or within the ASTM E 1527-00 search radius around the target property for the following databases:

FEDERAL ASTM STANDARD

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System
CERC-NFRAP..... CERCLIS No Further Remedial Action Planned
CORRACTS..... Corrective Action Report
RCRIS-TSD..... Resource Conservation and Recovery Information System
RCRIS-LQG..... Resource Conservation and Recovery Information System
RCRIS-SQG..... Resource Conservation and Recovery Information System
ERNS..... Emergency Response Notification System

STATE ASTM STANDARD

AWP..... Annual Workplan Sites
Cal-Sites..... Calsites Database
CHMIRS..... California Hazardous Material Incident Report System
Cortese..... "Cortese" Hazardous Waste & Substances Sites List

EXECUTIVE SUMMARY

Notify 65.....	Proposition 65 Records
Toxic Pits.....	Toxic Pits Cleanup Act Sites
SWF/LF.....	Solid Waste Information System
WMUDS/SWAT.....	Waste Management Unit Database
LUST.....	Leaking Underground Storage Tank Information System
CA BOND EXP. PLAN.....	Bond Expenditure Plan
UST.....	List of Underground Storage Tank Facilities
CA FID UST.....	Facility Inventory Database
HIST UST.....	Hazardous Substance Storage Container Database

FEDERAL ASTM SUPPLEMENTAL

CONSENT.....	Superfund (CERCLA) Consent Decrees
ROD.....	Records Of Decision
Delisted NPL.....	National Priority List Deletions
FINDS.....	Facility Index System/Facility Identification Initiative Program Summary Report
HMIRS.....	Hazardous Materials Information Reporting System
MLTS.....	Material Licensing Tracking System
MINES.....	Mines Master Index File
NPL Liens.....	Federal Superfund Liens
PADS.....	PCB Activity Database System
RAATS.....	RCRA Administrative Action Tracking System
TRIS.....	Toxic Chemical Release Inventory System
TSCA.....	Toxic Substances Control Act
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

STATE OR LOCAL ASTM SUPPLEMENTAL

AST.....	Aboveground Petroleum Storage Tank Facilities
CLEANERS.....	Drycleaner Facilities
CA WDS.....	Waste Discharge System
CA SLIC.....	Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
HAZNET.....	Hazardous Waste Information System
Orange Co. Industrial Site.....	List of Industrial Site Cleanups

EDR PROPRIETARY DATABASES

Coal Gas.....	Former Manufactured Gas (Coal Gas) Sites
---------------	--

SURROUNDING SITES: SEARCH RESULTS


Surrounding sites were not identified.

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

<u>Site Name</u>	<u>Database(s)</u>
LOMAS SAN JUAN MODEL HOME SITE	LUST
SAN JUAN COMPANY	UST
QUEST DIAGNOSTICS INC	UST
ARCO # 1706	UST
CHEVRON #93160	UST
SMWD TALEGA LIFT STATION	UST
TOSCO #5425	UST
POINT CENTER FINANCIAL INC	HAZNET
COUNTY ORANGE/EMA	HAZNET
COUNTY OF ORANGE/HARBORS BEACHES & PARKS	HAZNET
1X FORD MOTOR LAND DEVELOPMENT CO	HAZNET

OVERVIEW MAP - 711799.1s - Black Rock Geosciences

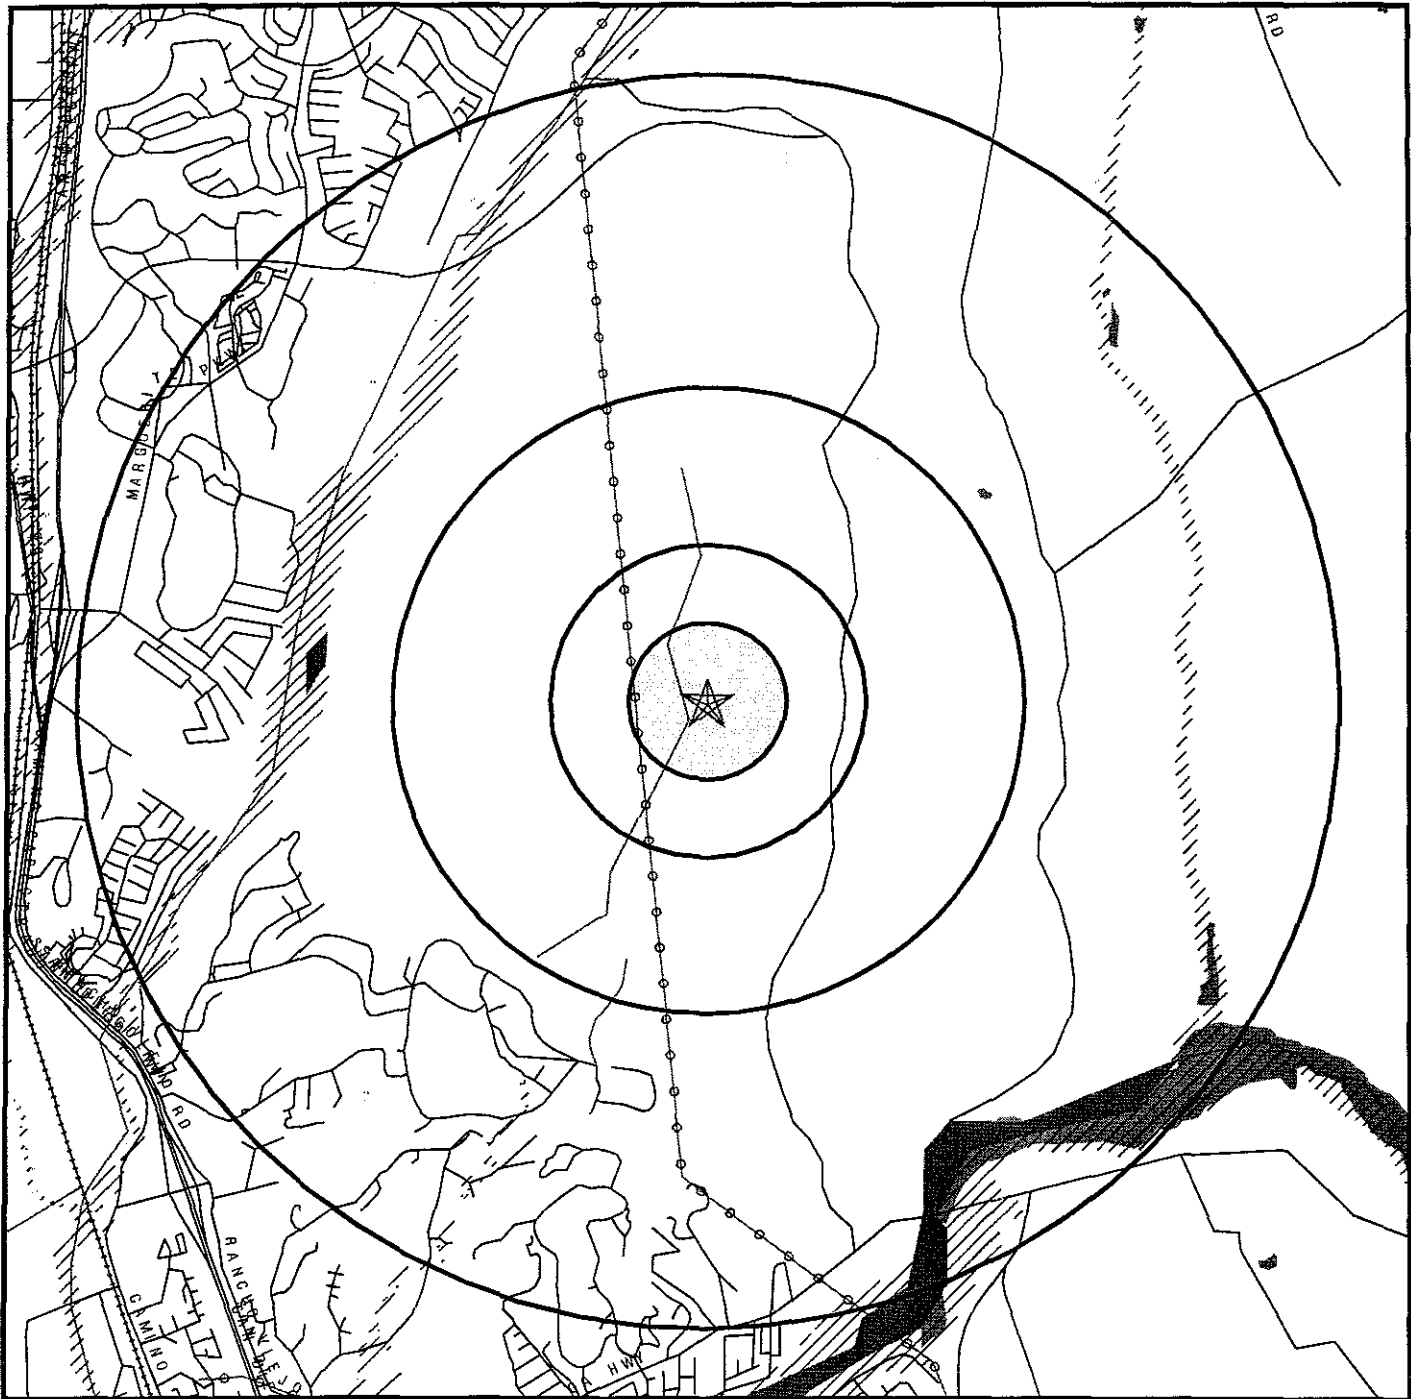

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites (if requested)
- National Priority List Sites
- Landfill Sites

- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▨ 500-year flood zone
- Wetlands


■ Areas of Concern



TARGET PROPERTY: Planned School Site
 ADDRESS: Vacant Land
 CITY/STATE/ZIP: Ladera CA 92675
 LAT/LONG: 33.5436 / 117.6377

CUSTOMER: Black Rock Geosciences
 CONTACT: Quin Kinnebrew
 INQUIRY #: 711799.1s
 DATE: December 07, 2001 12:49 pm

DETAIL MAP - 711799.1s - Black Rock Geosciences

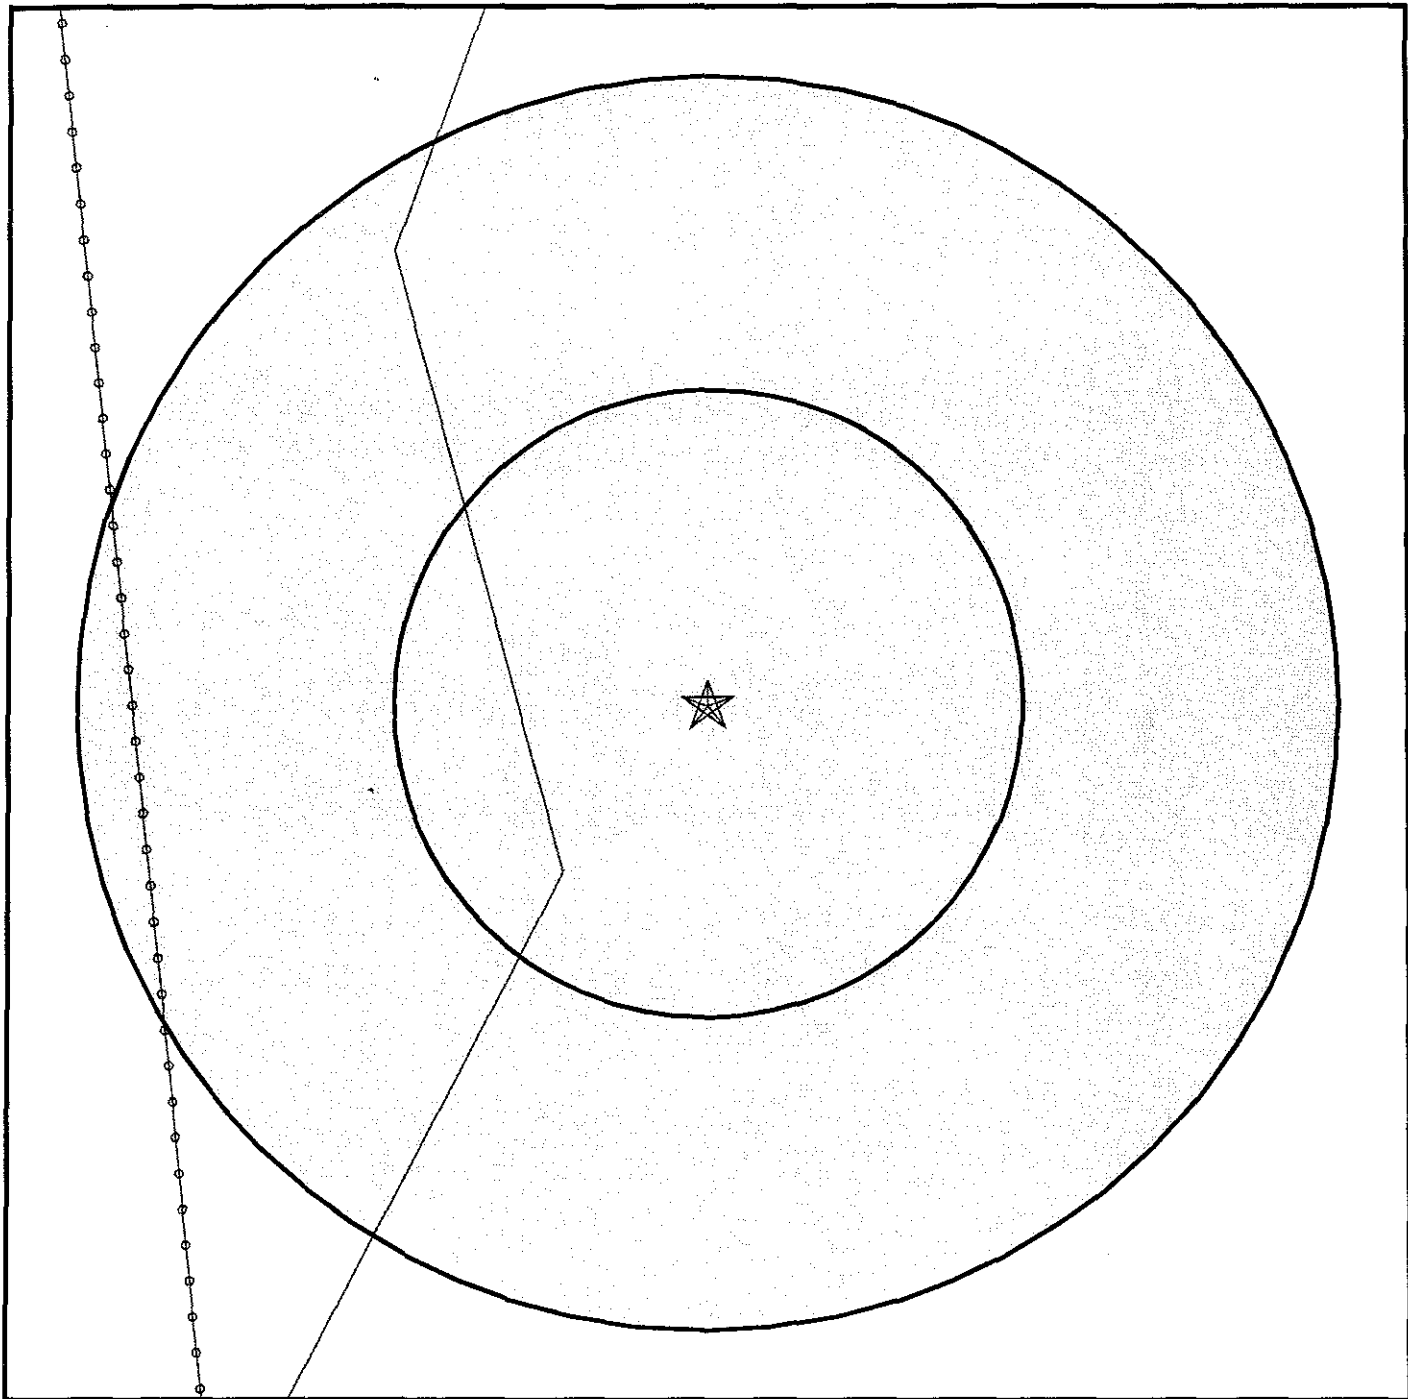

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites (if requested)
- ⌘ Sensitive Receptors
- National Priority List Sites
- Landfill Sites
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▩ 500-year flood zone
- ▤ Areas of Concern

TARGET PROPERTY:	Planned School Site	CUSTOMER:	Black Rock Geosciences
ADDRESS:	Vacant Land	CONTACT:	Quin Kinnebrew
CITY/STATE/ZIP:	Ladera CA 92675	INQUIRY #:	711799.1s
LAT/LONG:	33.5436 / 117.6377	DATE:	December 07, 2001 12:49 pm

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<u>FEDERAL ASTM STANDARD</u>								
NPL		1.500	0	0	0	0	0	0
Proposed NPL		1.500	0	0	0	0	0	0
CERCLIS		1.000	0	0	0	0	NR	0
CERC-NFRAP		0.750	0	0	0	0	NR	0
CORRACTS		1.500	0	0	0	0	0	0
RCRIS-TSD		1.000	0	0	0	0	NR	0
RCRIS Lg. Quan. Gen.		0.750	0	0	0	0	NR	0
RCRIS Sm. Quan. Gen.		0.750	0	0	0	0	NR	0
ERNS		0.500	0	0	0	NR	NR	0
<u>STATE ASTM STANDARD</u>								
AWP		1.500	0	0	0	0	0	0
Cal-Sites		1.500	0	0	0	0	0	0
CHMIRS		1.500	0	0	0	0	0	0
Cortese		1.500	0	0	0	0	0	0
Notify 65		1.500	0	0	0	0	0	0
Toxic Pits		1.500	0	0	0	0	0	0
State Landfill		1.000	0	0	0	0	NR	0
WMUDS/SWAT		1.000	0	0	0	0	NR	0
LUST		1.000	0	0	0	0	NR	0
CA Bond Exp. Plan		1.500	0	0	0	0	0	0
UST		0.750	0	0	0	0	NR	0
CA FID UST		0.750	0	0	0	0	NR	0
HIST UST		0.750	0	0	0	0	NR	0
<u>FEDERAL ASTM SUPPLEMENTAL</u>								
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
Delisted NPL		1.000	0	0	0	0	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
HMIRS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
NPL Liens	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
<u>STATE OR LOCAL ASTM SUPPLEMENTAL</u>								
AST	TP		NR	NR	NR	NR	NR	0
CLEANERS	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CA WDS		TP	NR	NR	NR	NR	NR	0
CA SLIC		0.500	0	0	0	NR	NR	0
HAZNET		0.250	0	0	NR	NR	NR	0
Orange Co. Industrial Site		TP	NR	NR	NR	NR	NR	0

EDR PROPRIETARY DATABASES

Coal Gas		1.000	0	0	0	0	NR	0
AQUIFLOW - see EDR Physical Setting Source Addendum								

TP = Target Property

NR = Not Requested at this Search Distance

* Sites may be listed in more than one database

Map ID
Direction
Distance
Distance (ft)
Elevation

MAP FINDINGS

Site	Database(s)	EDR ID Number	EPA ID Number
------	-------------	---------------	---------------

Coal Gas Site Search: No site was found in a search of Real Property Scan's ENVIROHAZ database.

NO SITES FOUND

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)	Facility ID
DANA POINT	S103982147	POINT CENTER FINANCIAL INC	34311 S COAST HWY	92675	HAZNET	CAC001416920
SAN JUAN CAPISTRANO	S103653287	COUNTY ORANGE/EMA	3301 ORETAGA HWY	92675	HAZNET	CAC001110208
SAN JUAN CAPISTRANO	S103653672	COUNTY OF ORANGE/HARBORS BEACHES & PARKS	33401 ORTEGA HWY/CASPERS PARK	92675	HAZNET	CAC000771808
SAN JUAN CAPISTRANO	U003433403	SAN JUAN COMPANY	31471 ORTEGA HWY	92675	UST	11166
SAN JUAN CAPISTRANO	U003778993	QUEST DIAGNOSTICS INC	33608 ORTEGA HWY	92675	UST	12344
SAN JUAN CAPISTRANO	U003783478	ARCO # 1706	26851 ORTEGA HWY # 1706	92675	UST	5456
SAN JUAN CAPISTRANO	U003799925	CHEVRON #93160	27112 ORTEGA HWY	92675	UST	
SAN JUAN CAPISTRANO	U003800119	SMWD TALEGA LIFT STATION	31500 ORTEGA HWY	92675	UST	
SAN JUAN CAPISTRANO	U003800140	TOSCO #5425	27164 ORTEGA HWY	92675	UST	
SAN JUAN CAPISTRANO	S100926569	1X FORD MOTOR LAND DEVELOPMENT CO	3360 ORTIGA HIGHWAY	92675	HAZNET	CAC000749384
SAN JUAN CAPISTRANO	S102432719	LOMAS SAN JUAN MODEL HOME SITE	TRACT 10139	92675	LUST	9UT197

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Elapsed ASTM days: Provides confirmation that this EDR report meets or exceeds the 90-day updating requirement of the ASTM standard

FEDERAL ASTM STANDARD RECORDS

NPL: National Priority List

Source: EPA

Telephone: N/A

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices

Date of Government Version: 07/26/01

Date Made Active at EDR: 08/28/01

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 08/06/01

Elapsed ASTM days: 22

Date of Last EDR Contact: 11/05/01

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1

Telephone 617-918-1143

EPA Region 3

Telephone 215-814-5418

EPA Region 4

Telephone 404-562-8033

EPA Region 6

Telephone: 214-655-6659

EPA Region 8

Telephone: 303-312-6774

Proposed NPL: Proposed National Priority List Sites

Source: EPA

Telephone: N/A

Date of Government Version: 07/26/01

Date Made Active at EDR: 08/28/01

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 08/06/01

Elapsed ASTM days: 22

Date of Last EDR Contact: 11/05/01

CERCLIS: Comprehensive Environmental Response Compensation, and Liability Information System

Source: EPA

Telephone: 703-413-0223

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 07/12/01

Date Made Active at EDR: 10/16/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 09/24/01

Elapsed ASTM days: 22

Date of Last EDR Contact: 09/24/01

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Source: EPA

Telephone: 703-413-0223

As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not needlessly repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/12/01
Date Made Active at EDR: 10/16/01
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 09/24/01
Elapsed ASTM days: 22
Date of Last EDR Contact: 09/24/01

CORRACTS: Corrective Action Report

Source: EPA
Telephone: 800-424-9346
CORRACTS identifies hazardous waste handlers with RCRA corrective action activity

Date of Government Version: 09/20/01
Date Made Active at EDR: 10/30/01
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 09/24/01
Elapsed ASTM days: 36
Date of Last EDR Contact: 09/11/01

RCRIS: Resource Conservation and Recovery Information System

Source: EPA/NTIS
Telephone: 800-424-9346
Resource Conservation and Recovery Information System RCRIS includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA)

Date of Government Version: 06/21/00
Date Made Active at EDR: 07/31/00
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 07/10/00
Elapsed ASTM days: 21
Date of Last EDR Contact: 11/07/01

ERNS: Emergency Response Notification System

Source: EPA/NTIS
Telephone: 202-260-2342
Emergency Response Notification System ERNS records and stores information on reported releases of oil and hazardous substances

Date of Government Version: 08/08/00
Date Made Active at EDR: 09/06/00
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 08/11/00
Elapsed ASTM days: 26
Date of Last EDR Contact: 10/25/01

FEDERAL ASTM SUPPLEMENTAL RECORDS

BRS: Biennial Reporting System

Source: EPA/NTIS
Telephone: 800-424-9346
The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities

Date of Government Version: 12/31/99
Database Release Frequency: Biennially

Date of Last EDR Contact: 09/18/01
Date of Next Scheduled EDR Contact: 12/17/01

CONSENT: Superfund (CERCLA) Consent Decrees

Source: EPA Regional Offices
Telephone: Varies
Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters

Date of Government Version: N/A
Database Release Frequency: Varies

Date of Last EDR Contact: N/A
Date of Next Scheduled EDR Contact: N/A

ROD: Records Of Decision

Source: NTIS
Telephone: 703-416-0223
Record of Decision ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/30/00
Database Release Frequency: Annually

Date of Last EDR Contact: 10/09/01
Date of Next Scheduled EDR Contact: 01/07/02

DELISTED NPL: National Priority List Deletions

Source: EPA
Telephone: N/A

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425 (e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 07/26/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/05/01
Date of Next Scheduled EDR Contact: 02/04/02

FINDS: Facility Index System/Facility Identification Initiative Program Summary Report

Source: EPA
Telephone: N/A

Facility Index System. FINDS contains both facility information and pointers to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/13/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

HMIRS: Hazardous Materials Information Reporting System

Source: U. S. Department of Transportation
Telephone: 202-366-4526

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 05/31/01
Database Release Frequency: Annually

Date of Last EDR Contact: 10/22/01
Date of Next Scheduled EDR Contact: 01/21/02

MLTS: Material Licensing Tracking System

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 05/29/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

MINES: Mines Master Index File

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959

Date of Government Version: 08/24/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/01/01
Date of Next Scheduled EDR Contact: 12/31/01

NPL LIENS: Federal Superfund Liens

Source: EPA
Telephone: 205-564-4267

Federal Superfund Liens. Under the authority granted the USEPA by the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner receives notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/91
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

PADS: PCB Activity Database System

Source: EPA
Telephone: 202-260-3936

PCB Activity Database PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities

Date of Government Version: 09/30/01
Database Release Frequency: Annually

Date of Last EDR Contact: 11/13/01
Date of Next Scheduled EDR Contact: 02/12/02

RAATS: RCRA Administrative Action Tracking System

Source: EPA
Telephone: 202-564-4104

RCRA Administration Action Tracking System RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA For administration actions after September 30 1995 data entry in the RAATS database was discontinued EPA will retain a copy of the database for historical records It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database

Date of Government Version: 04/17/95
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 09/13/01
Date of Next Scheduled EDR Contact: 12/10/01

TRIS: Toxic Chemical Release Inventory System

Source: EPA
Telephone: 202-260-1531

Toxic Release Inventory System TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/99
Database Release Frequency: Annually

Date of Last EDR Contact: 09/24/01
Date of Next Scheduled EDR Contact: 12/24/01

TSCA: Toxic Substances Control Act

Source: EPA
Telephone: 202-260-1444

Toxic Substances Control Act TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/98
Database Release Frequency: Every 4 Years

Date of Last EDR Contact: 10/24/01
Date of Next Scheduled EDR Contact: 01/21/02

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-564-2501

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/19/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/25/01
Date of Next Scheduled EDR Contact: 12/24/01

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Source: EPA
Telephone: 202-564-2501

Date of Government Version: 07/19/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/25/01
Date of Next Scheduled EDR Contact: 12/24/01

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

STATE OF CALIFORNIA ASTM STANDARD RECORDS

AWP: Annual Workplan Sites

Source: California Environmental Protection Agency
Telephone: 916-323-3400

Known Hazardous Waste Sites. California DTSC's Annual Workplan (AWP), formerly BEP identifies known hazardous substance sites targeted for cleanup

Date of Government Version: 11/08/00

Date Made Active at EDR: 03/02/01

Database Release Frequency: Annually

Date of Data Arrival at EDR: 01/31/01

Elapsed ASTM days: 30

Date of Last EDR Contact: 10/30/01

CAL-SITES: Calsites Database

Source: Department of Toxic Substance Control
Telephone: 916-323-3400

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database.

Date of Government Version: 10/01/00

Date Made Active at EDR: 11/22/00

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 10/30/00

Elapsed ASTM days: 23

Date of Last EDR Contact: 10/16/01

CHMIRS: California Hazardous Material Incident Report System

Source: Office of Emergency Services
Telephone: 916-464-3283

California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 12/31/94

Date Made Active at EDR: 04/24/95

Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 03/13/95

Elapsed ASTM days: 42

Date of Last EDR Contact: 11/26/01

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

Source: CAL EPA/Office of Emergency Information
Telephone: 916-327-1848

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWF/LS) and the Department of Toxic Substances Control (Cal-Sites)

Date of Government Version: 04/01/01

Date Made Active at EDR: 07/26/01

Database Release Frequency: Varies

Date of Data Arrival at EDR: 05/29/01

Elapsed ASTM days: 58

Date of Last EDR Contact: 10/30/01

NOTIFY 65: Proposition 65 Records

Source: State Water Resources Control Board
Telephone: 916-657-0696

Proposition 65 Notification Records. NOTIFY 65 contains facility notifications about any release which could impact drinking water and thereby expose the public to a potential health risk.

Date of Government Version: 10/21/93

Date Made Active at EDR: 11/19/93

Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 11/01/93

Elapsed ASTM days: 18

Date of Last EDR Contact: 10/22/01

TOXIC PITS: Toxic Pits Cleanup Act Sites

Source: State Water Resources Control Board
Telephone: 916-227-4364

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/95

Date Made Active at EDR: 09/26/95

Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 08/30/95

Elapsed ASTM days: 27

Date of Last EDR Contact: 11/05/01

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SWF/LF (SWIS): Solid Waste Information System

Source: Integrated Waste Management Board

Telephone: 916-341-6320

Active, Closed and Inactive Landfills SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 09/20/01

Date Made Active at EDR: 10/19/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 09/21/01

Elapsed ASTM days: 28

Date of Last EDR Contact: 09/21/01

WMUDS/SWAT: Waste Management Unit Database

Source: State Water Resources Control Board

Telephone: 916-227-4448

Waste Management Unit Database System WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

Date of Government Version: 04/01/00

Date Made Active at EDR: 05/10/00

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 04/10/00

Elapsed ASTM days: 30

Date of Last EDR Contact: 09/13/01

LUST: Leaking Underground Storage Tank Information System

Source: State Water Resources Control Board

Telephone: 916-445-6532

Leaking Underground Storage Tank Incident Reports LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 08/07/01

Date Made Active at EDR: 09/07/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 08/09/01

Elapsed ASTM days: 29

Date of Last EDR Contact: 11/08/01

CA BOND EXP. PLAN: Bond Expenditure Plan

Source: Department of Health Services

Telephone: 916-255-2118

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/89

Date Made Active at EDR: 08/02/94

Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 07/27/94

Elapsed ASTM days: 6

Date of Last EDR Contact: 05/31/94

CA UST:

UST: Active UST Facilities

Source: SWRCB

Telephone: 916-341-5700

Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 10/30/01

Date Made Active at EDR: 11/14/01

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 11/05/01

Elapsed ASTM days: 9

Date of Last EDR Contact: 10/15/01

CA FID UST: Facility Inventory Database

Source: California Environmental Protection Agency

Telephone: 916-445-6532

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/31/94
Date Made Active at EDR: 09/29/95
Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 09/05/95
Elapsed ASTM days: 24
Date of Last EDR Contact: 12/28/98

HIST UST: Hazardous Substance Storage Container Database

Source: State Water Resources Control Board
Telephone: 916-227-4408

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county source for current data.

Date of Government Version: 10/15/90
Date Made Active at EDR: 02/12/91
Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 01/25/91
Elapsed ASTM days: 18
Date of Last EDR Contact: 07/26/01

STATE OF CALIFORNIA ASTM SUPPLEMENTAL RECORDS

AST: Aboveground Petroleum Storage Tank Facilities

Source: State Water Resources Control Board
Telephone: 916-227-4382
Registered Aboveground Storage Tanks.

Date of Government Version: 08/21/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 11/05/01
Date of Next Scheduled EDR Contact: 02/04/02

CLEANERS: Drycleaner Facilities

Source: Department of Toxic Substance Control
Telephone: 916-225-0873

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

Date of Government Version: 07/27/01
Database Release Frequency: Annually

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

CA WDS: Waste Discharge System

Source: State Water Resources Control Board
Telephone: 916-657-1571
Sites which have been issued waste discharge requirements.

Date of Government Version: 07/19/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/25/01
Date of Next Scheduled EDR Contact: 12/24/01

HAZNET: Hazardous Waste Information System

Source: California Environmental Protection Agency
Telephone: 916-255-1136

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 350,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method.

Date of Government Version: 12/31/00
Database Release Frequency: Annually

Date of Last EDR Contact: 11/13/01
Date of Next Scheduled EDR Contact: 02/11/01

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LOCAL RECORDS

ALAMEDA COUNTY:

Local Oversight Program Listing of UGT Cleanup Sites

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700

Date of Government Version: 07/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/30/01
Date of Next Scheduled EDR Contact: 01/28/02

Underground Tanks

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700

Date of Government Version: 12/01/00
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/30/01
Date of Next Scheduled EDR Contact: 01/28/02

CONTRA COSTA COUNTY:

Site List

Source: Contra Costa Health Services Department
Telephone: 925-646-2286

List includes sites from the underground tank hazardous waste generator and business plan/2185 programs.

Date of Government Version: 09/01/00
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 09/04/01
Date of Next Scheduled EDR Contact: 12/03/01

FRESNO COUNTY:

CUPA Resources List

Source: Dept. of Community Health
Telephone: 559-445-3271

Certified Unified Program Agency CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

Date of Government Version: 11/14/01
Database Release Frequency: N/A

Date of Last EDR Contact: 11/13/01
Date of Next Scheduled EDR Contact: 02/11/02

KERN COUNTY:

Underground Storage Tank Sites & Tanks Listing

Source: Kern County Environment Health Services Department
Telephone: 661-862-8700

Kern County Sites and Tanks Listing.

Date of Government Version: 08/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 12/03/01
Date of Next Scheduled EDR Contact: 03/04/02

LOS ANGELES COUNTY:

List of Solid Waste Facilities

Source: La County Department of Public Works
Telephone: 818-458-5185

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/16/98
Database Release Frequency: Varies

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of El Segundo Underground Storage Tank

Source: City of El Segundo Fire Department
Telephone: 310-607-2239

Date of Government Version: 11/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of Long Beach Underground Storage Tank

Source: City of Long Beach Fire Department
Telephone: 562-570-2543

Date of Government Version: 10/01/99
Database Release Frequency: Annually

Date of Last EDR Contact: 11/26/01
Date of Next Scheduled EDR Contact: 02/25/02

City of Torrance Underground Storage Tank

Source: City of Torrance Fire Department
Telephone: 310-618-2973

Date of Government Version: 02/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of Los Angeles Landfills

Source: Engineering & Construction Division
Telephone: 213-473-7869

Date of Government Version: 08/31/99
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 09/19/01
Date of Next Scheduled EDR Contact: 12/17/01

HMS: Street Number List

Source: Department of Public Works
Telephone: 626-458-3517
Industrial Waste and Underground Storage Tank Sites

Date of Government Version: 06/28/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

Site Mitigation List

Source: Community Health Services
Telephone: 323-890-7806
Industrial sites that have had some sort of spill or complaint

Date of Government Version: 01/11/01
Database Release Frequency: Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

San Gabriel Valley Areas of Concern

Source: EPA Region 9
Telephone: 415-744-2407
San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office

Date of Government Version: 12/31/98
Database Release Frequency: N/A

Date of Last EDR Contact: 06/29/99
Date of Next Scheduled EDR Contact: N/A

MARIN COUNTY:

Underground Storage Tank Sites

Source: Public Works Department Waste Management
Telephone: 415-499-6647
Currently permitted USTs in Marin County

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/16/98
Database Release Frequency: Varies

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of El Segundo Underground Storage Tank

Source: City of El Segundo Fire Department
Telephone: 310-607-2239

Date of Government Version: 11/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of Long Beach Underground Storage Tank

Source: City of Long Beach Fire Department
Telephone: 562-570-2543

Date of Government Version: 10/01/99
Database Release Frequency: Annually

Date of Last EDR Contact: 11/26/01
Date of Next Scheduled EDR Contact: 02/25/02

City of Torrance Underground Storage Tank

Source: City of Torrance Fire Department
Telephone: 310-618-2973

Date of Government Version: 02/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

City of Los Angeles Landfills

Source: Engineering & Construction Division
Telephone: 213-473-7869

Date of Government Version: 08/31/99
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 09/19/01
Date of Next Scheduled EDR Contact: 12/17/01

HMS: Street Number List

Source: Department of Public Works
Telephone: 626-458-3517
Industrial Waste and Underground Storage Tank Sites

Date of Government Version: 06/28/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

Site Mitigation List

Source: Community Health Services
Telephone: 323-890-7806
Industrial sites that have had some sort of spill or complaint

Date of Government Version: 01/11/01
Database Release Frequency: Annually

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

San Gabriel Valley Areas of Concern

Source: EPA Region 9
Telephone: 415-744-2407
San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office

Date of Government Version: 12/31/98
Database Release Frequency: N/A

Date of Last EDR Contact: 06/29/99
Date of Next Scheduled EDR Contact: N/A

MARIN COUNTY:

Underground Storage Tank Sites

Source: Public Works Department Waste Management
Telephone: 415-499-6647
Currently permitted USTs in Marin County

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/05/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/05/01
Date of Next Scheduled EDR Contact: 02/04/02

NAPA COUNTY:

Sites With Reported Contamination

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269

Date of Government Version: 10/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/02/01
Date of Next Scheduled EDR Contact: 12/31/01

Closed and Operating Underground Storage Tank Sites

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269

Date of Government Version: 10/01/01
Database Release Frequency: Annually

Date of Last EDR Contact: 10/02/01
Date of Next Scheduled EDR Contact: 12/31/01

ORANGE COUNTY:

List of Underground Storage Tank Cleanups

Source: Health Care Agency
Telephone: 714-834-3446
Orange County Underground Storage Tank Cleanups (LUST)

Date of Government Version: 09/20/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

List of Underground Storage Tank Facilities

Source: Health Care Agency
Telephone: 714-834-3446
Orange County Underground Storage Tank Facilities (UST)

Date of Government Version: 09/25/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

List of Industrial Site Cleanups

Source: Health Care Agency
Telephone: 714-834-3446
Petroleum and non-petroleum spills

Date of Government Version: 10/24/00
Database Release Frequency: Annually

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

PLACER COUNTY:

Master List of Facilities

Source: Placer County Health and Human Services
Telephone: 530-889-7335
List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 09/25/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 09/25/01
Date of Next Scheduled EDR Contact: 12/24/01

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RIVERSIDE COUNTY:

Listing of Underground Tank Cleanup Sites

Source: Department of Public Health

Telephone: 909-358-5055

Riverside County Underground Storage Tank Cleanup Sites (LUST)

Date of Government Version: 09/05/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/22/01

Date of Next Scheduled EDR Contact: 01/21/02

Underground Storage Tank Tank List

Source: Health Services Agency

Telephone: 909-358-5055

Date of Government Version: 08/01/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/22/01

Date of Next Scheduled EDR Contact: 01/21/02

SACRAMENTO COUNTY:

CS - Contaminated Sites

Source: Sacramento County Environmental Management

Telephone: 916-875-8450

Date of Government Version: 08/08/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 11/05/01

Date of Next Scheduled EDR Contact: 02/04/02

ML - Regulatory Compliance Master List

Source: Sacramento County Environmental Management

Telephone: 916-875-8450

Any business that has hazardous materials on site - hazardous material storage sites underground storage tanks waste generators

Date of Government Version: 08/08/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 11/05/01

Date of Next Scheduled EDR Contact: 02/04/02

SAN BERNARDINO COUNTY:

Hazardous Material Permits

Source: San Bernardino County Fire Department Hazardous Materials Division

Telephone: 909-387-3041

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators and waste oil generators/handlers

Date of Government Version: 08/13/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 08/13/01

Date of Next Scheduled EDR Contact: 12/10/01

SAN DIEGO COUNTY:

Solid Waste Facilities

Source: Department of Health Services

Telephone: 619-338-2209

San Diego County Solid Waste Facilities

Date of Government Version: 07/01/98

Database Release Frequency: Annually

Date of Last EDR Contact: 11/30/01

Date of Next Scheduled EDR Contact: 02/25/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Hazardous Materials Management Division Database

Source: Hazardous Materials Management Division

Telephone: 619-338-2268

The database includes: HE58 - This report contains the business name site address, business phone number establishment 'H' permit number, type of permit and the business status HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases non-tank cases, groundwater contamination, and soil contamination are included)

Date of Government Version: 10/08/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

SAN FRANCISCO COUNTY:

Local Oversight Facilities

Source: Department Of Public Health San Francisco County

Telephone: 415-252-3920

Date of Government Version: 09/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

Underground Storage Tank Information

Source: Department of Public Health

Telephone: 415-252-3920

Date of Government Version: 09/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

SAN MATEO COUNTY:

Fuel Leak List

Source: San Mateo County Environmental Health Services Division

Telephone: 650-363-1921

Date of Government Version: 07/05/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/30/01
Date of Next Scheduled EDR Contact: 01/28/02

Business Inventory

Source: San Mateo County Environmental Health Services Division

Telephone: 650-363-1921

List includes Hazardous Materials Business Plan hazardous waste generators, and underground storage tanks.

Date of Government Version: 05/15/01
Database Release Frequency: Annually

Date of Last EDR Contact: 10/16/01
Date of Next Scheduled EDR Contact: 01/14/02

SANTA CLARA COUNTY:

Fuel Leak Site Activity Report

Source: Santa Clara Valley Water District

Telephone: 408-927-0710

Date of Government Version: 07/09/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/01/01
Date of Next Scheduled EDR Contact: 12/31/01

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Hazardous Material Facilities

Source: City of San Jose Fire Department
Telephone: 408-277-4659

Date of Government Version: 06/13/00
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/11/01
Date of Next Scheduled EDR Contact: 12/10/01

SOLANO COUNTY:

Leaking Underground Storage Tanks

Source: Solano County Department of Environmental Management
Telephone: 707-421-6770

Date of Government Version: 07/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/19/01
Date of Next Scheduled EDR Contact: 12/17/01

Underground Storage Tanks

Source: Solano County Department of Environmental Management
Telephone: 707-421-6770

Date of Government Version: 07/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/19/01
Date of Next Scheduled EDR Contact: 12/17/01

SONOMA COUNTY:

Leaking Underground Storage Tank Sites

Source: Department of Health Services
Telephone: 707-525-6565

Date of Government Version: 07/25/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/30/01
Date of Next Scheduled EDR Contact: 01/28/02

SUTTER COUNTY:

Underground Storage Tanks

Source: Sutter County Department of Agriculture
Telephone: 530-822-7500

Date of Government Version: 07/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/09/01
Date of Next Scheduled EDR Contact: 01/07/02

VENTURA COUNTY:

Inventory of Illegal Abandoned and Inactive Sites

Source: Environmental Health Division
Telephone: 805-654-2813
Ventura County Inventory of Closed, Illegal Abandoned and Inactive Sites

Date of Government Version: 04/02/01
Database Release Frequency: Annually

Date of Last EDR Contact: 11/26/01
Date of Next Scheduled EDR Contact: 02/25/02

Listing of Underground Tank Cleanup Sites

Source: Environmental Health Division
Telephone: 805-654-2813
Ventura County Underground Storage Tank Cleanup Sites (LUST)

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/24/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/19/01
Date of Next Scheduled EDR Contact: 12/17/01

Underground Tank Closed Sites List

Source: Environmental Health Division
Telephone: 805-654-2813

Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.

Date of Government Version: 05/24/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/16/01
Date of Next Scheduled EDR Contact: 01/14/02

Business Plan, Hazardous Waste Producers, and Operating Underground Tanks

Source: Ventura County Environmental Health Division
Telephone: 805-654-2813

The BWT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste Producer (W), and/or Underground Tank (T) information

Date of Government Version: 09/10/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 09/18/01
Date of Next Scheduled EDR Contact: 12/17/01

YOLO COUNTY:

Underground Storage Tank Comprehensive Facility Report

Source: Yolo County Department of Health
Telephone: 530-666-8646

Date of Government Version: 01/23/01
Database Release Frequency: Annually

Date of Last EDR Contact: 10/22/01
Date of Next Scheduled EDR Contact: 01/21/02

California Regional Water Quality Control Board (RWQCB) LUST Records

LUST REG 1: Active Toxic Site Investigation

Source: California Regional Water Quality Control Board North Coast (1)
Telephone: 707-576-2220

Del Norte Humboldt Lake Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties For more current information please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/01
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 11/28/01
Date of Next Scheduled EDR Contact: 02/25/02

LUST REG 2: Fuel Leak List

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-286-0457

Date of Government Version: 07/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/18/01
Date of Next Scheduled EDR Contact: 01/14/02

LUST REG 3: Leaking Underground Storage Tank Database

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-549-3147

Date of Government Version: 11/19/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 11/19/01
Date of Next Scheduled EDR Contact: 02/18/02

LUST REG 4: Underground Storage Tank Leak List

Source: California Regional Water Quality Control Board Los Angeles Region (4)
Telephone: 213-266-6600

Los Angeles, Ventura counties For more current information, please refer to the State Water Resources Control Board's LUST database.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/09/01
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 10/18/01
Date of Next Scheduled EDR Contact: 12/31/01

LUST REG 5: Leaking Underground Storage Tank Database

Source: California Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-255-3125

Date of Government Version: 09/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

LUST REG 6L: Leaking Underground Storage Tank Case Listing

Source: California Regional Water Quality Control Board Lahontan Region (6)
Telephone: 916-542-5424

Date of Government Version: 07/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/22/01
Date of Next Scheduled EDR Contact: 01/07/02

LUST REG 6V: Leaking Underground Storage Tank Case Listing

Source: California Regional Water Quality Control Board Victorville Branch Office (6)
Telephone: 760-346-7491

Date of Government Version: 10/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/08/01
Date of Next Scheduled EDR Contact: 01/07/02

LUST REG 7: Leaking Underground Storage Tank Case Listing

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)
Telephone: 760-346-7491

Date of Government Version: 10/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/02/01
Date of Next Scheduled EDR Contact: 12/31/01

LUST REG 8: Leaking Underground Storage Tanks

Source: California Regional Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-4498
California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database

Date of Government Version: 07/23/01
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 10/11/01
Date of Next Scheduled EDR Contact: 01/07/02

LUST REG 9: Leaking Underground Storage Tank Report

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 619-467-2952
Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database

Date of Government Version: 03/01/01
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 10/22/01
Date of Next Scheduled EDR Contact: 01/21/02

California Regional Water Quality Control Board (RWQCB) SLIC Records

SLIC REG 1: Active Toxic Site Investigations

Source: California Regional Water Quality Control Board North Coast Region (1)
Telephone: 707-576-2220

Date of Government Version: 02/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/28/01
Date of Next Scheduled EDR Contact: 02/25/02

SLIC REG 2: Spills, Leaks Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-286-0457
Any contaminated site that impacts groundwater or has the potential to impact groundwater.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/01/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/15/01
Date of Next Scheduled EDR Contact: 01/14/02

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-549-3147

Any contaminated site that impacts groundwater or has the potential to impact groundwater.

Date of Government Version: 11/19/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/15/01
Date of Next Scheduled EDR Contact: 01/14/02

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Region Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6600

Any contaminated site that impacts groundwater or has the potential to impact groundwater.

Date of Government Version: 09/13/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 10/29/01
Date of Next Scheduled EDR Contact: 01/28/02

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-855-3075

Unregulated sites that impact groundwater or have the potential to impact groundwater.

Date of Government Version: 06/01/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/10/01
Date of Next Scheduled EDR Contact: 01/07/02

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board, Victorville Branch
Telephone: 619-241-6583

Date of Government Version: 07/19/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/09/01
Date of Next Scheduled EDR Contact: 01/07/02

SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Region Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-3298

Date of Government Version: 06/11/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 10/11/01
Date of Next Scheduled EDR Contact: 01/07/02

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-467-2980

Date of Government Version: 07/01/01
Database Release Frequency: Annually

Date of Last EDR Contact: 12/03/01
Date of Next Scheduled EDR Contact: 03/04/02

EDR PROPRIETARY DATABASES

Former Manufactured Gas (Coal Gas) Sites: The existence and location of Coal Gas sites is provided exclusively to EDR by Real Property Scan, Inc. ©Copyright 1993 Real Property Scan, Inc. For a technical description of the types of hazards which may be found at such sites, contact your EDR customer service representative.

Disclaimer Provided by Real Property Scan, Inc.

The information contained in this report has predominantly been obtained from publicly available sources produced by entities other than Real Property Scan. While reasonable steps have been taken to insure the accuracy of this report, Real Property Scan does not guarantee the accuracy of this report. Any liability on the part of Real Property Scan is strictly limited to a refund of the amount paid. No claim is made for the actual existence of toxins at any site. This report does not constitute a legal opinion.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

HISTORICAL AND OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

Oil/Gas Pipelines/Electrical Transmission Lines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines and electrical transmission lines.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 1999 from the U.S. Fish and Wildlife Service.

GEOCHECK® - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

PLANNED SCHOOL SITE
VACANT LAND
LADERA, CA 92675

TARGET PROPERTY COORDINATES

Latitude (North):	33.543598 - 33° 32' 37.0"
Longitude (West):	117.637703 - 117° 38' 15.7"
Universal Transverse Mercator:	Zone 11
UTM X (Meters):	440794.9
UTM Y (Meters):	3711542.2

EDR's GeoCheck Physical Setting Source Addendum has been developed to assist the environmental professional with the collection of physical setting source information in accordance with ASTM 1527-00, Section 7.2.3. Section 7.2.3 requires that a current USGS 7.5 Minute Topographic Map (or equivalent, such as the USGS Digital Elevation Model) be reviewed. It also requires that one or more additional physical setting sources be sought when (1) conditions have been identified in which hazardous substances or petroleum products are likely to migrate to or from the property, and (2) more information than is provided in the current USGS 7.5 Minute Topographic Map (or equivalent) is generally obtained, pursuant to local good commercial or customary practice, to assess the impact of migration of recognized environmental conditions in connection with the property. Such additional physical setting sources generally include information about the topographic, hydrologic, hydrogeologic, and geologic characteristics of a site, and wells in the area.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata. EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers)

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

USGS TOPOGRAPHIC MAP ASSOCIATED WITH THIS SITE

Target Property: 2433117-E6 SAN JUAN CAPISTRANO, CA
Source: USGS 7 5 min quad index

GENERAL TOPOGRAPHIC GRADIENT AT TARGET PROPERTY

Target Property: General West

Source: General Topographic Gradient has been determined from the USGS 1 Degree Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County
ORANGE, CA

FEMA Flood
Electronic Data
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 06059C0071E / CWPP

Additional Panels in search area: 06059C0066E / CWPP
06059C0065F / CWPP
06059C0072E / CWPP
06059C0075F / CWPP

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property
SAN JUAN CAPISTRANO

NWI Electronic
Data Coverage
Not Available

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Site-Specific Hydrogeological Data*:

Search Radius: 2.0 miles
Status: Not found

AQUIFLOW®

Search Radius: 2.000 Miles.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION

Era:	Cenozoic	Category:	Stratified Sequence
System:	Tertiary		
Series:	Miocene		
Code:	Tm (decoded above as Era, System & Series)		

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994)

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Component Name: CALLEGUAS

Soil Surface Texture: clay loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer

Soil Drainage Class: Well drained. Soils have intermediate water holding capacity. Depth to water table is more than 6 feet.

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: HIGH

Depth to Bedrock Min: > 8 inches

Depth to Bedrock Max: > 20 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Permeability Rate (in/hr)	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	16 inches	clay loam	Silt-Clay Materials (more than 35 pct passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 2.00 Min: 0.60	Max: 8.40 Min: 7.90
2	16 inches	20 inches	weathered bedrock	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: clay
gravelly - loam
stony - loam
loam

Surficial Soil Types: clay
gravelly - loam
stony - loam
loam

Shallow Soil Types: clay
silty clay loam

Deeper Soil Types: sandy clay loam
stratified

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

ADDITIONAL ENVIRONMENTAL RECORD SOURCES

According to ASTM E 1527-00, Section 7.2.2, "one or more additional state or local sources of environmental records may be checked, in the discretion of the environmental professional, to enhance and supplement federal and state sources... Factors to consider in determining which local or additional state records, if any, should be checked include (1) whether they are reasonably ascertainable, (2) whether they are sufficiently useful, accurate, and complete in light of the objective of the records review (see 7.1.1), and (3) whether they are obtained, pursuant to local, good commercial or customary practice." One of the record sources listed in Section 7.2.2 is water well information. Water well information can be used to assist the environmental professional in assessing sources that may impact groundwater flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1 000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1 000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION


<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No PWS System Found		

Note: PWS System location is not always the same as well location

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 711799.1s

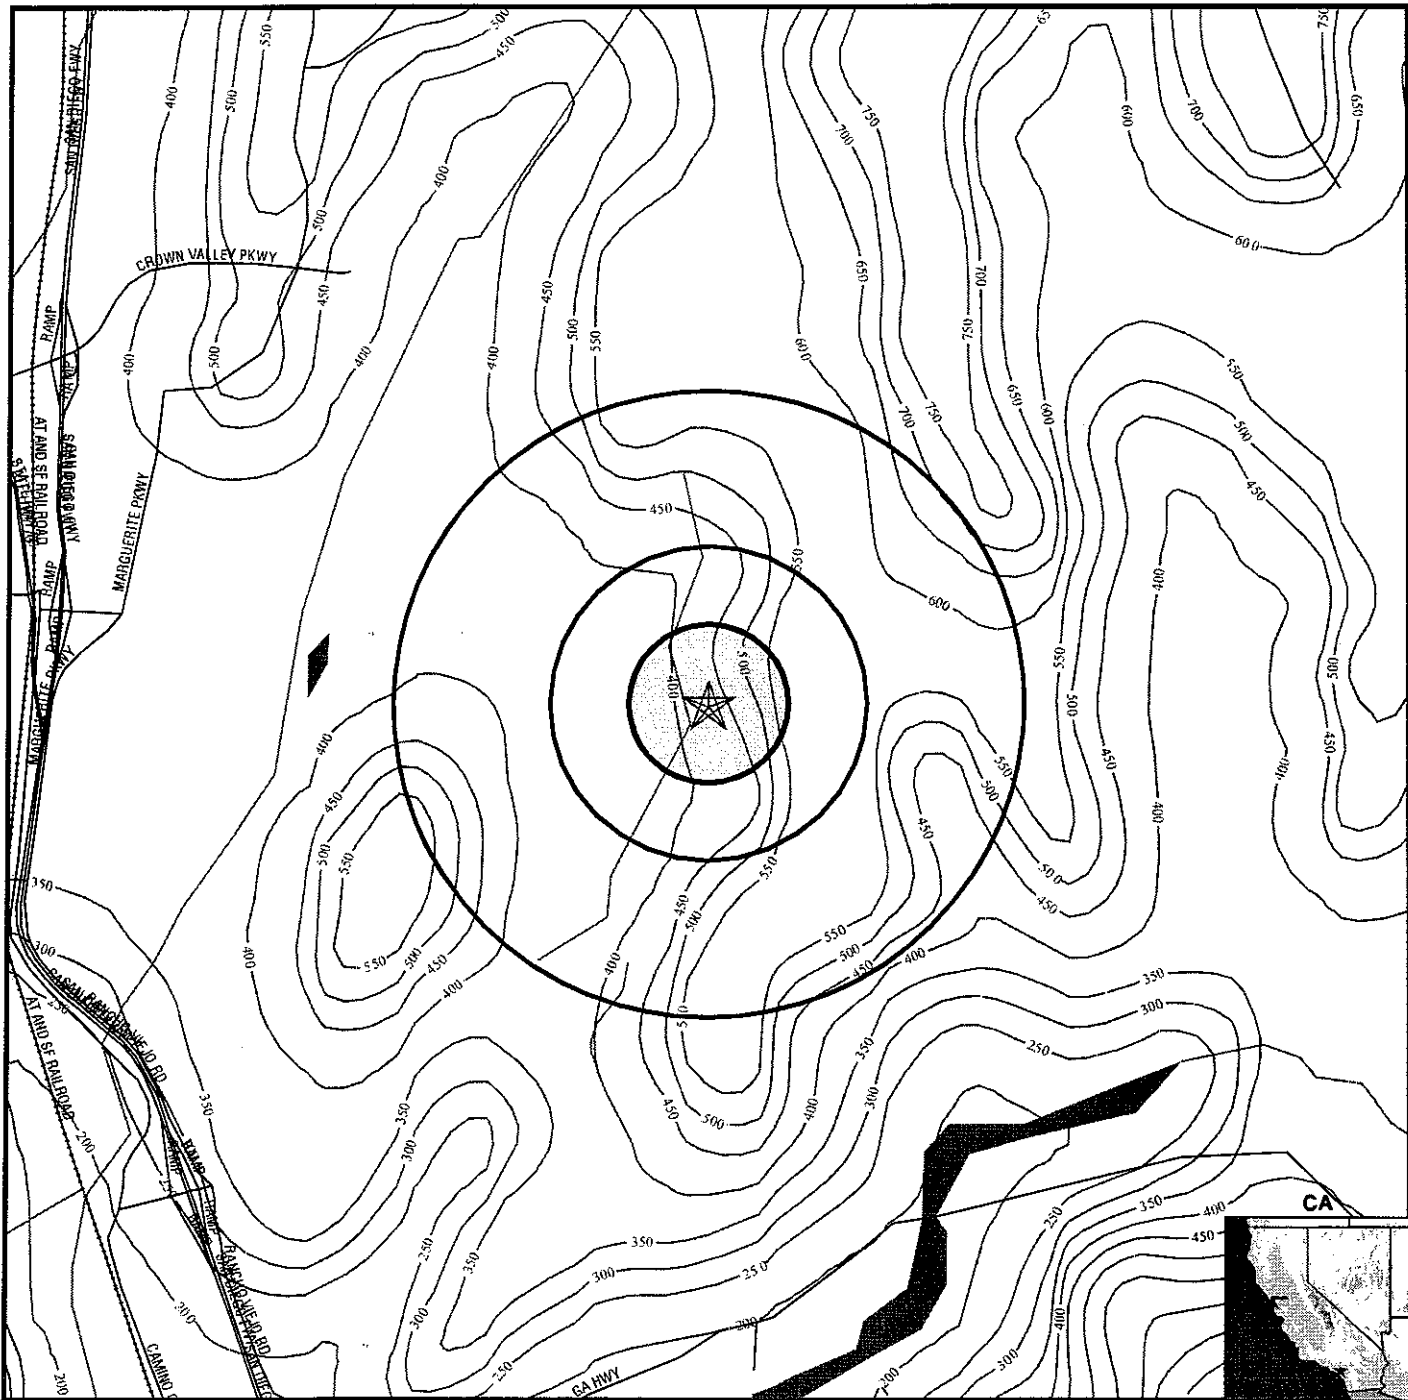

- Major Roads
- Contour Lines
- Earthquake Fault Lines
- Water Wells
- Public Water Supply Wells
- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Cluster of Multiple Icons
- Earthquake epicenter, Richter 5 or greater
- Closest Hydrogeological Data
- Oil, gas or related wells

TARGET PROPERTY: Planned School Site
ADDRESS: Vacant Land
CITY/STATE/ZIP: Ladera CA 92675
LAT/LONG: 33.5436 / 117.6377

CUSTOMER: Black Rock Geosciences
CONTACT: Quin Kinnebrew
INQUIRY #: 711799.1s
DATE: December 07, 2001 12:49 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for ORANGE County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L
: Zone 3 indoor average level < 2 pCi/L

Zip Code: 92675

Number of sites tested: 1

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	0.500 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 1999 from the U.S. Fish and Wildlife Service

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report hydrogeologically determined groundwater flow direction and depth to water table information

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map USGS Digital Data Series DDS - 11 (1994)

STATSGO: State Soil Geographic Database

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the national Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

ADDITIONAL ENVIRONMENTAL RECORD SOURCES

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-260-2805

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-260-2805

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: In November 1971 the United States Geological Survey (USGS) implemented a national water resource information tracking system. This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on more than 900,000 wells, springs, and other sources of groundwater.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STATE RECORDS

California Drinking Water Quality Database

Source: Department of Health Services

Telephone: 916-324-2319

The database includes all drinking water compliance and special studies monitoring for the state of California since 1984. It consists of over 3 200 000 individual analyses along with well and water system information

California Oil and Gas Well Locations for District 2 and 6

Source: Department of Conservation

Telephone: 916-323-1779

RADON

Area Radon Information: The National Radon Database has been developed by the U S Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones: Sections 307 & 309 of IRAA directed EPA to list and identify areas of U S with the potential for elevated indoor radon levels.

OTHER

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

California Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines, prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Database(s)
DANA POINT	S103882147	POINT CENTER FINANCIAL INC	34311 S COAST HWY	HAZNET
SAN JUAN CAPISTRANO	S103853287	COUNTY ORANGE/EMA	3301 ORETAGA HWY	HAZNET
SAN JUAN CAPISTRANO	S103853672	COUNTY OF ORANGE/HARBORS BEACHES & PARKS	33401 ORTEGA HWY	HAZNET
SAN JUAN CAPISTRANO	U003433403	SAN JUAN COMPANY	31471 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	U003778993	QUEST DIAGNOSTICS INC	33608 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	U003783478	ARCO # 1706	26851 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	U003799925	CHEVRON #93160	27112 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	U003800119	SMWD TALEGA LIFT STATION	31500 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	U003800140	TOSCO #5425	27164 ORTEGA HWY	UST
SAN JUAN CAPISTRANO	S100926569	1X FORD MOTOR LAND DEVELOPMENT CO	3360 ORTIGA HIGHWAY	HAZNET
SAN JUAN CAPISTRANO	S102432719	LOMAS SAN JUAN MODEL HOME SITE	TRACT 10139	LUST

ORPHAN SUMMARY

Site Name	Site Address	Zip	Database(s)	Facility ID
POINT CENTER FINANCIAL INC	34311 S COAST HWY	92675	HAZNET	CAC001416920
COUNTY ORANGE/EMA	3301 ORETAGA HWY	92675	HAZNET	CAC001110208
COUNTY OF ORANGE/HARBORS BEACHES & PARKS	33401 ORTEGA HWY/CASPER'S PARK	92675	HAZNET	CAC000771808
SAN JUAN COMPANY	31471 ORTEGA HWY	92675	UST	11166
QUEST DIAGNOSTICS INC	33608 ORTEGA HWY	92675	UST	12344
ARCO # 1706	26851 ORTEGA HWY # 1706	92675	UST	5456
CHEVRON #93160	27112 ORTEGA HWY		UST	
SMWD TALEGA LIFT STATION	31500 ORTEGA HWY		UST	
TOSCO #5425	27164 ORTEGA HWY		UST	
1X FORD MOTOR LAND DEVELOPMENT CO	3360 ORTIGA HIGHWAY	92675	HAZNET	CAC000749384
LOMAS SAN JUAN MODEL HOME SITE	TRACT 10139	92675	LUST	9UT197

DETAILED ORPHAN LISTING

Site	Database(s)	EDR ID Number EPA ID Number
POINT CENTER FINANCIAL INC 34311 S COAST HWY DANA POINT, CA 92675 HAZNET: Gepaid: CAC001416920 Tepaid: CAT080013352 Gen County: Orange Tsd County: Los Angeles Tons: .4170 Category: Waste oil and mixed oil Disposal Method: Recycler Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 30448 RANCHO VIEJO RD STE 200 SAN JUAN CAPISTRANO, CA 92675 County: Orange	HAZNET	S103982147 N/A
COUNTY ORANGE/EMA 3301 ORETAGA HWY SAN JUAN CAPISTRANO, CA 92675 HAZNET: Gepaid: CAC001110208 Tepaid: AZD049318009 Gen County: Orange Tsd County: 99 Tons: .4795 Category: Hydrocarbon solvents (benzene, hexane, Stoddard, etc.) Disposal Method: Transfer Station Contact: ORANGE COUNTY Telephone: (000) 000-0000 Mailing Address: 10852 DOUGLASS RD ANAHEIM CA 92806 County: Orange Gepaid: CAC001110208 Tepaid: AZD049318009 Gen County: Orange Tsd County: 99 Tons: .2710 Category: Hydrocarbon solvents (benzene hexane, Stoddard etc.) Disposal Method: Recycler Contact: ORANGE COUNTY Telephone: (000) 000-0000 Mailing Address: 10852 DOUGLASS RD ANAHEIM, CA 92806 County: Orange	HAZNET	S103653287 N/A
COUNTY OF ORANGE/HARBORS BEACHES & PARKS 33401 ORTEGA HWY/CASPER'S PARK SAN JUAN CAPISTRANO, CA 92675	HAZNET	S103653672 N/A

DETAILED ORPHAN LISTING

Site	Database(s)	EDR ID Number EPA ID Number
COUNTY OF ORANGE/HARBORS BEACHES & PARKS (Continued)		S103653672
HAZNET:		
Gepaid:	CAC000771808	
Tepaid:	CAT080013352	
Gen County:	Orange	
Tsd County:	Los Angeles	
Tons:	.1042	
Category:	Waste oil and mixed oil	
Disposal Method:	Recycler	
Contact:	COUNTY OF ORANGE/HARBORS BEACH	
Telephone:	(000) 000-0000	
Mailing Address:	300 FLOWER ST	
	SANTA ANA, CA 92701	
County	Orange	
SAN JUAN COMPANY	UST	U003433403
31471 ORTEGA HWY		N/A
SAN JUAN CAPISTRANO, CA 92675		
State UST:		
Facility ID:	11166	
Total Tanks:	1	
Region:	STATE	
Current Status:	Unknown	
UST Orange County:		
Region:	ORANGE	
Certificate Num:	09164	
Date Issued:	10/05/98	
QUEST DIAGNOSTICS INC	UST	U003778993
33608 ORTEGA HWY		N/A
SAN JUAN CAPISTRANO, CA 92675		
State UST:		
Facility ID:	12344	
Total Tanks:	2	
Region:	STATE	
Current Status:	Active	
Facility ID: 12344		
Total Tanks:	2	
Region:	STATE	
Current Status:	Unknown	
ARCO # 1706	UST	U003783478
26851 ORTEGA HWY # 1706		N/A
SAN JUAN CAPISTRANO, CA 92675		
State UST:		
Facility ID:	5456	
Total Tanks:	1	
Region:	STATE	
Current Status:	Unknown	

DETAILED ORPHAN LISTING

Site	Database(s)	EDR ID Number EPA ID Number
CHEVRON #93160 27112 ORTEGA HWY SAN JUAN CAPISTRANO, CA UST Orange County: Region: ORANGE Certificate Num: 09162 Date Issued: 10/05/98	UST	U003799925 N/A
SMWD TALEGA LIFT STATION 31500 ORTEGA HWY SAN JUAN CAPISTRANO, CA UST Orange County: Region: ORANGE Certificate Num: 09009 Date Issued: 12/18/98	UST	U003800119 N/A
TOSCO #5425 27164 ORTEGA HWY SAN JUAN CAPISTRANO, CA UST Orange County: Region: ORANGE Certificate Num: 08860 Date Issued: 12/07/98	UST	U003800140 N/A
1X FORD MOTOR LAND DEVELOPMENT CO 3360 ORTIGA HIGHWAY SAN JUAN CAPISTRANO, CA 92675 HAZNET: Gepaid: CAC000749384 Tepaid: CAD008252405 Gen County: Orange Tsd County: Los Angeles Tons: .9174 Category: Liquids with halogenated organic compounds > 1000 mg/l Disposal Method: Recycler Contact: FORD MOTOR COMPANY Telephone: (000) 000-0000 Mailing Address: ONE PARKLANE BLVD DEARBORN, MI 48126 County: Orange	HAZNET	S100926569 N/A
LOMAS SAN JUAN MODEL HOME SITE TRACT 10139 SAN JUAN CAPISTRANO, CA 92675 State LUST: Cross Street: LA NOVIA AVENUE Qty Leaked: Not reported Case Number: 9UT197 Reg Board: San Diego Region Chemical: Gasoline Lead Agency: Local Agency Local Agency : 30000 Case Type: Aquifer affected Status: Signed off, remedial action completed or deemed unnecessary	LUST	S102432719 N/A

DETAILED ORPHAN LISTING

Site	Database(s)	EDR ID Number	EPA ID Number
LOMAS SAN JUAN MODEL HOME SITE (Continued)		S102432719	
County:	Orange		
Abate Method:	Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)		
Review Date:	Not reported	Confirm Leak:	Not reported
Workplan:	10/30/1985	Prelim Assess:	10/30/1985
Pollution Char:	09/29/1986	Remed Plan:	09/29/1986
Remed Action:	Not reported	Monitoring:	Not reported
Close Date:	12/11/1991		
Release Date:	04/23/1985		
Cleanup Fund Id :	Not reported		
Discover Date :	04/12/1985		
Enforcement Dt :	Not reported		
Enf Type:	Not reported		
Enter Date :	04/23/1985		
Funding:	Responsible Party		
Staff Initials:	UNK		
How Discovered:	Other Means		
How Stopped:	Other Means		
Interim :	Yes		
Lat/Lon :	-117 6607491 / 33 5021355		
Leak Cause:	Unknown		
Leak Source:	Unknown		
Local Case # :	85UT40		
Beneficial:	MUN		
Staff :	UNK		
MTBE Date :	Not reported		
MTBE Tested :	NT		
Max MTBE GW :	Not reported		
GW Qualifies :	Not reported		
Max MTBE Soil :	Not reported		
Soil Qualifies :	Not reported		
Hydr Basin #:	901.27		
Operator :	GLENFED DEVELOPMENT CORP.		
Oversight Prgm :	LOP		
Priority :	Not reported		
Review Date :	08/27/1993		
Stop Date :	Not reported		
Office :	Not reported		
Work Suspended :	Not reported		
Responsible Party	GLENFED DEVELOPMENT CORP		
RP Address:	16601 VENTURA BOULEVARD, SUITE 200, ENCINO, CA 91436		
Global Id:	T0605902449		
Org Name:	Not reported		
Contact Person:	Not reported		
MTBE Conc:	0		
Mtbe Fuel:	1		
Water System Name:	CAPISTRANO VALLEY WD		
Well Name:	WELL 04 - ABANDONED		
Distance To Lust:	1054.8827410885008778212806875		
Waste Discharge Global ID:	W0605910030		
Waste Disch Assigned Name:	08S/07W-06N01 S		
Mtbe Class:	Not reported		
Summary:	FORMER GOLF COURSE MAINTENANCE FACILITY, 16000 YD3 SOIL EXCAVATED, AERATED, & USED AS BACKFILL @ SITE. 7 PPM B IN GW 9/85. PROPOSED VAPOR MEMBRANE BELOW EACH HOUSE FOUNDATION W/ MONITORING, STATUS REQSTED 2/21/90 BY OCHCA SITE V		

DETAILED ORPHAN LISTING

Site	Database(s)	EDR ID Number EPA ID Number
------	-------------	--------------------------------

LOMAS SAN JUAN MODEL HOME SITE (Continued)

S102432719

LUST Region 9:

Case Number:	9UT197	Release Date:	04/23/1985
Local Agency:	30000		
Substance:	8006619	Qty Leaked:	Not reported
Date Found:	04/12/1985	How Found:	Other Means
Date Stopped:	/ /	How Stopped:	Other Means
Source:	Unknown	Cause:	Unknown
Lead Agency:	Local Agency		
Status:	Signed off, remedial action completed or deemed unnecessary		
Case Type:	Aquifer affected		
Abate Method:	Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)		
Confirm Date:	4/23/85	Submit Workplan:	4/23/85
Prelim Assess:	7/14/86	Desc Pollution:	7/14/86
Remed Plan:	Not reported	Remed Action:	Not reported
Began Monitor:	12/11/91	Closed Date:	12/11/91
Enforce Type:	Not reported		
Enforce Date:	Not reported		
Pilot Program:	LOP	Local Case:	85UT40
Basin Number:	901 27	Gwater Depth:	6.8'
File Dispn:	File discarded, case closed		
Interim Remedial Actions:	Yes		
Beneficial Use:	MUN		
Cleanup and Abatement order Number:	Not reported		
Waste Discharge Requirement Number:	Not reported		
NPDES Number:	Not reported		