

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: CE000477
Version: VBR040CH/1

Full Report
Printed: 28/11/2024

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	Not Known
Work Provider:	OTHER	Able to Authorise Repairs:	TBA
Claim Reference:		Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	TBA
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	VAUXHALL
Model:	CORSA Active
Model Sheet Number:	585
Engine:	1.2 LTR 63KW
Registration Number:	YT12FTF
VIN Number:	W0L0SDL68C4128460
Registration Month:	March
Registration Year:	2012
Odometer:	75000 miles
Colour:	Green
Paint Code:	GLE
Build Date:	FROM MODEL 2012
Selection Type:	AudaVIN+
Fuel Type:	Petrol
Vehicle Imported:	No

Model Specs

RADIO CD 30 MP3
FROM MODEL 2012
AIR CONDITIONING
REMOTE CENTRAL LOCK
ELECT WDW REGULATOR
EL/HEAT DOOR MIRROR
FOG LAMPS
MAN SEAT ADJ 4-WAY
PAINTED DOOR HANDLES
REAR SPLIT BACKREST
MULTI INFO DISPLAY
INS TRIM RING CHROME
S-WHEEL RADIO CONT
1.2 LTR 63KW
5 SPEED EASYTRONIC
LEATHER STRG WHEEL
ADJ STRG COLUMN
TYRES 195/55 HR 16
ALTERNATOR 120A
PHONE PREPARATION
WHEELS 6J X 16 ALLOY
SIDE AIRBAGS
5-DOOR
PLANT EISENACH
TWO COAT PEARL/MICA

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering Rim Ply:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	28/11/2024
Pre-Accident Damage:	

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: CE000477
Version: VBR040CH/1

Full Report
Printed: 28/11/2024

Tyres Condition:

Tread Depth LHF:



Tread Depth LHR:

Tread Depth RHF:

Tread Depth RHR:

Damage Areas:

Direction of Impact:

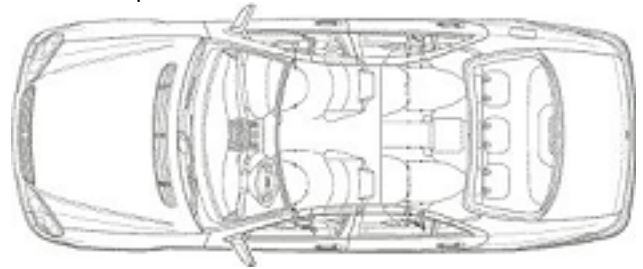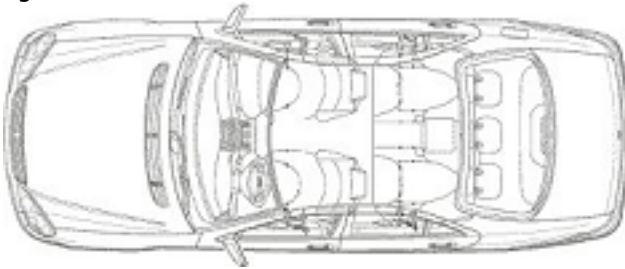

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: CE000477
Version: VBR040CH/1

Full Report
Printed: 28/11/2024

Addresses

No addresses entered.

Cost Summary

Total Labour	£380.00
Total Paint/Material	£475.17
Total Parts	£383.16
Additional Costs	£103.00
Grand Total Exc VAT:	£1,341.33
20 % VAT:	£268.27
Grand Total Inc VAT:	£1,609.60
Excess:	TBA

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £50.00/HR

Repair / Guide

Number	Description	Work Units
0110702	R + R FRONT TRIM	3.0
2040310	R + R L/FOG LAMP COVER	2.0
1420120010	RENEW L/FRONT PANELLING BRACKET	2.0
0110702004	R + R LEFT HEADLAMP	1.0
2040512)	ADJUST HEADLAMPS	2.0
1430490)	R + R L/WING COVER	2.0
NO NUMBER	R + R WING TRIM	1.0
0283	REPAIR FRONT BUMPER	10.0*
1000	SPECIALIST STANDARD SHUTDOWN	3.0*
1000	POSTCALIBRATION ROAD TEST	2.0*
Total Work Units		28.0
Total Panel / Mechanical Labour		2.80 HRS £140.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £50.00/HR

Repair / Guide

Number	Description	Work Units
283	FRONT TRIM REPAIR PAINT PLASTIC	15.0
741	L/F WING SURFACE PAINT	5.0
	PREPARATION FOR PRE-PAINTING	28.0

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: CE000477
Version: VBR040CH/1

Full Report
Printed: 28/11/2024

Total Work Units	48.0
Total Paintwork Labour	4.8 HRS. £240.00

MATERIAL COST - PAINT

COST

Total Paint Cost	£316.06
Sundry Paint Material	£42.65
Pre-Painting Sundry Materials	£109.44
Total Excluding Pearlescent Uplift	£468.15
Pearlescent Uplift @ 1.5%	£7.02
Total Paint And Material Cost	£475.17

PARTS

Price Valid: 01/11/2024

Guide No.	Description	Part Number	Bet.	Price
307	L/F OUT BUMP GRILLE	13344798	0%	£63.23
309	L/F BLANKING COVER	13345358	0%	£0.00
319	L/F OUT COVER BRKT	13179960	0%	£8.64
321	L/F INNER COVER BRKT	13286037	0%	£15.72
561	LEFT HEADLAMP ASSY	95511329	0%	£288.06
Sub Total				£375.65
Deduction from RRP				(0.0 %) £0.00
Sundry Parts				(2 %) £7.51
Total Parts				£383.16

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras		Description	Betterment	Price
		EPA Specialist	0%	£28.00
		REPAIR METHODS Specialist	0%	£25.00
		PRE DIAG_CHECK Specialist	0%	£25.00
		PRE REPAIR CHECK Specialist	0%	£25.00
Total Extras				£103.00

Calculation

28/11/2024

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: CE000477
Version: VBR040CH/1

Full Report
Printed: 28/11/2024

Labour			
	Total Panel/Mechanical	£140.00	
	Total Paintwork	£240.00	
Total Labour			£380.00
Total Paint/Material Costs			£475.17
Total Parts			£383.16
Additional Costs			
	Cost of Specialist	£103.00	
Total Additional Costs			£103.00
Grand Total Excl VAT			£1,341.33
	VAT @ 20 %		£268.27
Grand Total Incl VAT			£1,609.60
	Excess		TBA

Assessment Notes

No assessment notes entered.