

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	Not Known
Work Provider:	OTHER	Able to Authorise Repairs:	TBA
Claim Reference:		Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	TBA
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	FORD
Model:	PUMA ST-Line X
Model Sheet Number:	2PU
Engine:	1.0 LTR 114/115 KW
Registration Number:	YS71CGU
VIN Number:	WF02XXERK2MD04593
Registration Month:	December
Registration Year:	2021
Odometer:	54742 miles
Colour:	Black
Paint Code:	PN4GM
Build Date:	FROM 08/2021
Selection Type:	AudaVIN+
Fuel Type:	Petrol
Vehicle Imported:	No

Model Specs

FROM 08/2021
AUTO AIR CON
FRONT SCRREN DAMPER
WINDSCREEN HEATED
RAIN SENSOR
OUTS MIRROR W/ILLUM
AUDIO FORD CD/MP3 ME
NAVIGATION SYSTEM
RADIO DIGITAL
SMARTPHONE INTEGRAL
FORD SYNC 3
SYSTEM BLUETOOTH
MILD HYBRID SYSTEM
FOG LAMPS
INTERIOR LIGHT LED
COLOUR DISPLAY LCD 8
COMBI INSTR 12.3"
LEATHER GEAR KNOB
CLOTH/LEATHER TRIM
FRT SEAT LUMBAR ADJ
SERIES 34
HEIGHT ADJ PASS SEAT
ANTI-THEFT ALARM
WIRELESS CHARGE SYS
REAR PARKING SYSTEM
1.0 LTR 114/115 KW
6-SPEED GEARBOX
REAR BRAKE DISC
RADIAT GRILLE ACTIVE
CRUISE WITH POSITION
TYRES 215/50 WR 18
WHEELS 7J X 18 ALLOY
RADIO "B&O"
SPORT STEERING WHEEL
HEAD AIRBAG
FRONT SPORTS BUMPER
REAR SPORTS BUMPER

ROOF SPOILER BIG
SILL MOULDING PAINT
TWO COAT METALLIC

Vehicle Condition

Vehicle Status



Pre-Accident Condition:	As New	Severity of Impact:	
Steering Rim Ply:	Not testable	Vehicle Status on Inspection:	Unroadworthy
Brakes Pedal Travel:	Not testable	Date of Inspection:	04/12/2024
Place of Inspection:			
Pre-Accident Damage:	None Noted		

Tyres Condition: Excellent
Tread Depth LHF:
Tread Depth LHR:

Tread Depth RHF:
Tread Depth RHR:

Damage Areas:

Direction of Impact:

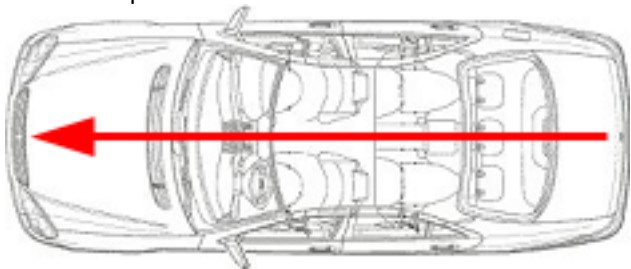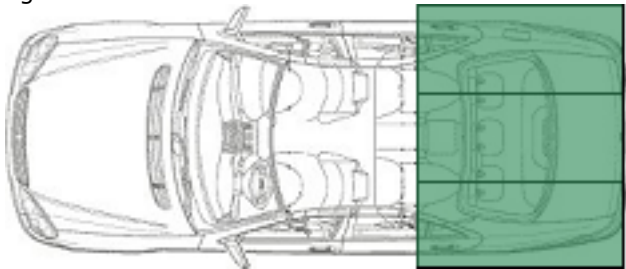

Assessment Number: PREM0342
Version: payg1148/4

Full Report
Printed: 22/01/2025

Addresses

Insured

Mrs Lorrance
65 Overmills Rd
Ayr
KA73LH
Mobile Tel : 07437014544

Repairer

Premier 1 ARC
45 Boundary Rd
Ayr
KA89DJ
Business Tel : 01292 435593
Mobile Tel : 07741279004

Cost Summary

Total Labour	£1,704.00
Total Paint/Material	£1,261.84
Total Parts	£2,153.04
Additional Costs	£271.00
Grand Total Exc VAT:	£5,389.88
20 % VAT:	£1,077.98
Grand Total Inc VAT:	£6,467.86
Excess:	TBA

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £80.00/HR

Repair / Guide

Number	Description	Work Units
NO NUMBER	R + R REAR CENTRE BUMPER BRACKET	2.0
43 447 1	R + R REAR BUMPER	5.0
	INCLUDES: R + R TAILLAMPS.	
43 447 4	RENEW REAR BUMPER (REMOVED)	3.0
43 447 5	ADD/TIME FOR RENEW REAR BUMPER COVER	3.0
	(VEHICLE WITH PARKING AID)	
	INCLUDES: STAMP HOLES	
40 122 1	R + R REAR SEAT CUSHION	1.0
40 128 1ZAX	R + R L/REAR SEAT REST	2.0
40 128 1ZAX	R + R R/REAR SEAT REST	2.0
44 674 4	R + R REAR BUMPER CROSSMEMBER	2.0
43 841 1)ZAX	R + R LEFT REAR WHEELHOUSE SHELL	1.0
43 841 1)ZAX	R + R RIGHT REAR WHEELHOUSE SHELL	1.0
NO NUMBER	STRIP + RETRIM REAR FLOOR	15.0
NO NUMBER	R + R LUGGAGE COMP FLOOR CARPET	1.0
44 734 0	RENEW TAILGATE	28.0
	INCLUDES: R + R TAILGATE,	
	ATTACHED PARTS CONVERT AND IF NEC RENEW	
11 211 1	R + R LEFT REAR WHEEL	1.0
11 211 1	R + R RIGHT REAR WHEEL	1.0

Assessment Number: PREM0342
Version: payg1148/4

Full Report
Printed: 22/01/2025

	Car Care Kit Renew		
	Window lift tape Renew		
2712	REPAIR REAR PANEL		30.0*
1000	PULLING REAR PANELS		10.0*
1000	CHECK AND QUALITY CONTROL		3.0*
1000	CHECK 4		
1000	Corrosion Prote TO 2 PANELS		5.0*
Total Work Units			116.0
Total Panel / Mechanical Labour		11.60 HRS	£928.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £80.00/HR

Repair /Guide	Description		
Number	TWO COAT METALLIC		Work Units
2640	REAR BUMPER C-MEMBERSURFACE PAINT		4.0
2931	BOOTLID/TAILGATE NEW PART PAINTING		16.0
2581	REAR BUMPER NEW PART PAINT K1R		9.0
2608	RR BUMPER WIND DEFL NEW PART PAINT K1R		8.0
2773	REAR LOWER SPOILER NEW PART PAINT K1R		4.0
2712	REAR PANEL REPAIR PAINTING <50%		11.0
3489	L/SIDE PANEL INSERT SURFACE PAINT		6.0
3490	R/SIDE PANEL INSERT SURFACE PAINT		6.0
1000	SIDE GLASS MASK x2 SURFACE PAINT		5.0*
	PREPARATION FOR PRE-PAINTING		28.0
Total Work Units			97.0
Total Paintwork Labour		9.7 HRS.	£776.00

MATERIAL COST - PAINT

COST

Total Paint Cost	£1,109.75
Sundry Paint Material	£109.44
Pre-Painting Sundry Materials	£42.65
Total Excluding Pearlescent Uplift	£1,261.84
Pearlescent Uplift @ 0.0%	£0.00
Total Paint And Material Cost	£1,261.84

PARTS

Price Valid: 01/01/2025

Guide No.	Description	Part Number	Bet.	Price
-----------	-------------	-------------	------	-------

**TEL: PREMIER 1 ARC
45 BOUNDARY ROAD
AYR KA8 9DJ**

Assessment Number: PREM0342
Version: payg1148/4

Full Report
Printed: 22/01/2025

2581	REAR BUMPER	2 548 147	0%	£369.71
2608	RR BUMPER WIND DEFL	2 577 418	0%	£312.53
2640	REAR BUMPER C-MEMBER	2 396 431	0%	£100.84
2645	RR CTR BUMPER BRKT	2 432 826	0%	£37.87
2773	RR LWR BUMPER COVER	NO NUMBER	0%	£90.13
2931	BOOTLID/TAILGATE	2 732 183	0%	£619.00
2977	REAR DOOR LOCK	2 475 591	0%	£75.31
2978	LOCK MOTOR	2 588 253	0%	£62.40
3015	REAR BADGE	1 947 613	0%	£30.89
3018	BADGE MODEL	2 494 626	0%	£28.29
3020	BADGE MOTOR TYP	2 431 523	0%	£24.43
3160	REAR SCREEN BOND KIT	2 053 958	0%	£38.05
3361	L/NUMBER PLATE LAMP	NO NUMBER	0%	£0.00
3362	R/NUMBER PLATE LAMP	NO NUMBER	0%	£0.00
3691	L/FASTENING CLIP	5 270 438	0%	£0.80
3692	R/FASTENING CLIP	5 270 438	0%	£0.80
3901	REAR FLOOR PANEL	2 491 827	0%	£236.23
3903	BONDING KIT	2 053 958	0%	£38.05
1000	Car Care Kit	Renew	0%	£10.00 *
1000	Window lift tape	Renew	0%	£15.00 *

Sub Total		£2,090.33
Deduction from RRP	(0.0 %)	£0.00
Sundry Parts	(3 %)	£62.71
Total Parts		£2,153.04

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras			
	Description	Betterment	Price
	PPE Specialist	0%	£10.00
	DECONTAMINATE VEH Specialist	0%	£30.00
	EPA Specialist	0%	£10.00
	ENERGY PAYMENT Specialist	0%	£50.00
	METHODS RESEARCH Specialist	0%	£25.00
	PRE_REP_DIAG_CHECK Specialist	0%	£65.00
	POST_REP_DIAG_CHEC Specialist	0%	£65.00
	K		
	Total Extras		£255.00

Calculation **10/01/2025**

Labour

Assessment Number: PREM0342
Version: payg1148/4

Full Report
Printed: 22/01/2025

	Total Panel/Mechanical	£928.00	
	Total Paintwork	£776.00	
Total Labour			£1,704.00
Total Paint/Material Costs			£1,261.84
Total Parts			£2,153.04
Additional Costs			
	Corrosion Protection Materials External	£16.00	
	Cost of Specialist	£255.00	
Total Additional Costs			£271.00
Grand Total Excl VAT			£5,389.88
	VAT @ 20 %		£1,077.98
Grand Total Incl VAT			£6,467.86
	Excess		TBA

Assessment Notes

No assessment notes entered.