WhiteWater
WATER & WASTEWATER SOLUTIONS
253B Worcester Road, Charlton MA 01507
Phone: 888-377-7678 / Fax 508-248-2895

April 12th, 2013

Mr. George Zoto
MA DEP Southeast Regional Office
20 Riverside Drive
Lakeville MA 02347

Re: **Sanitary Survey Response and Documentation**
Facility Location: Corn Hill Condominiums - Truro
PWS ID#: 4300027

Dear Mr. Zoto:

Please find enclosed a copy of the Sanitary Survey Compliance Plan Response Form with supporting documentation for Corn Hill Condominiums in Truro. Listed below are the deficiencies that were found and the date that they were completed.

Table B- Deficiencies:

1. **Hose-Bib Vacuum Breaker Installation:** This was completed on 3/22/13. Hose-Bib Vacuum Breakers were installed on all the threaded faucets without built-in vacuum breakers. Please see the attached picture.

2. **Update Total Coliform Sampling Plan:** This was completed on 1/9/13. The plan has been updated to show sampling sites for two distribution sites. Please see attached plan and sampling map.

3. **Lock Pit:** This has not been completed yet. WWI has been in contact with a representative from the association who has contacted their property management company to make repairs to the roof hatch and install a lock by the end of April 2013. WWI will submit documentation upon its completion.

Table C- Recommendations

1. **Ensure Adequate Pressure:** This was completed on 4/5/13. Atlantic Well of Eastham has installed a constant pressure controller to maintain pressure at around psi during peak demand. Every time water is being used the controller will activate the pumps.

2. **New Roof for Pit:** Please see number three under Table- B Deficiencies.

Should you have any question, please feel free to contact our office at 888-377-7678.

Respectfully yours,
WHITEWATER, INC.

Roy A. Maher
Operations Supervisor

cc: Terry Dayian, MA DEP SERO
Truro Health Department
Russell Tierney, Northeast Regional Manager Water Operations, WWI
Vijay Jain, WWI
Marcus Thompson, WWI

MassDEP Drinking Water Program - SERO
COLIFORM SAMPLING PLAN
Small Systems – Quarterly (population <1,000)

Please fill in the highlighted areas and return for approval to your DEP Regional Office

PWS ID#: **4300027** PWS Name: **Corn Hill Condominiums** PWS Town: **Truro**

Population Winter: **0** *# RS Winter samples:* **0**	Population Summer: **45** *# RS Summer samples:* **2**	TANKS: **N/A** *# RS Tank samples:* **0**

# RS Winter + # RS Tanks = **(RS)** samples required for Winter:	**0**	per	**Quarter**
# RS Summer + # RS Tanks = **(RS)** samples required for Summer:	**2**	per	**Quarter**
No. of raw water **(RW)** samples required:	**0**	per	**Quarter**
No. of plant tap **(PT)** samples required:	**0**	per	**Quarter**
TOTAL Number of Samples Required Winter (RS + PT +RW):	**0**	per	**Quarter**
TOTAL Number of Samples Req. Summer (RS + PT + RW):	**2**	per	**Quarter**

* Sample Type, Sample Code#, and DEP Approved Sample Site must correspond to the sample columns on the DEP Total Coliform Report Form

Sample Type*		Sample Code#*		DEP Approved Sample Site* Sampling Point Name and/or Street Address		Sampling Frequency		
RS		**001**		**Unit 6 Spigot**		**1**	per	**Quarter**
UR		**1a**		**Unit 12 Spigot**				
DR		**1b**		**Unit 17 Spigot**				
AR		**1c**		**Unit 8 Spigot**				
RS		**002**		**Unit 19 Spigot**		**1**	per	**Quarter**
UR		**2a**		**Unit 19 Bathroom**				
DR		**2b**		**Unit 19 Kitchen**				
AR		**2c**		**Unit 19 Spigot**				

Key to Sample Type Codes			
RS	Routine Sample site	(tap representative of the water system)	Example **Sample Code # 001**
UR	Upstream Repeat sample site	(tap upline of the RS sample tap)	Example **Sample Code # 1a**
DR	Downstream Repeat sample site	(tap downline of the RS sample tap)	Example **Sample Code # 1b**
AR	Additional Repeat sample site	(additional tap representative of the water system)	Example **Sample Code # 1c**
RW	Raw Water sample site	(untreated source water)	Example **Sample Code # RW-01G, RW-01S etc.**
PT	Plant Tap sample site	(entry point-finished (treated) water sample tap)	Example **Sample Code # 10000, 10001, etc.**

Also attach a map or sketch of your water supply distribution system showing the locations of the bacteria sampling sites, wells, and storage tanks.

Public Water Supplier Signature: Roy A. Walker DATE: 01/09/13

For DEP/DWP use

Total # of bacteria samples required per 310 CMR 22.05 _____per _____.

Action: _____ Date: _____

DWP Name: _____Signature: _____

Corn Hill Condominiums
Truro, MA
PWSID# 4300027
Unit 19 002RS, 2aUR, 2bDR, 2cAR
Unit 8 1c AR
Wells
Unit 6 001 RS
Unit 17 1b DR
Unit 12 1a UR
Google earth
Imagery Date: 3/11/2012 42°00'11.81" N 70°04'47.97" W elev 111 ft eye alt 1233 ft

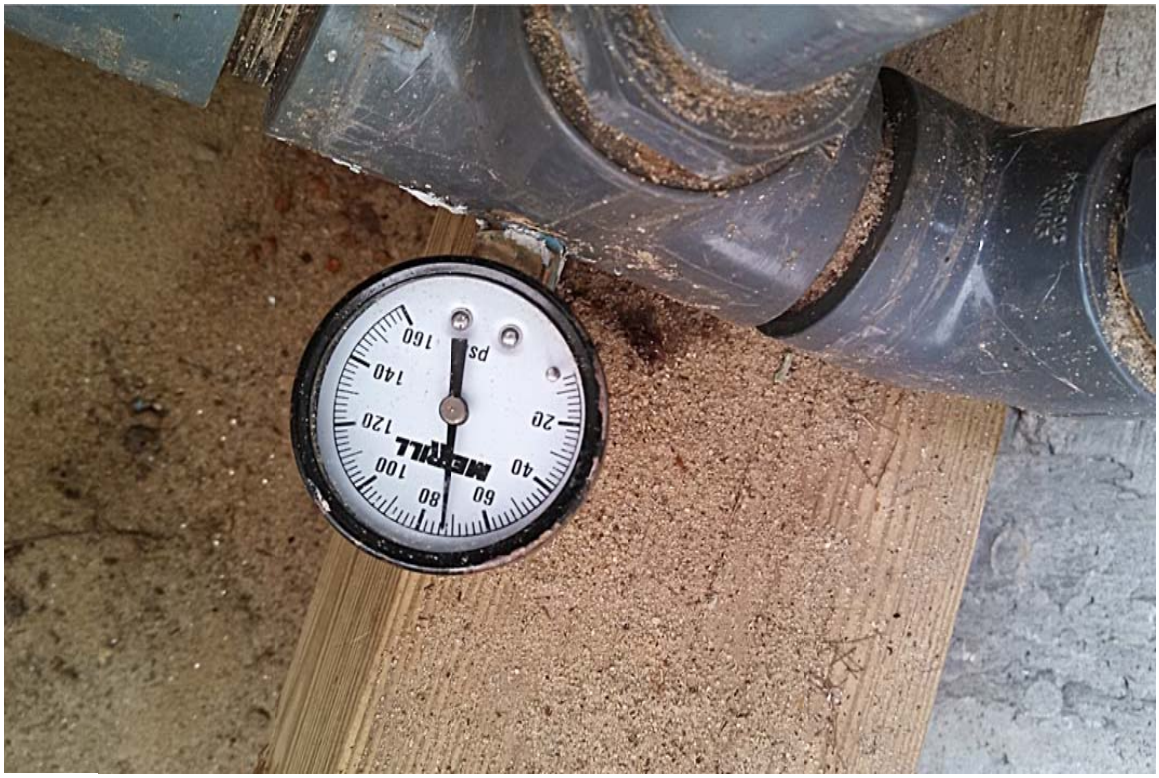
PSI
20
40
60
80
100
120
140
160

Franklin Electric
SubDrive 150
CONSTANT
PRESSURE
CONTROLLER
Franklin Electric
POWER/ALIMENTÉ/ENCENDIDO
FAULT/ERREUR/FALLA
CALL
Atlantic
WELL DRILLING
508-255-1211
FOR SERVICE
Access/Access/Acceso

Corn Hill Condominiums
PWSID 4300027

Sanitary Survey: July 3, 2012

SANITARY SURVEY COMPLIANCE PLAN RESPONSE FORM for TABLE A & B

Within 30 days of receipt of this inspection report, you must complete and submit this response form if your system has TABLE A –Violations and/or TABLE B-Deficiencies. Attach a copy of the completed tables listing the date that the corrective action was or will be taken by your system and all other applicable documentation. (310 CMR 22.04(12))

Please note that violations listed in TABLE A of the Compliance Plan are also a Notice of Noncompliance (NON) pursuant to M.G.L. c.21A, §16 and 310 C.M.R. 5.00 and may require the submission of quarterly written progress reports on the identified violations.

The following corrective actions listed in the Sanitary Survey Compliance Plan(s) TABLE A and/or B has been taken by the public water system. (Please check all that apply).

☐ My system has taken **ALL** of the corrective actions listed within the timeframes specified in the Sanitary Survey Compliance Plan(s).
For each item, I have listed the completion date of the corrective action within each table.
I have attached copies of supporting documentation as required.

☑ My system has taken **SOME BUT NOT ALL** of the corrective actions listed within the timeframes specified in the Sanitary Survey Compliance Plan(s). My system **HAS NOT** complied with **ALL** of the requirements set forth in the Sanitary Survey Compliance Plan(s).
For each item, I have listed the actual or anticipated completion date of the corrective action within each table.
I have attached copies of supporting documentation as required.
I have attached a revised corrective action schedule establishing timelines for my system to address outstanding items and I will submit a written progress report each quarter (every 3 months) until all items have been addressed, at which time written documentation of completion shall be submitted to the Department. I understand that my system may be subject to further enforcement action.

☐ My system is **UNABLE** to comply with some or all of the corrective actions within the timeframes specified in the Sanitary Survey Compliance Plan(s). I understand that my system may be subject to further enforcement action.
An explanation is attached.

I hereby acknowledge receipt of the inspection findings and compliance plan table(s) of the sanitary survey conducted by the Department of Environmental Protection's Drinking Water Program. I certify that under penalty of law I am the person authorized to fill out this form and the information contained herein is true, accurate and complete to the best of my knowledge and belief.

Water Commissioner, Owner, Owner Representative or Other Responsible Party:

Signature: Roy M Maher Date: 4/12/13

Print Name: Roy Maher Title: Operations Supervisor

Return this form, a copy of each Compliance Plan Table and all attachments to:
DEP-BRP Drinking Water Program,
50 Riverside Drive, Lakeville, MA 02347
Attn: George Zoto