

AI · 300+ POINT INSPECTION

Complete Vehicle Inspection Report

A comprehensive 360° pre-purchase inspection combining certified inspector checks with AI-assisted diagnostics — so you can buy with complete confidence.

98/100

OVERALL AI
VEHICLE
SCORE

Excellent · Buy

The vehicle is in excellent overall condition, with all major functions operating normally. A few minor exterior scratches were observed, along with a single scratch on the sunroof glass. A slight alignment/gap issue was also noted between the connecting tail lamps. Apart from these minor observations, the vehicle is in very good condition and all other inspected components are functioning properly.

Booking ID

Vehicle

MG Hector Plus

Inspection Date

Location

Yelahanka

SUMMARY

Inspection Summary

Overall AI-assisted health score based on 300+ inspection checkpoints across exterior, mechanical, electrical and document verification.

98

OUT OF 100

Excellent · Buy

BOOKED

2026-08-28

COMPLETED

2026-08-28

PACKAGE

Pre-Drive

FUEL TYPE

Petrol

MANUFACTURED

2026

OWNER COUNT

0 Owners

CATEGORY BREAKDOWN

- Exterior

Completely inspected body structure, panels, and paint finish. the condition with detailed photos captured in the report
- Tyres

All 4 tyres and spare wheel thoroughly inspected for tread depth, sidewall condition, and manufacturing date. In good roadworthy condition.
- Brakes

Brake pads, rotors, pedal travel, and handbrake efficiency tested. Operating smoothly with optimal stopping power.
- Underbody

Underbody and chassis frame inspected. Floor pan, silencer, and lower crossmembers show no major rust or scraping.
- Engine Analysis

Engine idle, sound, mounting vibration, oil quality, and coolant level thoroughly checked. Operates clean with no abnormal noise.
- Interior

Seats, upholstery, dashboard console, switches, and seatbelts inspected. All cabin controls and trims in clean, functioning order.
- Lighting

Headlamps, high/low beam, tail lights, indicators, fog lamps, and cabin dome lights tested and operational.
- AC

Air conditioning compressor engagement, blower speed, vent airflow, and cooling temperature performance verified optimal.
- Suspension

Front struts, rear shock absorbers, bush arm condition visually inspected
- Gear & Transmission

Smooth gear transitions.
- Inspection Info

Comprehensive 300+ point inspection conducted at yard by certified technician with full photo verification.
- Vahan Info

New Car PDI

ANOMALY CHECKS

Insurance & Ownership

Insurance Status

Insurance validity not available or expired.

Vehicle Ownership

0 previous owners.

PUC Status

Not available in Parivahan. Check locally.

Dent / Tamper Check

No VIN plate or registration mismatches found.

NEGOTIATION TIPS

AI Price Negotiation Suggestions

Based on detected defects, here is the estimated room for negotiation with the seller.

Glass & Mirrors — Sunroof glass condition

1 item(s) require attention.

₹3,000
SUGGESTED CUT

Total suggested negotiation room

₹3,000

ADDITIONAL AI CHECKS

Engine Calibration

No active or pending diagnostic trouble codes found.

Tyre Analysis

Tyre condition assessment based on inspection data.

Service History

New car PDI

Market Price Analysis

New car PDI

VAHAN VERIFICATION

Owner Details

Name	Withheld for privacy	Present Address	Withheld for privacy
Father's Name	Withheld for privacy	Permanent Address	Withheld for privacy
Phone	Withheld for privacy	Owner Count	0 Owners
Ownership Type	Individual	Registration Authority	NA

Vehicle Details

Make & Model	MG Hector Plus	Fuel Type	Petrol
Registration Number	New Car	Body Type	Saloon
Registration Date	—	Odometer (at inspection)	15 km
Manufacturing Year	2026	Seat Capacity	—
Engine Number	[REDACTED]	Insurance Valid Till	—
Chassis / VIN	MZ [REDACTED]	PUC Valid Till	—
Color	Celadon Blue	Tax & Fitness Valid Till	—

Insurance

Insurance validity not available or expired. Check locally.

Pollution Certificate

Not available in Parivahan. Check locally.

Finance Status

Getting verified

Tax & Fitness

Tax & fitness status valid.

REPAIR ESTIMATE

Estimated Repair & Rectification Costs

All figures are indicative estimates based on local market rates.

- Glass
- Exterior

GLASS		
COMPONENT	DESCRIPTION	EST. COST
Sunroof glass condition	Minor Scratch on sunroof	₹1,500 – ₹4,000
Category Total		₹4,000

EXTERIOR		
COMPONENT	DESCRIPTION	EST. COST
Body scratches	Minor Scratches	₹1,500 – ₹2,000
Tail light	Tail light R&R Fix	₹1,500 – ₹2,000
Category Total		₹4,000

Grand Total Estimated Repair Cost	₹8,000
-----------------------------------	--------

SERVICE HISTORY

Vehicle Service Records

Service history sourced from admin-verified records and/or uploaded documents.

Date	Service Center / Dealer	Odometer	Service Type	Description	Cost
------	-------------------------	----------	--------------	-------------	------

No service records available

SUPPORTING DOCUMENTS

PHOTO GALLERY


Vehicle Exterior Overview



Front



Side (Driver)

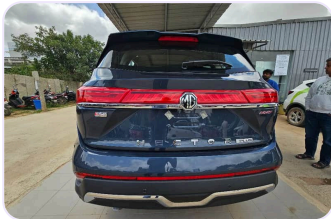


Rear



Side (Passenger)

INSPECTION CHECKPOINTS

Baseline Photos & Docs7 checks		
ITEM	STATUS	NOTES
Exterior Baseline Photos	Pass	
   		
RC Details	Pass	
PUC Certificate	Pass	
Insurance Certificate	Pass	
Interior overview (front & rear)	Pass	
 		
VIN plate & odometer close-ups	Pass	
		
Cluster warning lamps photo (Ignition ON)	Pass	
		

Driving Controls & Driver Aids8 checks		
ITEM	STATUS	NOTES
Steering wheel condition (rim / stitching)	Pass	
Steering free play (static) / adjust	Pass	
Gear selector movement (PRND / pattern)	Pass	
Hand / parking brake	Pass	
Drive mode switch (Eco/Normal/Sport)	Pass	
Pedal rubbers condition	Pass	
Steering-mounted controls	Pass	
Brake pedal feel (static)	Pass	

Exterior Structure & Trim26 checks	
------------------------------------	--

ITEM	STATUS	NOTES
Front Bumper: Defects	Pass	
Front Bumper: Fitment	Pass	
Hood/Bonnet: Defects	Pass	
Hood/Bonnet: Fitment	Pass	
Roof: Defects	Pass	
Roof: Fitment	Pass	
Front grille condition	Pass	
Emblems / Badges present & correct	Pass	
Fender Left: Defects	Pass	
Door Front Left: Defects	Pass	
Door Rear Left: Defects	Warn	Scratches
		
Quarter Left: Defects	Warn	Scratches
		
Running Board Left	Pass	
Rear Bumper: Defects	Pass	
Rear Bumper: Fitment	Pass	
Fender Right: Defects	Pass	
Door Front Right: Defects	Pass	
Door Rear Right: Defects	Pass	
Running Board Right	Pass	
Rear Right door handle: physical	Pass	
VIN plate / rivets tamper signs	Pass	
Fender / Door / Quarter / Pillar fitment (L & R)	Pass	
Trunk / Tailgate: Defects & Fitment	Warn	There is gap in between Connecting Tail Light - Left
		
Fuel lid / door condition & hinge	Pass	
Left / Right ORVM housing condition	Pass	
Modification	Pass	

Glass & Mirrors			11 checks
ITEM	STATUS	NOTES	
Check all glass MFD	Pass		
Front windshield: chips / cracks	Pass		
Front windshield: wiper-arc scratches / haze	Pass		
Front windshield seal / garnish condition	Pass		
Left / Right ORVM mirror glass	Pass		
FL / FR door window glass condition	Pass		
RL / RR door window glass condition	Pass		
Rear windshield: chips / cracks	Pass		

Rear defogger lines (continuity)	Pass	
Rear windshield seal / garnish condition	Pass	
Sunroof glass condition	Warn	Minor Scratch on sunroof
		

Interior Electricals & HVAC9 checks		
ITEM	STATUS	NOTES
Cabin lights (front & rear rows)	Pass	
Window & lock switches (all doors)	Pass	
Touchscreen, audio, Bluetooth / USB / FM	Pass	
Reverse camera / parking sensors	Pass	
AC cooling at center vents	Pass	
Heater output	Pass	
AC odour on start	Pass	
Wiper controls, horn, hazard / defogger switches	Pass	
Cluster warning lamps status (Ignition ON)	Pass	
		

Interior Trim & Fixtures7 checks		
ITEM	STATUS	NOTES
Front & rear seats: cushioning, upholstery, adjustments, seatbelts	Pass	
2nd & 3rd row: fold / slide / tumble access	Pass	
Dashboard panels & instrument cluster lens	Pass	
Carpet fitment & cleanliness	Pass	
Roof lining condition	Pass	
Glovebox, center console & door pockets	Pass	
Interior rear-view mirror (mount / flip)	Pass	

Lighting6 checks		
ITEM	STATUS	NOTES
Headlamps (low / high)	Pass	
DRL / Parking lights	Pass	
Indicators / hazards	Pass	
Brake lights (incl. CHMSL)	Pass	
Reverse lights	Pass	
Fog lamps (front / rear)	Pass	

OBD / Engine Scan3 checks		
ITEM	STATUS	NOTES
Error Code	N/A	
idle RPM	N/A	Normal
Charging Volt	N/A	

Paint Thickness Assessment15 checks		
ITEM	STATUS	NOTES

Front Bumper	Pass
Hood/Bonnet	Pass
Roof	Pass
Fender Left	Pass
Door Front Left	Pass
Door Rear Left	Pass
Quarter Left	Pass
Pillars Left (A/B/C)	Pass
Rear Bumper	Pass
Trunk/Tailgate	Pass
Fender Right	Pass
Door Front Right	Pass
Door Rear Right	Pass
Quarter Right	Pass
Pillars Right (A/B/C)	Pass

Tyre Data			5 checks
ITEM	STATUS	NOTES	
Tyre — Front Left (FL)	Pass		
Tyre — Front Right (FR)	Pass		
Tyre — Rear Left (RL)	Pass		
Tyre — Rear Right (RR)	Pass		
Spare Tyre	Pass		

Tyres, Wheels & Brakes			9 checks
ITEM	STATUS	NOTES	
Tyre valve / nozzle — FL	Pass		
Tyre valve / nozzle — FR / RL	Pass		
Tyre sidewall / tread defects (all 4)	Pass		
Wheel rim condition (all 4)	Pass		
			
Mud / silt under carpets (front & rear)	Pass		
Seat rail rust / pitting	Pass		
Under-dash wiring oxidation / green patina	Pass		
Brake rotor visual (lip / scoring)	Pass		
Brake pad visual (thickness)	Pass		

Under Hood — Engine OFF			10 checks
ITEM	STATUS	NOTES	
Oil level / condition	Pass		
Visible oil leakage	Pass		
Battery terminals & hold-down	Pass		
Belts visual (cracks / fray)	Pass		
Coolant reservoir / brake fluid level	Pass		
Washer fluid level	Pass		
Visible wiring / hoses condition	Pass		

Battery resting voltage (engine OFF)	Pass
Engine mounts visual condition	Pass
Power steering fluid level	N/A

Under Hood — Engine ON			8 checks
ITEM	STATUS	NOTES	
Back compression (oil spill)	Pass		
unusual Noise from engine	Pass		
Idle quality / vibration	Pass		
Idle RPM (spec)	Pass		
Cooling fan operation	Pass		
Accessory belt noises	Pass		
Visible leaks at idle	Pass		
Charging voltage (idle, lights & AC ON)	Pass		

Water / Accident Exposure			9 checks
ITEM	STATUS	NOTES	
Trunk / spare well moisture or smell	Pass		
Door drain holes clear	Pass		
Headlamp / taillamp condensation	Pass		
Engine bay mud / rust at lower members	Pass		
Wiring / fusebox water marks	Pass		
Underbody waterline / oxidation patterns	Pass		
Structural welds / overspray / panel replacement signs	Pass		
Seat mount bolts & seat base waterline	Pass		
Trunk side cavities / quarter pockets moisture	Pass		

TYRE DATA

Tyre Specification & Condition

Position	Brand / Model	Size	DOT (Wk/Yr)	Tread	Tread Condition	Sidewall
Front Left (FL)	GOODYEAR Efficient Grip	215/55/R18	W23/26	7.6 mm	New (>8mm)	Good
Front Right (FR)	GOODYEAR Efficient Grip	215/55/R18	W22/26	7.6 mm	New (>8mm)	Good
Rear Left (RL)	GOODYEAR Efficient Grip	215/55/R18	W23/26	7.6 mm	New (>8mm)	Good
Rear Right (RR)	GOODYEAR Efficient Grip	215/55/R18	W23/26	7.6 mm	New (>8mm)	Good



Spare Tyre
Condition: Good | Size: 215/55/18

OVERALL TYRE ASSESSMENT

GOODYEAR - Efficient Grip - June 2026 - Unused

ADMIN REMARKS

Inspector Notes & Recommendations

INSPECTOR NOTES

Details are updated with photos


ADMIN REMARKS

—

FINAL RECOMMENDATION

The vehicle is in excellent overall condition, with all major functions operating normally. A few minor exterior scratches were observed, along with a single scratch on the sunroof glass. A slight alignment/gap issue was also noted between the connecting tail lamps. Apart from these minor observations, the vehicle is in very good condition and all other inspected components are functioning properly.

Disclaimer: This report is prepared by InspectCar based on a physical visual and functional inspection performed at the time and location mentioned. InspectCar does not guarantee the future performance of the vehicle. The report reflects the condition of the vehicle at the time of inspection only and should not be used as a substitute for professional mechanical advice. InspectCar holds no liability for any decisions made based on this report.



InspectCar

Need help understanding this report?

Our certified inspector is available to walk you through every detail of this inspection and help you make the right decision.

 **Chat with Inspector on WhatsApp**

WhatsApp: +91 9900368006 • Email: info@inspectcar.in • Website: inspectcar.in

