


DESCRIPTION		FOR ISSUE				
REV	DATE	BY	CHKD	APPD		
4	27/07/07	JR	GS	PP		

* MINIMUM DISTANCE BETWEEN FACE OF EXCAVATION & STRUCTURE TO ALLOW ACCESS TO PLACE GRANULAR FILL & COMPACT

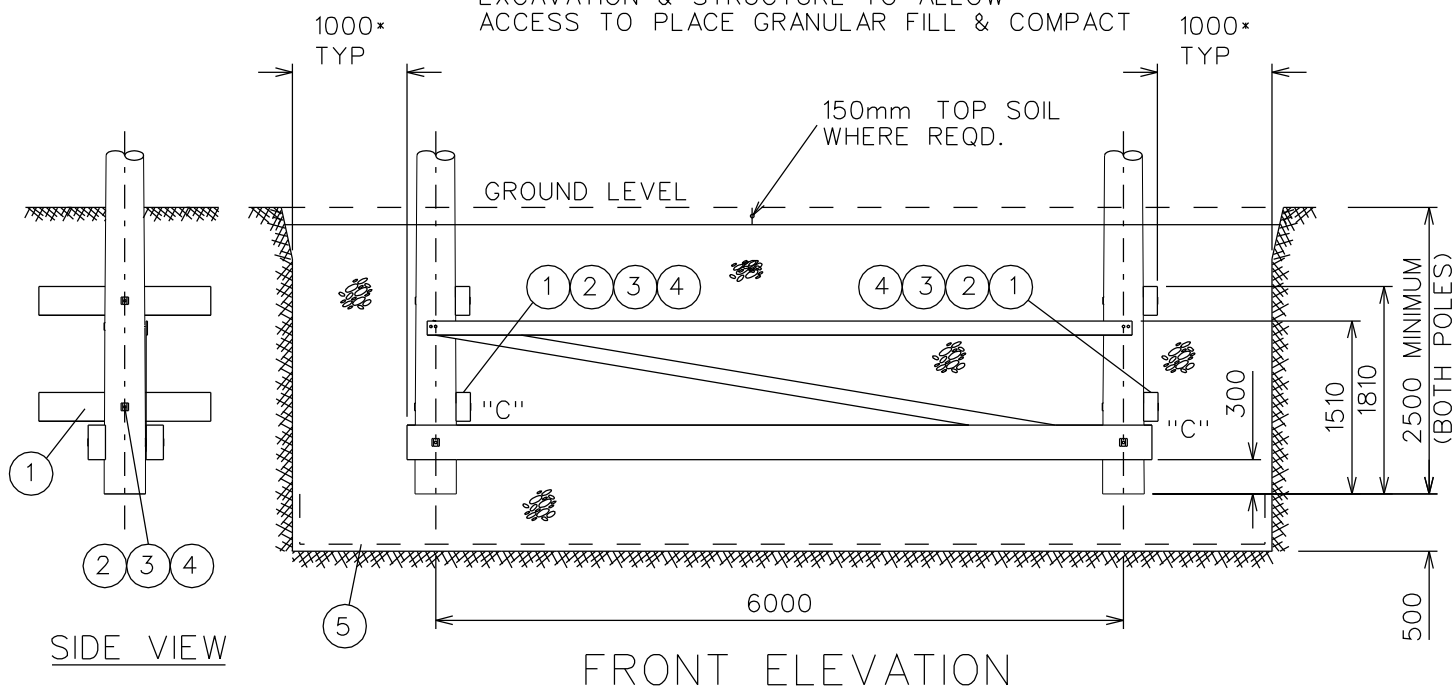

ITEM - DESCRIPTION	REFERENCE No.	QTY REQ'D	WEIGHT EACH (Kg)	REMARKS
1 Foundation Block	LSTC/STD/PAR/602	2	40	Foundation Block "C" in addition to LSTC/STD/GNA/527
2 M20 Bolts x Length To Suit Pole Diameter	LSTC/STD/GNA/555	2	0.5	M20 Bolts to attach additional Foundation Block "C"
3 Square Flat Washer	LSTC/STD/PAR/619	2	0.1	
4 Square Curved Washer	LSTC/STD/PAR/620	2	0.2	
5 Geotextile Membrane		1	--	Place in Bottom of Excavation Prior to Granular Backfill
Total Additional Calculated Weight = 82Kg				

GENERAL NOTES:

- ALL STEELWORK TO BE PROTOTYPE CHECK ERECTED PRIOR TO MASS PRODUCTION.
- ALL DIMENSIONS ARE IN MILLIMETRES.
- NO ADDITIONAL ITEMS REQUIRED WHEN "VERY POOR" SOIL CONDITIONS ARE ENCOUNTERED. FOUNDATIONS TO HAVE MINIMUM EMBEDMENT DEPTH OF 2.5M.
TO BE READ IN CONJUNCTION WITH:
LSTC/STD/GNA/527: FAILURE CONTAINMENT WOOD POLE
LSTC/STD/GNA/529: MATERIAL LIST
LSTC/STD/GNA/555: BOLT LENGTH DETERMINATION
- IMPORTANT: REFER TO LSTC/STD/GNA/779 SHEETS 1 TO 4 FOR FOUNDATION DESIGN CRITERIA.

SHT 1 : SOIL CLASSIFICATIONS & POLE EMBEDMENT DETAILS.
SHT 2 : FOUNDATION DETAILS / STRUCTURE TYPES.
SHT 3 : FACTORS OF SAFETY.
SHT 4 : OUTLINE DESIGN FOR "VERY POOR" SOIL FOUNDATIONS.

CLIENT PowerSystems	TITLE ADDITIONAL MATERIAL FAILURE CONTAINMENT WOOD POLE VERY POOR SOIL CONDITIONS	SCALE 1:65 (UNLESS OTHERWISE STATED)	ORIGINAL SIZE A4		LSTC North: Yorkshire House York Road Little Driffield East Yorkshire YO25 5XA Tel 01377 253617 Fax 01377 259555	LSTC South: Bourne House Office 21 475 Godstone Road Whyteleafe Surrey CR3 0BL Tel 01883 621114
		DATE 27/07/07	CHECKED GS			
SPECIFICATION OHL-03-132		DRAWN JR	APPROVED PP			
		DRAWING NUMBER LSTC/STD/GNA/812	REV 4			